MX 7172114 2

COMPUTER AIDED FACTORY LAYOUT PLANNING

(CAFLAP)

Bohumil Augustin K o b l i h a

A thesis submitted to the C.N.A.A. in partial fulfilment
of the requirements for the degree of Doctor of Philosophy.

Faculty of Engineering, Science and Mathematics

M I D D L E S E X   P O L Y T E C H I C

JULY 1988

B. A. K O B L I H A

Computer Aided Factory Layout Planning (CAFLAP)

A B S T R A C T

This Thesis addresses Factory Layout Problems, and reviews and evaluates the available layout techniques.

Manufacturing as a system has been studied and reclassified for factory layout: space demands and spatial relationships have been considered as main principles of Factory Layout Planning. This forms a basis for the introduction of a new, more efficient Factory Layout Planning Methodology, denoted as SPACE MANAGEMENT. A new COMPUTER AIDED FACTORY LAYOUT PLANNING system is formulated as a tool for:

- preparing 3-D templates of Work Station Modules and Equipment Modules;

- drawing a requested interior of an industrial hall/bay in 3-D;

- positioning any 'objects' (spaces), via manual interactive programs in 3-D;

- automatic positioning of work stations and equipment in the bay, in 'technological' order (in 3-D), using an automatic positioning program, with a facility for:
    collision course finding (with objects within the bay),
    manual override for corrections, and
    finding an optimum size (width) of the bay.

The resulting layout scene can be observed from any required position and distance.

The system includes a set of auxiliary programs for Manual Feeding of lines of work stations in 'technological' order and for basic capacity calculations.

CAFLAP also opens a new way of economic evaluation of projects and alternatives.

CAFLAP is implemented in FORTRAN 77 and uses the Computer Graphics System PICASO.

ACKNOWLEDGEMENTS

CONTENTS

1. INTRODUCTION

The purposeful arrangement of machine tools and equipment on the shop floor is of equal importance for competitive manufacturing as machining itself. It is very well documented in history how the wealth of nations grows as their manufacturing standards improve. A very good example of this is the Republic of Venice [7]. Manufacturing was one of the pillars of the Republic's success, and was so advanced that in 1474 it led to the enactment of the first formal patent law. The "heart of the state of Venice" was the Arsenal [24]. Here was also the largest centre of production and the greatest concentration of workmen before the industrial revolution. The plans of the Arsenal, founded in 1104, were in fact an early example of planned plant layout!

'Plant Layout' and 'Factory Layout Planning' are terms (see Appendix I-1) most commonly used for labelling activities concerned with a feasible location of manufacturing or processing facilities in a suitable region, site, complex of buildings, industrial hall and finally in an industrial bay.

By definition, 'Plant Layout' is the most effective arrangement and coordination of the physical plant facilities, to allow greatest efficiency in the combination of man, materials, machines and equipment necessary for the

operation of any unit of a plant or business [1]. 'The activity in Factory Layout Planning could be expressed symbolically as in Fig.1.

ACTIVITY

{ M A N
  M A T E R I A L S
  M A C H I N E S and E Q U I P M E N T

E F F I C I E N T   O P E R A T I O N
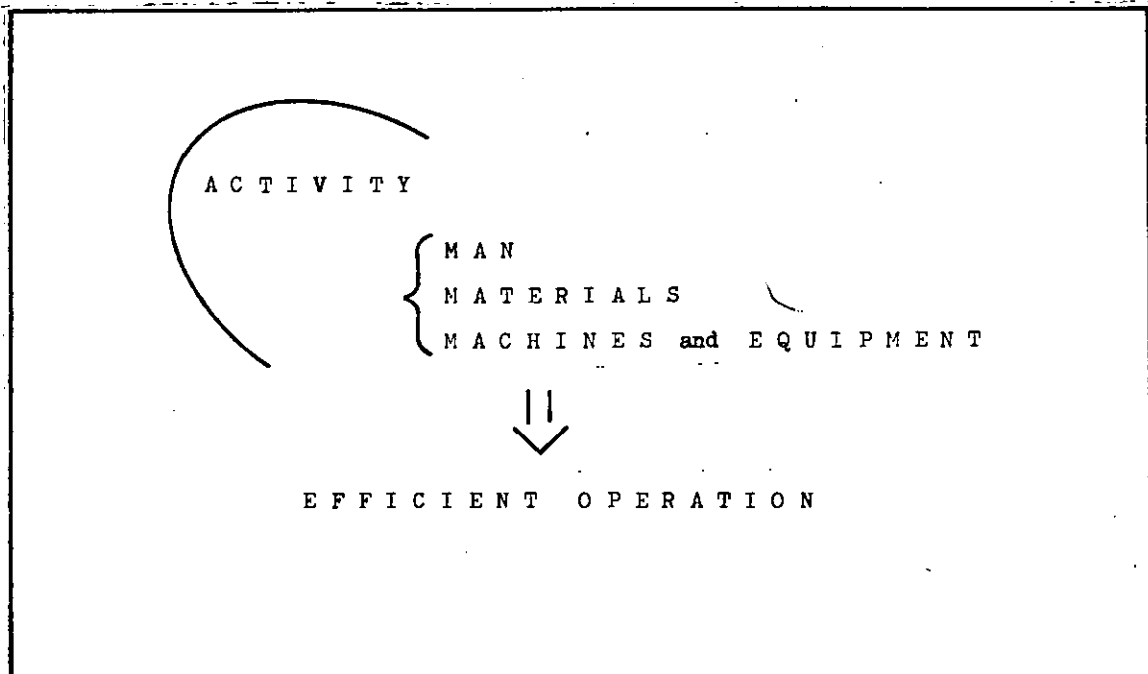
Fig. 1. ACTIVITY IN FACTORY LAYOUT PLANNING
RESULTS IN EFFICIENT OPERATION

As the main interest of this project is focused on mechanical engineering manufacturing, the term Factory Layout Planning [22] has been chosen. This term also clearly distinguishes activities in mechanical engineering production from chemical and other similarly specialised plants (i.e. food processing, earth products etc.), and from the design of individual equipment.

Factory Layout Planning is closely interrelated with

Mechanical Engineering, Production Engineering, Mechanical Technology, Material Handling, Management and Organisation, Industrial Psychology and Sociology, Civil Engineering, Architecture and Town Planning on one side, and with Ventilation and Heating, and Electrical Engineering etc., on the other side. The requirements and demands of these professions together with legislative measures like the Health and Safety Act, and the regulations of the Ministry of Defence, Ministry of Transport and Civil Aviation can be very restrictive. Further factors related to the protection of nature, springs and water, historic monuments, etc., have to be carefully considered, and can sometimes, even become ruling factors in Factory Layout Planning. All that is indispensable, as the construction of a new plant or modernisation and reconstruction of an older factory may have a substantial influence on the environment and on the lives of the inhabitants within a relatively large area.

In Factory Layout Planning there are usually two main types of situation to be encountered:
- The change of layout within an existing factory,
or
- A layout for a new factory on a 'green field site'.

In the first case the object is to try to utilise the existing areas in the most economical manner in order to accommodate efficient production. In the second case, the civil engineering part can be designed to fit exactly the

technological needs. These two different situations can result in a different emphasis in layout techniques. ⱽ

Other situations and complications follow from the type of manufacturing/production (single product, multi-product, parallel) and from the further division of production according to the quantity of products to be manufactured e.g. job production, batch production, flow production and mass production.

The type of production usually conditions the type of layout, i.e.:

- Process (or Functional) Layout,
  where the main factor for work stations arrangement
  is considered to be the technological process
  (similarity of operations, e.g. drilling machines
  in one area, milling machines in another area, etc.,
  often creating departments, i.e. milling department,
  drilling department, etc.).

- Product (or Line) Layout,
  where the main factor for work stations arrangement
  is the product. Work stations are arranged to suit
  the sequences of operations (e.g. prodn. line). [1]

  As a special sub-group could be considered Group
  Layout (Group Technology and Flexible
  Manufacturing Systems).

- Fixed-Position Layout,

    where the product is stationary and material,

    men and equipment are brought together

    to work on the product (ships, bridges).`

The initial considerations and calculations for new layout
very often form the basis for the long-term prosperity of
the whole company. A plant must be profitable and and the
profit must be maximised, so that the plant layout
/consulting engineer has to approach the task with this in
mind and take care to avoid any possible losses in future,
which may affect not only the investor, but the public as
well. Therefore the future situation must be assessed
already in the preliminary stage.`

Here the layout engineer faces a dilemma. At this stage he
is not in possession of sufficient amount of data and
information of requested accuracy and depth to design a new
layout. But still, the decision making must be as precise
as possible. In some cases even the most essential
information, e.g. the volume of production, is lacking and
must be acquired by the engineer via an analysis of
statistics, typical products, indirect indicators, and
qualified guesses. The technique of Typical Products is
used when there is a lack of information regarding the
future actual products. Typical products have similar
specifications and characteristics to those of the future

planned products.

As this is a very demanding exercise, some companies and consulting engineering firms have developed up to five stages of project to avoid losses. For example, the Ford Motor Company has three 'project' stages: Programme Study, Study, and Project.(This will be dicussed later in Chapter 2.)

In this complicated situation it ·is quite difficult to find a way to ease the work of the Factory Layout Planning Engineer. According to Francis and White [16] (published in 1974!) there were some five hundred papers written on the topic.

Moor in his survey [30] in the same year (1974) analysed twenty five programs and concluded that the layout planner must still do almost all the adjustments. He considered the facility design problems to be complex and ill-structured, and as such they were handled in a variety of ways, such as: total enumeration, computerised techniques, interactive programming, heuristic programming and by intelligent machines. He also observed that a great majority of programs fell into the construction or improvement class, only five programs were found to fit into graph theory or other[30- Fig.3].

Lewis and Block [32] in 1980 noted that 'despite much

research activity there is widespread failure to use available computer programs for planning the layout of manufacturing facilities'.

According to Lewis and Block this happened for two reasons: opinion that an experienced planner can produce acceptable layout based on his own subjective judgement; and ignorance of the potential benefits of computer-aided techniques.

The writer's own experience from Ford-Dagenham, Plant Layout Department (1973-75) was similar to that of Lewis and Block, but the reasons for the failure to use computer programs are seen differently. There were serious attempts made at Ford's to use the programs available at that time, but these failed to help efficiently in practical plant layout work. The main reason could be seen in the fact that the programs were covering only a tiny portion of the planner's tasks. The manual method of templates on 'skins' (see Appendix I-12) continued in use instead, until 1987 as documented by Mike Farish [33] (See Chapter 3.).

In the second half of the seventies the number of published work titles on Factory Layout Planning seems to have dropped. However between 1980 and 1988, there were over forty new titles in the field (according to Applied Science and Technology Index, January 1980-March 1988). Contrary to Moor's survey findings and his classification [30] it seems

that some entirely new aids are now appearing combining simulation and computer graphics, for example Hollocks [25]; and interactive computer graphics, for example O'Brien and Barr [34] (See Chapter 3.).

The present work introducing Computer Aided Factory Layout Planning (CAFLAP) also uses interactive computer graphics principles. Moreover CAFLAP is pioneering some new principles of layout planning (3-D space management), which are used in combination with computer graphics in order to assist the layout engineer in a more creative way mainly in detailed layout planning.

CAFLAP offers planners a very simple, cheap and easy-to-learn-and-use practical tool for everyday layout work; a tool which would be always available for any production engineer or planner to use as and when the need occurs.

2. FACTORY LAYOUT PLANNING AND EXISTING TECHNIQUES

2.1 FACTORY LAYOUT PLANNING

According to Reed [1] a good factory layout should satisfy the following basic requirements:

- Improvement of the manufacturing process
- Improvement of Material Handling (M.H.)
- Most effective use of available area
- Improved utilisation of labour
- Improved efficiency in plant services
- Improved employee morale
- Improved production management, quality and production control
- Minimum capital investment

Main objectives of a good layout could be formulated from experience, using the above as a lead:

- effective and safe operation
- comfortable and safe access to work stations for operation and maintenance
- straight Material Flow
- work stations as close to each other as possible
- work stations positioned in inter-related positions (in straight lines or groups)
- work stations in positions requesting minimum space

in an industrial bay

and

- work stations in positions with no interference
  with other 'spaces' (see 4.2, 4.3 and 4.4).

Observing the situation in Factory Layout Planning Bestwick and Lockyer [3] conclude that "there are a number, and sometimes conflicting requirements, which should be satified" if "most effective arrangement and co-ordination of physical plant facilities" is to be achieved.

In the writer's view there are two different categories of basic requirements': conflicting and complementary.

Considering first the complementary criteria it can be seen that:

Firstly, improvements in the manufacturing process can be achieved if in the layout planning area provisions are made for smoother material flow and reduction of delays. This, projected on the shop floor, can be achieved by improved Material Handling (M.H.). The main generally recognised principle of M.H. is DON'T (i.e.don't move). Apple [35] and others are stressing the importance of elimination of movements. If movements cannot be eliminated they should be simplified, shortened and straightened. Any congestion should be avoided.

These M.H. principles are in agreement with the requirement for closeness of facilities as formulated by Muther [4]. The principles of closeness and reduction of movements are aimed at greater cost effectiveness.

Shorter distances between facilities result in improved utilisation of labour, not only in the M.H. area, but also in manufacturing services; e.g. faster supply of tools (this depends on accessible positioning of Tool Crib).

Secondly, closeness of sufficient facilities for health and welfare (lavatories, drinking water, sitting facilities, rest rooms, etc.) in connection with Health and Safety at Work requirements [36,57] eliminates the excessive Relaxation Allowance [51] and improves the quality of relaxation time for the labour force. These measures directly contribute to employees' contentedness, and this improves their moral. The aesthetic effect of well arranged layout also makes an all round positive contribution.

Thirdly, closeness of facilities is complementary to the requirement of the most effective use of the available (or designed) area, therefore the yield of shop floor space (t/m sq., number of products per m sq., etc.) may be increased. This positively influences capital investment which can be minimised, especially in 'green fields' projects. Size of buildings, and therefore cost of buildings, could be reduced with consequent reduction of cost of maintenance, reduction

of cost of heating, ventilation, lighting and other overheads. The resulting compact layout is more controlable and therefore supports in a better way production management functions; management control, identifying and counting of W.I.P. and products is simplified.

Fourthly, from operation management and utilisation of labour point of view, the achievement of the proper plant layout allows the most effective design of individual operations, the process and the flow.

Fifthly, the achievement of a proper facilities layout incorporating correct inspection locations in the process should positively influence quality control.

Sixthly, layout planned for ease of maintenance allows for the use of maintenance time effectively and reduces personnel requirements.

All of the above complementary criteria show the profitable advantages of proper Factory Layout Planning.

Contrary to this, are conflicting combinations of criteria, which are making the task of the layout planner more difficult. The sources of conflicts occur among the needs of production technology, space requirements, space available and the overriding economic criteria.

Firstly, a conflicting situation may arise between the requirements of an ideal technological position of work stations and the real space of an industrial hall/bay.

For example, a sophisticated calculation [5,6,7,8,9] can recommend positioning work stations in a cluster to achieve the shortest possible distances between them. Theoretically this seems to be a perfect recommendation, but it could prove an unacceptable one if the width of the existing industrial bay cannot accommodate the cluster! In the same way the cluster arrangement may conflict with the spatial demands of Material Handling.

Secondly, a conflict may also arise with the width of the bay when a group or line arrangement of work stations, each of which has a different size, has to be accommodated.

Thirdly, different sizes of work stations in recommended positions may conflict with the requirements for the most economic utilisation of the shop floor area. There could also be a collision of work stations with supports/columns of maintenance steelwork etc.

Fourthly, the interrelated positions of departments, services, stores, tool cribs and the relative positions of foremen, etc., could be sources of conflict.

In order to achieve the best possible results in the final layout it is essential to compromise and establish

priorities. But priorities could vary from case to case and from planner to planner.

From the point of view of overall economy, it is the distance between the interrelated places that plays the main role. It was probably for this reason that most research effort has so far been concentrated on understanding the flow of material, in an attempt to shorten the distance of travel of Work in Progress (W.I.P.) between operations. A number of methods and relationship charts, studying mostly 'from - to' material handling, have been developed. The most widely recognised method is Muther's [4] Systematic Layout Planning. He also gives priority to the closeness of facilities, combined with the importance of relationships among facilities, rated by a unique AEIOUX rating system.

These techniques improve the quality of the layout engineer's work, but have very little impact on his productivity. New ways have only been opened by the wider implementation of computers (see Chapter 3.).

As already mentioned in Chapter 1., each project is usually divided into several project stages. Reasons could be found in the necessity of approval procedures for financing the project, strategic planning, regional planning etc., as well as in technical methodology of approximation, i.e. from theoretical outline ideas of the system, to detailed complex design and installation of the "recommended system" [4, 40].

Another category in Factory Layout Planning are design phases. These are logical steps in layout design methodology and could be seen represented by some well known procedures like Muther's Systematic Layout Planning, Apple's Plant Layout Procedures or Reed's Plant Layout Procedures as summarised by Tomkins and White [39].

The distinguished reality of project stages and design phases as parallel categories is unfortunately not stressed enough in Factory Layout Planning literature. Very often they are intermixed. But for the sake of methodological clarity this should be avoided.

The distinct differences between project stages and design phases could be seen clearly from the following definition and description of project stages; which is then followed (for comparison) by design phases.

Definition of project stages:

Project stages (see Appendix I-2) are graded steps in the preparation of project documents (i.e.reports, calculations, drawings etc.). Each step gradually goes into more depth and detail of factory layout.

In an ideal situation engineers would have the capacity, the time and the information to solve detailed problems in the early stages, as these could often influence the final economic aspects of the project.

To see more clearly the extent of the problem it is useful to describe in outline the project stages:

Stage 1.

FEASIBILITY STUDY (see Appendix I-3) defines the most economical approach to the plant layout. The production programme should be defined at this stage, sometimes with the help of typical products. The main Flow of Material, the number of machines and equipment needed, and the main areas and building(s) required should be established here, as well as manning and services. In drawings main areas and buildings are presented as block layout. A programme of all building and layout works and with the relevant economic considerations should be worked-out. Two or more alternatives are usually considered.

Stage 2.

INVESTMENT PROJECT (Appendix I-4)
studies the size of the main industrial hall(s), dimensions of bays and annexes of the plant; determines the requested production programme and flow of material; designs departments in inter-related positions, but without detailed shop floor layout and the positions of work stations and equipment. In drawings the departments are often presented as more accurately specified block layout. In the case of a new factory on 'green field', a site is selected. As above, two or three alternatives are usually considered.

Stage 3.

PROJECT and WORKING DRAWINGS

In this final project stage (Appendix I-5) all final 'capacity' calculations are made, work stations (machines and equipment) are determined and their positions are fixed in the layout of the defined building.

The project layout drawings show e.g. work stations in realistic shape, with details like anchoring bolts, and position of power supply, electrical accessories, connection to gas, water, coolant supply, etc. The Working Drawings (Appendix I-6) include all the details necessary for work stations installation and any necessary civil engineering works, e.g. if foundations are requested. The industrial halls are positioned in the general layout.

In some commercially and technically complicated cases intermediate stages are introduced, usually after the Investment Project. For example, in an 'Introductory Project' (Appendix I-7) almost everything is defined exept the final and exact position of work stations inside the industrial halls. The intermediate stage is also used when the project and detailed final drawings are prepared in another country where the project is located and local subcontractors are employed. In this way the investor is saving on the cost of design work, using local draftsmen and engineers. He only hires the experts from the consulting firm or supplier who designed the previous stages of the

project. The experts, consulting engineers, supervise local staff and advise on site. This helps to secure higher employment for local people. The experts also pass on the 'know-how', which is very valuable especially for the 'Third World' countries.

\Design phases (represented here by Muther's Phases of Systematic Planning [4]) are following:

Phase I

LOCATION

Determine the location of the area to be laid out.

Phase II.

GENERAL OVERALL LAYOUT

Establish the arrangement of the area to be laid out.

Phase III.

DETAILED LAYOUT PLANS

Locate each specific piece of machinery and equipment.

Phase IV.

INSTALLATION

Plan the installation, seek the approval of the plan, make the necessary physical moves.

To illustrate the difference : In Feasiblity Study it is

not necessary to use all design stages. Overall layout or a block layout in drawing presentation is all that is needed. In the Investment Project the situation would be similar.

The difference in the position of 'Location' in project stages and design phases can easily be seen. Muther [4] places the 'Location' first, while the present work places the 'Location' in project stages, in Stage 2. - Investment Project.

The approach here is different for the following reason: Prior to the selection of any plot or place (location) the main capacity calculations, requirements of areas, and a block layout of facilities have to be completed. The engineer responsible for the selection of a plot must have this information in hand together with details of max.loads (bearing loads) etc., otherwise the selection of the plot cannot be carried out with full responsibility. Not furnishing the information to the engineer could be costly: completly inadequate plot could be selected, which could result in expensive alterations e.g. foundations of heavy machines and building columns might have to be supported by piles etc..

Hence project stages are influencing the activity in design phases. This is apparently the reason why Tompkins and White ([39] - Fig 1.1) are putting their Facility Location in facility planning hierarchy on a completly independent

level and position.

Further, in contemplating the design methodology and procedures only, for every layout, Muther [4] lays down three fundamentals:

Relationships - the relative degree of closeness desired or required among things;

Space - the amount, kind and shape or configuration of the things being laid out;

Adjustment - the arrangement of things into a realistic best fit.

The above three fundamentals have a special place in CAFLAP development.

In CAFLAP, the relationships are seen in dynamic and spatial terms (see 4.2).

From the production point of view, the dynamic/activity relationships are expressed in the 'technological' positioning of work stations to suit best the Flow of Material (requirements of the most economical production).

With the help of Nugent, Wollman and Ruml's [38] ideas, 'Technological' positioning can be defined as the optimal specification of which facilities are to be adjacent in the final layout without regard to the area or shape of the

individual facilities.

The spatial demands are seen as the total amount of spaces to be accommodated in the building, which include the space needed for work stations and equipment, and some other spaces.

NOTE:

Here and in the rest of the thesis the terms 'space' and 'spaces' are used. In 3-D CAFLAP connotations (contrary to Muther's [4] spaces which are actually 2-D areas) they have been used to express the situations and spatial relationships (see 4.2).

The arrangement of work stations and equipment in the 'technological' order and realistic spatial position in an industrial bay, is the main task in Factory Layout Planning. Here also lies a source of conflicting situations and requirements, as dicussed above, and more:

Firstly, the work station itself has to be designed as a safe and comfortable place allowing and supporting all functions of the machine tool or equipment, and effective work of the operator(s). The design itself carries conflicts between safety and the requirements for most effective operation.

Secondly, the requested position of work station in the real

space (building) could be in conflict with maintenance requirements.

Thirdly, the requirement for closeness of facilities could be a trigger for collision among functions, operations and maintenance of other facilities.

CAFLAP has been developed with all this in mind (see Chapter 4.).

2.2 EXISTING TECHNIQUES USED

For the study and design of Activity Relationships and the Flow of Material, a number of methods, mostly charts, have been in use (e.g. From-To charts, REL charts etc.).

On the basis of these charts, in relation to 'technological' (Appendix I-8) positioning of work stations, some computerised methods have been developed. The most important of them are discussed in Chapter 3.

From the point of view of graphical presentation of the arrangement of work stations in work shop situations the Space Relationships are the most important. Here below are outlined the main techniques for design of Space Relationships as historically developed, and as also presented even in the most recent literature ([39]-published in 1984 and [58] published in 1985).

Originally ordinary 2-D drawings were used for Factory Layout Planning. Work station after work station, position after position, had to be drawn individually. This often meant repeating similar shapes and situations, in the same way as in the days of the Venice Arsenal, or in the manner of Michelangelo Buonarroti's civil engineering layouts. There were no facilities to ease the draftsmen's work. This demanding and slow technique was improved by the use of two dimensional templates of work stations. These were either

copied (under tracing paper) into a layout, or held in position by magnetic 'operators' on a magnetic table where a drawing of the industrial hall was fixed. Where the magnetic table technique was used, a photograph of the layout was taken by an overhead camera. This process was repeated after each change, introducing alternative layouts. This technique was much faster than drawing layouts with templates under tracing paper. But all the extra equipment like cameras, special overhead stands, lighting and finally engaging a qualified photographer on the job made this method expensive. Also the extra space needed and time lost by the layout engineer involved, e.g. queuing for the magnetic table and the photography, led to this method being abandoned.

The two dimensional methods had some disadvantages especially when presented to customers or non professional top management lacking knowledge of reading drawings. Also, these methods are not able to show some of the space utilisation problems. Neither are they sufficient for collision course finding among work stations and building, maintenance steel-work, columns footings (foundations), ducts, etc.. Therefore 3-D model 'templates' were introduced.

This 3-D method, deploying wooden, plastic, or metal models, is still in use for some specialised cases, e.g. piping. This, however, is a very slow and expensive method. To

manufacture models of work stations and equipment, usually in 1:50 scale, is a straightforward job if wood or plastic materials are used. But storing and issuing them to layout engineers, as well as the manipulation of models of work stations within a 3-D model of an industrial hall is complicated. Plastic models of work stations, equipment, operators, etc., are usually subcontracted. For wooden models of industrial halls, maintenance steel-work, pipelines, etc., there have to be adjacent workshop facilities. This can be a very undesirable mixture of activities : design work vs. manufacture. According to good engineering practice, and ergonomic and synergetic rules (see 4.2), such activities should be kept separate.

When a 3-D model is finally built, photographs of the arrangement are taken in a similar manner to that needed for the magnetic table method.

With the development of plastic drawing sheets (Mylar) known as 'skins', a relatively very good technique, using 2-D templates fixed after manual positioning by double-sided sellotape, has been invented. This template on 'skins' technique, (see Appendix I-12), enables the engineer to change position of work stations several times to investigate alternatives. The templates of work stations are usually drawn in 1:50 scale on a thinner plastic tracing foil. The 'skins' have a pre-printed grid (250x250mm in 1:50 scale) to ease the positioning of templates. For

buildings, pre-printed sellotapes, indicating walls, etc., are used.

The 'skins' are reproduced in the same way as ordinary tracing paper drawings. These 'skins' remain relatively durable. However, the dust catching residue of the sellotape creates stains. Because of their relative weight and stiffness, the 'skins' are stored hanging in purpose-designed steel cases. Overall ease of manipulation of 'skins', so similar to familiar tracing paper, makes this inexpensive method of producing 2-D layout models, sometimes called 'templates and tapes', very popular. Tompkins and White ([39-published in 1984!) stated:

> "The most common method of creating layout plans
> for larger facilities is to use templates and
> tapes."

Also Konz [58] published in 1985, described this technique in great detail.

Unfortunately none of the above discussed manual methods is fast enough, and none of them assists the layout engineer in the direction of providing economic space utilisation. They do not help in the coordination of layout tasks (system - Hall, Bay, Work Station ... Mechanical, Civil, Piping, Electrical, etc.); nor do they facilitate collision course finding.

All the layout work must currently be carried out intelligently and unaided by the layout engineer. The quality of projects therefore depends on his experience, level of education and ability to consider, assess, and foresee the technological situations in a spatial context. This also requires great engineering imagination!

The methods, described above, show how inadequate are the tools which the layout engineer is using for his highly creative and, at the same time, complicated yet repetitive assignments.

Even in a new factory situation there must be a continuous re-layout and re-arrangement activity in progress [2]. The repetitiveness of layout tasks, the need for changes of layout to be carried out in the shortest possible time, and the requirement for finding the most effective arrangement by consideration of alternative layouts, have led to the development of new methods and techniques in Factory Layout Planning.

3. COMPUTER AIDED SYSTEMS PRESENTLY AVAILABLE

3.1 INTRODUCTION

In order to avoid any duplicity of research and with the view of a possible utilisation of some of the existing computer programs for CAFLAP, an extensive literature search has been undertaken. (See Chapter 10.)

One of the sources quoted is Location and Layout Planning bibliography [48] by Domschke and Drexl, in which the authors include layout planning and any relevant systems in a wide field of "location theory".

According to them, location theory can be divided into macroeconomic and microeconomic location theories.

In macroeconomic location theories industries, economic sectors, etc., are placed 'in space'. The microeconomic location theories are further divided into plant location and plant layout theory.

Publications whose authors regard transportation cost or travel time as main location factors are described in the bibliography as transportation orientated, and of a normative (quantitative) type. This group is further divided into publications dealing with plant location and

those which deal with public facility location problems.

According to Domschke and Drexler the main objective in plant location is to minimize the sum of cost (minisum problem). In public facility location the objective is to minimize the maximum distance, time, etc., which a user of a facility has to accept (minimax problem). Within both types the factor of different distances occurs. Dealing with this there are network orientated models (where the shortest distance between two points is considered - Operation Research), and models assuming that travel takes place on a plane (all points on the plane are potential locations).

Plant layout theories try to optimize the location of facilities within a building or plant, e.g. location factors are studied.

Authors have divided publications on location and layout planning into 13 chosen subjects. (The current work would fit into the class "M"-Thesis). Future trends in the development of the microeconomic location theory are predicted by the authors as mainly concerned with the development of software tools based on computer graphics. (This is the line which CAFLAP follows.)

Nugent, Vollmann and Ruml [38] are considering "the optimal specification of which facilities are to be adjacent in the final layout without regard to the area or shape of the

individual facilities", as most important step in the complete layout process.

With the expansion of the use of computers, many attempts have been made to find the algorithms for the most suitable 'technological' positioning of work stations, related to each other in the sense of the most economic flow of material. Relationship charts of activity areas (based on the flow of material and service departments) have created the basis for a number of computerised methods in Factory Layout Planning.

According to Tompkins and White [39], techniques for computer aided layout may be classified by the method of recording flow among departments and by the method of generating the layout. The flow may be expressed as a quantitative record in a FROM-TO chart, or as a qualitative one recorded in an activity relationship chart.

The method of generating layout may vary from computerised algorithm developing block layout, presented by symbolically marked squares, to computer graphic presentation of detailed facilities in 3-D.

Moore in his international survey [30] in 1974 is using Wollmann's [41] classification of computer programs for facilities design as either 'construction' type or 'improvement' type. According to him the construction

algorithms build or construct a solution from raw data;   the improvement algorithms require a feasible solution as part of the input.

In Moore's survey eighteen programs are classified by authors as construction type, seven as improvement type, but five are not classified either way.   (As Moore's classification fits better for block plan plant layout algorithms, it is less suitable for classification of other systems.   If Moore's approach should be applied to CAFLAP it would fit in his class 'Others', although this class was originally created for a different purpose.)

Below are reviewed and evaluated some classical types of methods/programs from the past, which are still quoted in recent literature.   Tompkins and White in 1984 [39] are actually presenting CRAFT, COFAD, PLANET, CORELAP AND ALDEP. Their selection is identical with programs chosen in Computer Aided Layout: A User's Guide [57], which quotes them as "techniques already proven to be usable to the facility designer".   Konz in 1985 [58] also finds it useful to include in his book CRAFT, COFAD, CORELAP, ALDEP AND PLANET.

These classical types of program are followed by new tendencies and ways in tackling Factory Layout Planning problems.

3.2 COMPUTER AIDED SYSTEMS

Many programs and commercial software packages currently in the field are approaching plant layout as a pure operation management problem of 'sequencing' the departments or work stations, in order to receive a final block layout with shortest possible distances between the interrelated facilities. As described in the following, many of them are building on the original ideas of Armour-Buffa [5,6], Lee-Moore [8] or Apple-Deisenroth [9].

3.2.1 CRAFT

In 1962 G.C.Armour and E.S.Buffa presented their work "A Heuristic Algorithm and Simulation Approach to Relative Location of Facilities" which resulted in CRAFT (Computerised Relative Allocation of Facilities Technique – 1964), a typical improvement type program for block plan plant layout [5,6,7]. The program was developed for process (functional) layout. This method is based on the algorithm to minimise Material Handling (M.H.) costs incurred among all departments. M.H. cost is defined as the product of flow, distance, and unit distance travel cost, which are the main input data. An initial layout has to be given and must consist of a group of unit squares to represent each department. The procedure first determines the centroids of departments. Then CRAFT evaluates the given layout, calculating the rectilinear distances between the

departments and stores it in a distance matrix. Then M.H. cost is calculated as product of data from FROM-TO chart (flow), distance matrix and move cost matrix.

Production departments are identified by assigned capital letters. CRAFT next considers departmental interchanges and evaluates what the effect will be if locations are interchanged. The program switches the positions of the departments to achieve, through an approximation process, maximum economy in Material Handling. M.H. costs are compared. The process continues until no more improvement can be made by pairwise exchanges. Only departments with common borders or of the same area are considered for exchanges of locations.

On final computer prints the inter-related positions of departments are marked by lines, composed of the assigned capital letters, delimiting the areas of individual departments. CRAFT program does not guarantee that the layout with lowest M.H. cost will be found unless all possible interchanges are considered.

Some assumptions made in the CRAFT algorithm could be viewed critically.Francis and White [16] commented that:

Firstly, the use of centroid locations in measuring distances, might not be realistic for some practical applications. This way some unusual layout designs could be obtained, resulting in crooked aisles.

Secondly, the asssumption that M.H.costs are significant,

known and linear in distance travelled. In the real layout this could sometimes be of small significance.

The comments on problematic assumptions are important for the user. He should see CRAFT as a conceptual tool for the design of block layout in some early stages of projects or search phase of design.

Nugent, Vollmann and Ruml in 1967 [38] compared CRAFT with newly developed similar programs H63 and HC63-66. They compared the goodness of the solutions reached and computational efficiency. The results obtained by the authors show that CRAFT runs more slowly than HC63-66; the latter produces solutions of slightly higher quality. Despite some positive results achived by programs H63 an HC63-66, none of them were quoted in literature studied and failed to appear even in Moor's survey [30].

In spite of the above criticism Francis and White in 1974 [16] finally have a word of praise for CRAFT:

"Although there are other improvement algorithms, in general none have been shown to be superior to CRAFT in layout design."

3.2.2 COFAD

From the family of similar improvement programs, at least COFAD should be mentioned here. Developed by Tompkins and

Reed [43], COFAD -Computer Facility Design- is basically a modification of CRAFT.

COFAD allows the use of move cost for a variety of M.H. systems, i.e., each alternative layout is also considered from the point of view of the M.H. method to be selected.

Input requirements are the same as for CRAFT, expanded by the cost of M.H. system, and a percentage of utilization of M.H. equipment per move. COFAD enables the selection of the least-cost layout and in parallel the selection of M.H. method with minimal cost of M.H. equipment.

The program starts with procedures identical to CRAFT, i.e., improving the initial layout. Then the cost of each move with M.H. method alternatives is determined. Flow (FROM-TO chart data) is constant. Next comes determination of a minimal cost M.H. system which is followed by a search for M.H. equipment whose utilization is good.

In the next phase reduction in total cost is sought. If in the COFAD process no reduction of total cost can be achieved, the program is terminated or flow volume inputs are changed. This is done for following reasons: to confirm that the found solution is a steady-state solution, and to check the sensitivity of design to the flow data. If the steady-state is not confirmed, COFAD is restarted with a new apportioning of cost of M.H. system to individual

moves. This loop continues until the requested (steady-state) solution is obtained.

The assumptions inherited from CRAFT (as discussed above in this connection) are inevitably sources of the same critical comments. Here the situation is made even more complicated by the variety of M.H. methods considered, and their costs due to the variation of market prices. Another complication arises in connection with the collection of data regarding the realistic percentage of utilization of equipment, which is always difficult to establish.

Further programs of a similar type in the improvement class quoted by Moore [30] are: GRASP, KONUVER, LAYADAPT, OFFICE, PREP and The Terminal Sampling Procedure. In 1978 Tompkins and Moore [57] are adding to this list another two: COSFAD and SET.

3.2.3 CORELAP

As a classical example of construction type program [30] could be seen the digital computer program CORELAP [8]. CORELAP-Computarised Relationship Layout Planning- was developed by R.C.Lee and J.M.Moore in 1967 to design block plan plant layout economically. It is a job shop orientated procedure.

In comparison with CRAFT, which is using flow consideration for it's procedures, CORELAP procedures are based on activity relationships (originally suggested by Apple[10]). Activity relationship (REL) charts are using A, E, I, O, U, X, rating convention [4, 10].

For input the following data are required:
- the number of departments (N)
- the data from REL chart
- the area requirements for each of the departments
- the ratio of maximum length of the building to width.

The heuristic algorithm starts with areas having the greatest sum of relationships. The departments with the highest total closeness rating (TCR) is placed in the centre of layout matrix. The program then interactively adds other areas, one at a time, in such a way as to maximize the attainment of the desired relationship. The final output is in the form of layout matrix. On the print of the final layout, whole areas of departments appear covered by identifying numbers, each representing the unit square it occupies. The areas which are available but not occupied are marked up by zeros. Layouts designed by CORELAP are often of an irregular shape. To fit a conventional shape of a building, this has to be adjusted manually.

Similarly to CRAFT, CORELAP should be considered as a conceptual tool for the design of block layout in some early

project stages or research phase of design.

3.2.4 PLANET

Another construction type program often quoted in literature
is PLANET - Plant Layout Analysis and Evaluation Technique-
developed by J.M.Apple and M.P.Deisenroth in 1972 [9,7,39].
PLANET was also developed for design of block layout.

For input the following data are required:
- material flow data (i.e.entries from the FROM-TO chart)
- move cost matrix
- distance matrix

PLANET uses three alternative methods for specifying
material flow data. In the design procedure three different
layout construction algorithms are used.

The three methods of specifying material flow data are
following:

The first one specifies product sequence by department for
each part, together with cost per move per unit of distance
for each part. The cost is often input as unity, because it
may not be determined. PLANET then develops a flow-between
cost chart, which indicates the cost of movement between
pairs of departments. This is then used in the construction
algorithm.

The second method inputs material data directly from FROM-TO chart, which is then converted to a flow-between cost chart.

The third method of inputting flow data is that using a penalty matrix. The penalty input between two departments is an indicator of the importance of closeness of the departments. The matrix can also indicate the difficulty and relative frequency of material movements between departments, or indicate the relationship data. A placement priority scale 1 to 9 is used (9 is the lowest priority). The layout is not predetermined.

The three construction algorithms used in PLANET are best described as follows:

Method A selects departments according to flow-between costs, starting with pairs of highest priority group with the highest flow-between costs. The next department to be selected is that from the highest priority group and with the highest flow-between cost with any department already placed. In this fashion the procedure continues until there is no department left unplaced within the layout.

Method B starts in a similar way to that of A, but the next department to enter is chosen from the highest priority group and has the highest sum of flow-between costs with all selected departments. This continues until no department is left unpositioned.

Method C starts with the department in the highest priority group that has the highest sum of flow-between cost with all other departments. As the next entry, method C selects the department in the highest priority group that has the highest sum of flow-between cost among all other departments. The procedure continues until no department is left unpositioned.

The layout routine always starts with the two top selected departments placed in the centre of the layout. Any following department is placed in a manner which will minimize the M.H.cost, using a trial-and-error method.

PLANET often generates layouts that do not suit a uniform building shape, so deficiencies are similar to those of CORELAP. Layout must be manually adjusted but this cannot be evaluated by PLANET as feedback. PLANET can be considered as another conceptual technique for initial stages of projects or search phase of design.

3.2.5 ALDEP

ALDEP -automated layout design program- was presented by Seehof and Evans in 1967 [54]. As classified by Tompkins and Moore [57] this is another construction type routine.

First the authors studied the attributes which condition a better layout. They suggested a scoring technique, and used

a matrix of weighting factors which indicated a desirable closeness of departments. The layout score is the summation of the preference values for the adjacent departments. No details of preference values (factors), or scoring techniques have been published by the authors. However, Tompkins and Moore [57] used in their assessment of ALDEP Muther's [4] A,E,I,O,U,X relationship rating.

The main input data are:

- number of departments and their square footage,

- relative departments location preference,

- layout of the building (building dimensions, etc).

ALDEP creates a random layout and scores it. This is repeated several thousand times to reach the best scores. Compared with CORELAP, ALDEP produces many layouts and rates them leaving the selection of the best alternative to the user; while CORELAP attempts to produce one best layout. Block layouts are produced by a plotter. Selection and adjustments for the final layout are done manually. ALDEP can be only used for block plan layouts with predetermined aisles, stairs and other amenities. ALDEP cannot be utilised for a detailed layout or 'technological' positioning of work stations, and therefore cannot be used as an entry programme for CAFLAP.

It is worth quoting that, in 1979, Rosenblatt suggested a new algorithm [60] which, as he claims, could be used with

ALDEP. He uses a combined quantitative and qualitative (subjective) approach to the plant layout problem. His supposition is that quantitative and qualitative approaches are formulated as a quadratic assignment problem. Both have the same feasible region, therefore the two methods can be combined. His multi-objective formulation, minimizing total flow cost and maximizing total closeness rating, is made possible by the introduction of weight assigned to the total cost flow and total rating score. Rosenblatt suggests a graphical solution to find the 'best' layout. The 'best' layout lies on the intersection of a line, established by the weights, with a point on a 'discrete efficient frontier', given by positions of efficient layouts in the graph.

Moore in 1974 [30] quotes in this class of programs (using construction algorithms) another 16 programs. They are: CASS, COLO2, COMP2, COMSBUL, DOMINO, GENOPT, IMAGE, KONUVER, LAYADAPT, LAYOPT, LSP, MUSTLAP2, PLAN, SISTLAP AND SUMI. In 1978 Tompkins and Moore [57] added another two: Hiller-Conners and RMA Compl.

A number of further programs based on the above mentioned classical types have been developed. Some authors tried to eliminate the disadvantages mentioned above, some tried to develop the system in a more universal way or to extend their use into other areas.

Examples of the latter intentions are MODULAP and SPACECRAFT.

3.2.6 MODULAP

Real situations, influenced for example by transport routes, were not considered previously. The development of new more practical methods was then begun, e.g. MODULAP [11].

MODULAP, contrary to CRAFT or CORELAP, measures the real distances alongside the transport routes. However, it still cannot guarantee the positioning of all the departments along the transport routes, and the layout engineer has to define the required additional routes intelligently. MODULAP first designs an ideal layout and then, in a second round, converts the ideal layout into a feasible alternative. Similarly as all the above quoted methods, MODULAP is also more suitable for block layout and the positioning of departments, rather than for the more detailed positioning of work stations.

3.2.7 SPACECRAFT

SPACECRAFT was developed in 1982 by Roger V. Johnson [44]. It is a construction type program based partly on CRAFT method. Johnson is trying to minimize the total variable cost of movements (M.H.) between facilities in multi-floor

buildings.

The aim of the program is to locate the departmnets in a feasible way, and the total time of journeys on N floors is minimized. Johnson consideres the volume or number of journeys from department 'i' to department 'j' as constant, but the time of a journey will depend on the location of departments 'i' and 'j'. The main difference between the multi-floor problem and the single-floor problem is, according to him, the nonlinearity of transportation times.

For input, SPACECRAFT requires:
- building size data (number of floors, number of floor types, number of columns, rows of modules and definition of floor types),
- travel times between each pair of floors, for each inter-floor access route,
- travel times between each pair of modules within each floor type,
- travel times between each module on a particular floor type and each access point,
- department information (number of departmets, a code number of departments, department titles, volume of movements between each pair of departments),
- Initial layout and its restrictions and any requirements, or restrictions of any department.

SPACECRAFT, in a procedure very similar to CRAFT but with

the difference caused by the nonlinearity of transportation times between floors, produces:

- table of movement times between each pair of floors,
- table of movement times between each pair of modules on each floor type,
- table of movement times between each module and each vertical movement point on each floor type,
- table of volume of movement per period between each pair of departments,
- table of single journey movement times between each pair of departments,
- table of single journey movement times between each pair of departments which have a nonzero volume of movements,
- table of the dollar cost of a single journey between each pair of departments which have a nonzero volume of movements,
- table of total per period movement time between each pair of departments,
- table of dollar cost of the total per period movement time between each pair of departments,
- summary of total per period time and cost of movements originating from each deparment,
- location data listed for each department,
- location data listed for each floor,
- layout grid of the building.

The graphical presentation of layout designed by SPACECRAFT is similar to that of CRAFT. But the positions of

departments are indicated by symbolic numbers instead of the letters used for CRAFT. The numbers are printed in a grid given by column numbers, module row numbers, and floor numbers. This grid feature could be seen as an improvement on CRAFT and the method can, similarly to CRAFT, be used for the development of block layouts. However, SPACECRAFT cannot guarantee an optimal solution. A poor layout will result in higher utilization of elevators.

This method was commented upon by Jacobs in 1984 [45]. He compares SPACECRAFT to a program known as CRAFT-3D developed already in 1975 [46]. Jacobs considers the programs as very similar, with the following difference. SPACECRAFT considers all the travelling distances parallel to the department edge, not diagonally, while CRAFT-3D calculates with rectilinear distances measured between department centroids.

In spite of their discussion of space and 3-D programs, SPACECRAFT and CRAFT-3D are both actually only solving 2-D layouts on different floor levels.

In comparison with CAFLAP (see Chapter 4.) they are actually only 2-D and symbolic in presentation. They also have no facility for 'space management', automatic positioning in 3-D space with collision course finding, etc.. This comment is also true for CRAFT, COFAD, CORELAP, PLANET and MODULAP programs.

3.2.8 SHAPE

SHAPE -Selection of material handling equipment and area placement evaluation- program [47], was presented by Hassan, Hogg and Smith in 1986. The aims of Shape resemble those of CORELAP (3.2.3) or PLANET (3.2.4). The intention was to develop a functional layout with minimum interdepartmental movement costs. SHAPE tried to find the 'best arrangement and configuration of departments' [47]. This was considered in terms of a real area shape.

SHAPE used warehousing methods for locating a new single item in existing stores. This was a new approach to plant layout design. SHAPE divides the layout into a mesh consisting of numbered unit squares (1 to N). Constraints are:
-Departments (n) are occupying a number (compact collection) of unit squares (Ai),
-Each unit square in the mesh is to be occupied by only one department.

SHAPE allocates the unit squares for each department and tries to minimize interdepartmental movement costs. In a similar way to CRAFT and PLANET, SHAPE uses a quantitative departmental relationship (FROM-TO chart), with the difference that each flow value is classified as major or minor and is defined by the user. SHAPE determines the order in which departments enter the layout according to the

sum of the major flow values. The first selected department is placed in the centre of mesh. The rest of departmnets are placed around according to their flow values. Departments with the largest flow values are near the centre; those with decreasing values are placed in the direction towards the perimeter.

Similarly to CRAFT, centroids of departments are established and the rectilinear distances between the centroids are used. The movement cost here is the product of average distance and flow between placed departments. The placement procedure is similar to PLANET and is extended by a process orientating departments in the layout according to the minimum movement cost. The process allows the shape of departments to be changed by influencing objective functions of the model; i.e. the flow-distance product controls the selection of unit squares and therefore changes the shape of the departments. In the final layout every department is of an optimum shape, while the least movement costs between departments are secured.

In spite of the authors' original claim about SHAPE dealing with "selection of material handling equipment..." no selection is discused in the paper presented [47]. SHAPE is also compared in the paper with PLANET and CRAFT, but if selection of M.H. equipment is considered it should rather be compared with COFAD (3.2.2). The comparison with PLANET, provided by authors in detail, shows SHAPE's advantage of up

to 23% reduction in movement cost.

The final layout is presented as a 2-D layout matrix of unit squares. Each unit square represents a particular area of the department, coded by a number. Thus SHAPE can be used, similarly to the previously described programs, as a conceptual technique for the initial stages of project or search phase of design.

Unlike CAFLAP and in company with the other programs dicussed here it also has no facility for 3-D presentation, no facility for detailed layout or collision course finding, etc.. Because of its otherwise unique ability of changing the layout shape it can be used for block layout, but is not suitable for 'technological' positioning of individual work stations and therefore cannot be used as an entry program for CAFLAP.

The disadvantages of SHAPE for practical layout are similar to CORELAP, PLANET and CRAFT. Unusual layout designs can sometimes be generated by SHAPE and the resulting crooked aisles cause difficulties in practical M.H. Moreover, placement of the work stations in the detailed layout may prove to be difficult, if not impossible, because of the changed shape of departments.

SHAPE should be seen as a most recent attempt to improve the existing line of heuristic construction algorithms based on

the classic ideas of Lee and Moore in the sixties.

3.2.9 RUGR

In parallel with the construction and improvement types of programs, Moore introduced, in his survey [30], another class of programs: graph theory [50]. A classical representative of these types of program is RUGR, already presented by Krejcirik in 1969 [12]. Using the graph theory Krejcirik tried to consider the plant layout problems within the limits of an existing building and given areas. His RU-Program is designed for finding the optimum arrangement of spaces which lie alongside a corridor. He was partly inspired by Armour-Buffa's CRAFT program but, contrary to this program, his arrangement of spaces (e.g.departments) follows a direct line, distributing them evenly within the building, without any waste of space available.

Krejcirik's RG-Program is intended to find mutually related locations of spaces on one plane, while the RR-Program is designed for the minimization of total area of the layout, in order to achieve the most economic size of the building. RUGR is suitable for 2-D plant layout block plans.

Seppänen and Moore in 1975 [53] reviewed the graph theory. They found that it is not always possible to represent the plant layout situation as a planar graph. String processing algorithms, using Novelty Luggage problem method, were

suggested as an alternative approach. But this method has not been further developed and implemented using a computer.

3.2.10 MATHANDL

Very important techniques for the 'technological' positioning of work stations have been developed by the University of Strathclyde.

Program MATHANDL [13] introduces a new technique of arranging work stations into lines instead of clusters, as it is in CRAFT and CORELAP, and removes the shop foor limitations which are inherent in these methods. To achieve this, Numerical Taxonomy, a computerised approach to biological classification has been adopted to develop a computerised algorithm. However, the developed program is at present not available for multiple machine departments. The method of numerical taxonomy was further studied by Carrie [51]. He also observed [55] that the technique of numerical taxonomy provided an analytical procedure similar to the intuitive one of the plant layout engineer. For the Layout of Multi-Product Lines [14], he has proposed a computer method of preparing alternative line layout designs. The method considers work flow and work load and proposes a three stage procedure:

1) Construction of a 'complex' line which contains enough work stations at appropriate positions to allow every part to be processed without back-tracking;

2) Identification of those machines which do not have an economic work load, and eliminate them by re-routing the operations planned to be performed on them to other machines in the line. This is done in an interactive manner producing several possible designs;

3) Comparison of the alternative designs by computer simulation.

The simulation model was written using the GPSS package [26].

3.2.11 PLANTAPT

PLANTAPT - a prototype integrated package for layout planning analysis- was presented by Carrie in 1977 [54]. This general purpose package is intended for medium size plant layout and group technology applications. PLANTAPT's file system holds following data:
- for a number of independent projects,
- on component parts,
- on plant resources, machines or processes;
it is designed to:
- permit variations in the data,
- permit max. flexibility in the data layout in input documents,
- store and retrieve results of application programs.

PLANTAPT's application programs are designed for:

- specifying the component parts to be examined,

- specifying the machines to be considered in the analysis,

- analysing group technology code numbers (Opitz),

- analysing the operations carried out on parts,

- developing the layout of group flow lines and rationalising operation sequences,

- analysing material flow or activity relationships for planning overall layout or detailed layout.

PLANTAPT programs first analyse the situation and then, in a grouping operation, design parts groups, and corresponding groups of machines. If no grouping is necessary, each item becomes a group of one. A facility for operation sequences is provided. If a multiple-product flow line is being considered, machines for the flow line are selected by a specialised program.

Integral parts of PLANTAPT are programs called TRAVEL and LAYOUT. TRAVEL computerises relationship data, while LAYOUT develops a maximal planar subgraph (the theoretical ideal layout) from which a practical plant layout can be designed.

A graphical extension of PLANTAPT was described by Carrie in 1980 [55]. He used PLANTEC, an interactive package for plant layout, developed by National Engineering Laboratory [56]. PLANTEC stores and supplies 2-D shapes of buildings and machine templates. Coordinates of the shapes, relative to a convenient origin, are measured and filed. This can

also be done by digitising the shapes. Similarly, positions of machines in the layout are given by coordinates and scale factors can be given. The layout is presented on VDU and manually adjusted according to engineer's discretion. When the layout reflects the theoretical ideal layout best, the engineer can instruct the computer to provide a large size plot of the layout drawing.

Utilisation of Strathclyde's techniques MATHANDL and PLANTAPT is suggested for the benefit of CAFLAP (section 4.3).

3.2.12 A large-scale spatial allocation problem

A large-scale spatial allocation problem was formulated in 1980 by Liggett [61]. He used a quadratic assignment approach combined with a 'partitioning scheme'. This very interesting method allows the efficient solution of layout problems, positioning up to 1000 departments, shortening the computing time substantionally. The 'partitioning' approach solves a layout at a set of nested levels. The highest level (master partitioning problem) assigns activity modules to subsets of locations. These are grouped into zones or 'partitions'. The method used for selecting the assignments in levels considers the immediate costs of assignments (activities to locations) and the restrictions imposed on possible choices for future assignements. Probability theory is used to predict which assignment would most likely

lead to an optimum solution, and therefore which is the most suitable as a possible future choice.

This partitioning method is said to be very effecive and computer time saving. It is appropriate for architectural space allocation but unfortunately it leads to irregular shapes of departments, and on a much higher scale than in CRAFT (which is the program used by Liggett for comparison). The method is therefore much less suitable for mechanical engineering application.

3.2.13 INLAYT, S-ZAKY (an interactive approach)

An interactive approach to construction and improvement procedures was described by O'Brien and Barr in 1980 [34]. They tried to overcome some problems which are inherent in the above quoted procedures, by introducing the user's participation in the selection process. Program INLAYT is designed for the construction of initial layout for a new factory, or improvements in an existing one. The improvement procedure, based on program S-ZAKY, is asking the user to evaluate the 2-D layout on VDU.

INLAYT analyses the flow of material between facilities and suggests to the user groups of facilities and priorities to select for positioning. The user then has to position the facilities in the layout manually. The procedure disregards the actual areas required, and is concerned with relative

location only.   INLAYT does not produce the final layout, it only provides the initial input to the improvement procedure S-ZAKY.

Input data into program INLAYT are following:

-The number of facilities,their   names   and   indentification numbers.

-The spatial array of building or site.

-The weighted flow of material between facilities.

-A flow factor (a control variable specified by the user).

The order of departments is   produced   by   the   program   and stored   in a matrix organised according to maximum values of weighted flows.   Facilities are assigned to a space location grid by the light pen.

The improvement procedure S-ZAKY must start from an   initial layout.   This   can   be   produced by INLAYT, or the existing layout or any other proposal can be used.

Input data required:

-The name of each facility.

-The area of each facility.

-The relative location of all facilities.

-Details of fixed facilities.

-The coordinate positions of all machinary.

-The coordinate position of material set-down and pick-up.

-The orientation of set-down and pick-up with each facility.

-Estimates of cost of relocating each facility.

-The cost of investment capital.

-The lifespan of the programme being considered.

-Control variables.

The authors claim that the improvement algorithm S-ZAKY is superior to other avilable algorithms. The main reason is that they interchange three pairs of facilities instead of two, as CRAFT and other programs do.

The 2-D layout is presented on the screen together with the total M.H. cost. Material flow pattern between set-down and pick-up can be superimposed on the layout. Series of questions are asked regarding further procedures required. In the case of exchanging facilities the program will reposition aisles. The rearrangement of facilities is left to the experience of the user, who can move facilities (2-D templates) manually by the light pen. The improvement layout is assessed by computer. The procedure continues until no more improvement can be achieved. Total M.H. cost which is the prime factor in this procedure is compared with the cost of physical repositioning of facilities. The ratio of these costs indicates the economy achieved by the changes. If no requested economic effect is achieved, the relayout procedures could be resumed and the process is repeated. The procedure can handle up to 100 facilities but all areas must be rectangular, and the system of aisles must be rectilinear, which is a substantial limintation.

The INLAYT-S-ZAKY method has certainly brought a new approach to factory layout planning. Unfortunately there does not seem to be any independent assessment of the method yet published. There are also limitations similar to other comparable methods e.g. the inaccuracy of the input data on M.H. cost, installation costs, etc..

Kaltnekar in 1980 [62] considers three groups of criteria for layout decision making: limiting, mutually influencing, and marginal conditions. These criteria dictate approaches and Kaltnekar reminds the reader that most of the literature mainly considers the relationship between layout and material flow while other factors are ignored. To balance this he suggests it appropriate to study the above three groups of criteria:

Limiting conditions are those which cannot be changed (i.e. market,sources,etc.).

Mutually influencing conditions are those which can be changed (i.e. M.H., flexibility of layout, outside transport, building construction, conditions for the employees, the mutual influence of different parts of production system, etc.).

Marginal conditions are all conditions surrounding the production system (i.e. the social order, disposable workforce, financial posibilities etc.).

Because of the large number of different influencing

factors, the criterion of minimization of particular functions or their costs is used. Kaltnekar's critical observation that every method offered optimizes a model, and not the real state, is a crucial one. His improving algorithm only emphasizes that the result is still far from a satisfactory solution.

Prof. Lockyer [21] in 1981, when assessing the existing computer aided layout planning systems, is quoted as saying that:

> "...computer programs may assist the planning function by avoiding an oversight and this is a common experience when using computers, in that the preparation of input data enforces a discipline which is often useful. It is the author's experience that layouts are currently, in fact, prepared entirely manually, and his belief that the use of the computer in this area will, for many years, be extremly limited."

In this rather unsatisfactory situation, new attempts to ease the layout engineer's work were made, especially in the area of simulation and systems using computer graphics.

3.2.14 SEE WHY (FORSIGHT)

In 1984 B.H. Hollocks [25] suggested a new approach to plant layout problems through computer simulation. His

program FORSSIGHT experiments on 'real world' layout situations. The engineer may change the layout situations and the program finds out the influences of the options, before any decisions (changes, purchase of equipment etc.) are made.

The method was originally developed at British Steel for reflecting a course of activity on physical mimic displays. The computer simulation run was valuable for giving a fuller understanding of the behaviour of mimic displays in specific circumstances. It is claimed [25] that the FORSSIGHT program "enables an accurate computer model of real world production plant to be constructed quickly and easily". It gives production statistical results and can produce an animated view of the model in operation. FORSSIGHT also enables the user to change operating parameters and to observe the results. Departments or work stations are presented as 2-D blocks (as is usual in mimic diagrams), but without any real shop floor area or space considerations. FORSSIGHT has recently been renamed SEE WHY: it is a good package for the study of cost effective production flow.

3.2.15 UA1, UA2, UA3

From the range of other simulation programs it is worth mentioning programs presented by Driscoll and Sayers in 1985 [68]. The authors have studied a dynamic facility relayout, and developed three new programs:

Program UA1 undertakes data validation. For static layout design program UA2 is used, while UA3 is designed for changeover simulation. The programs have the facility for evaluating alternatives on a financial basis.

Static 2-D layout (in UA2) is determined by coordinates of the building outline; facilities are represented by rectangular or circular shapes/areas. Facilities (workcentres) are grouped into sets and the placement of facilities is done manually. The relayout starts with the existing layout, the new arrangement, and with the support of M.H. information. The changeover simulation model (UA3) operates subject to a number of assumptions which define the changeover situation, e.g.: specified life-span, times of relocation, limits on the number of relocated workcentres, limits on relocation moves (within a period), etc.. There are three types of changeover:

-instant changeover (at time zero)

-slow changeover (with intermediate layouts)

-changeover while stopping production for early benefit from the new layout.

UA3 evaluates the changeover, on the basis of M.H. costs and workcentres relocation costs. M.H. distances are calculated as straight-lines, where no traffic routes exist, or as the shortest distances around the traffic system. In comparison with CRAFT and PLANET, UA3 considers not only the cost of journeys but also extra costs i.e. M.H. fixed

costs, consisting of pick-up and set-down costs. A priority rating expressing the order of potential gain from changeover is used. Program UA3 prints details of M.H. costs troughout the simulation.

The authors are fully aware of the vulnerability of M.H. criteria if considered in isolation. The dynamic facility layout draws a comparison between M.H. cost and the rate of profit from production in the new changover situation on, on the one hand, and the cost of the relocation of facilities, on the other hand: this produces a better picture of the changeover.

The simulation model is designed as an aid for decision making regarding changes of layout, rather than as a tool for actual detailed workshop layout.

In the class of major and expensive simulation packages programs MAP and CDAS were introduced.

3.2.16 MAP

MAP -Manufacturing Automation Protokol, was developed by General Motors in cooperation with Boeing, and introduced in 1986 by Baer [69]. The system is able to handle 3-D CAD data, NC tool paths, robots, automatic quided vehicle instructions and shop traffic instructions. The MAP package can be integrated with CAD/CAM system. According to Baer,

the MAP system is very expensive and currently beyond the means of medium and small-sized companies. MAP enables communication and control of the shop floor. Operations in this particular application include loading, cleaning, soldering and stacking. Using MEDUSA CADD software, the system was used to draw the cell configuration, but the levels of manual/automatic drawing or any specialised factory layout facilities are not documented.

MAP is clearly orientated as a large scale process control system, including MRPII (material requisitioning) programs. Therefore any comparison with CAFLAP, which is a special purpose, plant layout orientated system, can hardly be made.

3.2.17 CDAS

Immediately after MAP, Rockwell's Configuration Design Analysis and Simulation Environment System (CDAS) was introduced by Tice [70]. It was primarily designed for the simulation of future human or robotic on-orbit servicing procedures during space flight. Low fidelity computer graphic visual simulation was used. All positions and motions of objects were calculated ahead of time and could be recalled in 3-D presentation, frame by frame. Tice claims that CDAS can be used for:

-designing spacecraft, tool and cradle hardware,

-analyzing remote manipulator system

-checking effectivenes and feasibility of design

-simulating design, redesign, feasibility and efficiency operations.

At the present time, CDAS has no collision detector.

Grant and Weiner [71] evaluated ten Animated Simulation Systems in worldwide use. This included the "See Why" system already described in paragraph 3.2.14. The systems evaluated were:

AutoGram, BEAM, Cinema, Modelmaster, PCmodel, RTCS, See Why, SimFactory, Simple 1 and TESS.

The features compared are:

-simulation model building system

-animation graphics

-operational consideration

The model building system is most important both for the model builder and for the user. Five of the above systems are special purpose with manufacturing orientation and five are general purpose systems. All but one system uses use two dimensional animation graphics. Only AutoGram uses 3-D and the graphics display allows observation of the designed system from different perspectives. AutoGram allows the creation of layout from drawings, via a digitiser. The other systems offer mouse driven menus of characters or shapes.

The listing of these features reveals that none of the simulation systems are similar to CAFLAP.

The Buyer's Guide to CAD systems [72] was studied and it shows that although different CAD system offer various and sometimes very sophisticated facilities, none of them is similar in operation or presentation to CAFLAP (see also Chapter 4.2.).

3.2.18 GRASP

Another interesting package recently developed is GRASP [29]. This is a practical tool for the visualisation and study of relative positions of work stations with respect to robotics and movements of parts in 3-D Computer graphics. GRASP was designed predominantly for:

   1)   Programming robots;

   2)   Process purposes (showing what the robot
        is doing and finding movement paths.
        A Clash detector menu can indicate,
        by flashing, the clash of parts
        or equipment);

   3)   Robot purchase.

The system is orientated on Flexible Manufacturing Systems (FMS) and on relatively small areas or spaces of

manufacturing cells. At present it has no facility for labelling the work stations with tag numbers and dimensions, although this may be a feature of a new program GRASP 6.1 which is now being developed. GRASP is certainly a very powerful system and could in future be expanded into other specific areas.

Parallel to the above mentioned new approaches, research still continues in the field of 'technological' positioning of facilities (considering mainly flow factors and desirability rating). This can be seen documented by the works of Foulds, Giffin and Cameron in 1984 [63, 64 and 65] and Foulds, Giffin and Evans in 1985 [66].

The last word in block layout design is apparently the study of Evans, Wilhelm and Karwowski [31] presented in 1987. Instead of the previously mentioned techniques, they suggest the use of the theory of fuzzy sets. The authors consider flow rates and REL charts as vague concepts, yet the inexact data could be handled with the use of fuzzy methodology in a mathematically strict way.

However, Herroelen and Van Gils, in 1985 [67], in a similar manner to Kaltnekar [62], critically examined the main stream of research following the ideas of flow dominance. Assessing the stream of studies following the concept of CRAFT, they come to the following conclusion:

"Using flow complexity measures to decide on the

particular layout configuration to be installed ... is a mere neglect of the many complexities involved in designing a plant layout and materials handling system..."

"...the layout complexity issue is in desperate need of further research..."

All the above references show methodical differences in approach to solving layout problems and a genuine effort to find a way of facilitating the industrial/layout engineer's work. Despite all this effort, Lockyer's claim [21] that the layouts still have to be designed entirely manually, persists. The Writer believes that this failure to find a better method was not only caused by the fact that in Factory Layout Planning "there are a number, and sometimes conflicting requirements" (as claimed by Lockyer [3]) or by methodology of approach, but also by the state of computer science. As in many other engineering fields, it is the recent development of the techniques in computer graphics that is generally opening new horizons. In this particular work it is these techniques which have made CAFLAP possible!

4.   COMPUTER AIDED FACTORY LAYOUT PLANNING

4.1 ENUNCIATION OF THE PROBLEM

Factory Layout Planning "is at best an imprecise craft" and "layout planning never developed into a clear procedure" stated Muther ([57-Preface], [4]). Nugent [38] and others see its combinatorial nature. "Factors influencing layout are numerous" says Kaltnekar [62]. Order, product, production programme, production planning, production, manufacturing systems, cost of product, and capital investment are just the main factors influencing Factory Layout Planning (Fig.2.) to be quoted.

Only with all the digested knowledge of what Factory Layout Planning involves (see Chapter 1,2 and 3) is it possible to select the area of layout planning which is suitable for methodological improvements with the use of computers. Hence the area of space demands and space relationship has been selected as the main topic for this Thesis. Contrary to all the above mentioned packages, CAFLAP solves SPACE RELATIONSHIP AND SPACE REQUIREMNT problems.
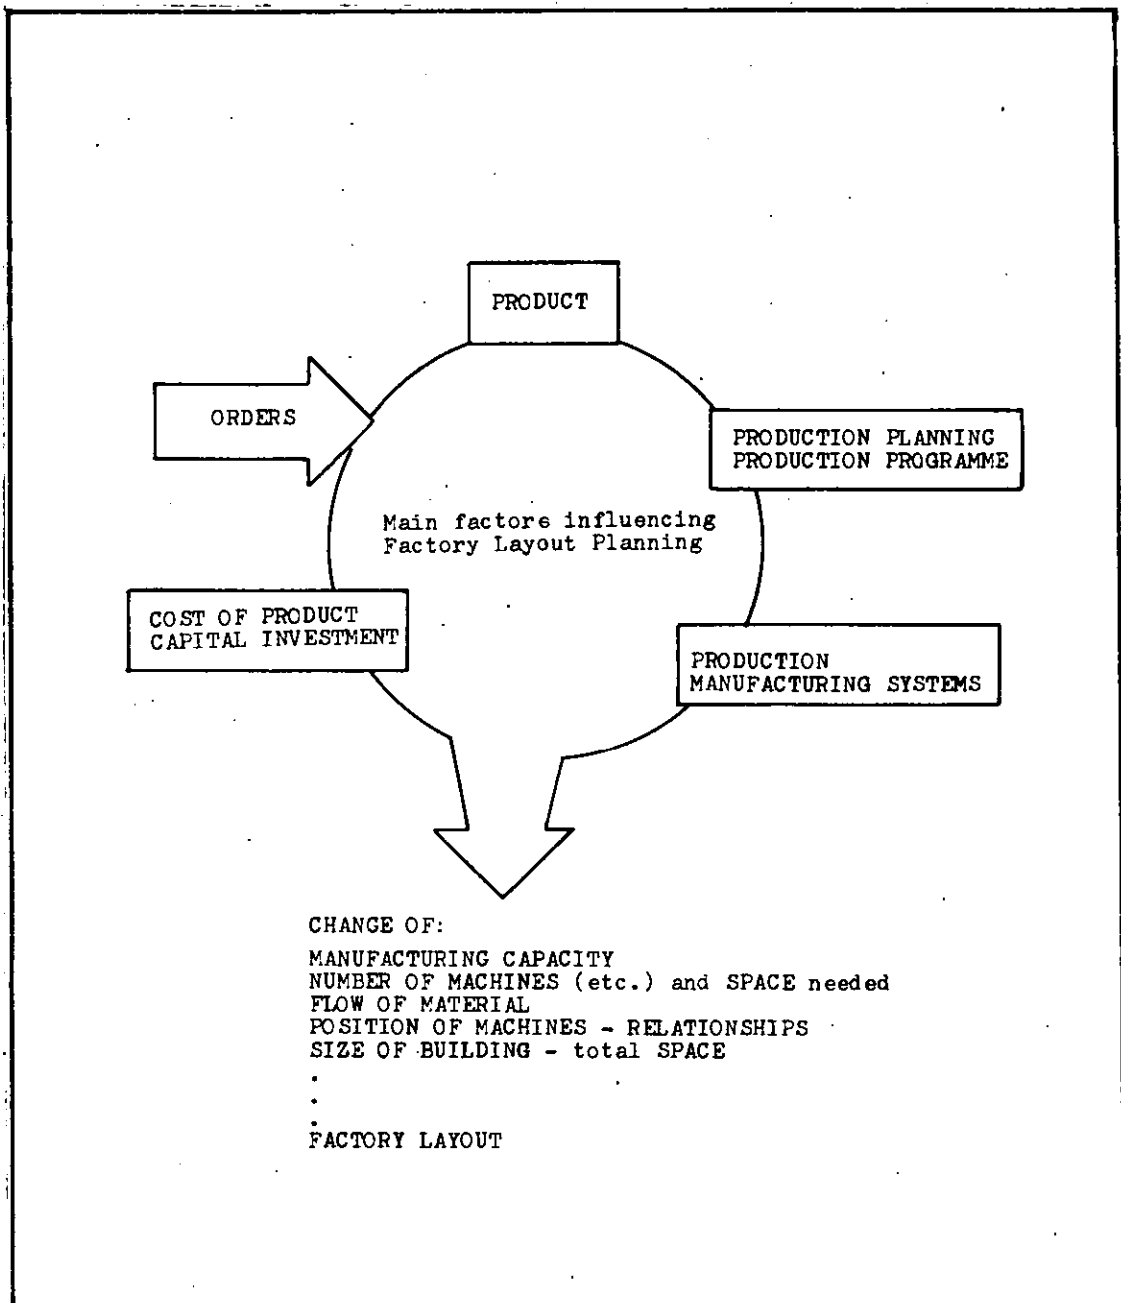
Fig. 2. MAIN FACTORS INFLUENCING FACTORY LAYOUT PLANNING

CAFLAP consideres the relative positions of 'spaces' (Manufacturing Space, Product Space...see section 4.2) conditioned by the technological requirements and demands of optimum utilisation of building space (Civil Engineering Space).

To fulfil the task, the following particular areas and steps are considered:

a) Manufacturing, as a system, is re-defined for the purpose of Computer Aided Factory Layout Planning in dynamic and spatial terms.

b) The definition of a Work Station Module as a new 3-D 'template' for the use in computer graphics is established. (A Specimen of a Work Station Card which can also be used for the purposes of a complete computer aided Production/ Industrial/Project Engineering control and planning system, is developed.) Material Handling studies, regarding space and its 'filling' are pursued.

c) A specific computer graphics system, PICASO (see section 4.4), is selected.

d) The principle of a 'continuous industrial bay' and 'Product Space Zone', as an aid for layout planning, is defined.

e) Programs for the design of individual Work Station Modules, Buildings, and for Manual Positioning of Work Station Modules are written.

f) A program for the manipulation of the whole scene to allow the user to observe the layout from a required position is written.

g) The development of the system into an automatic positioning system, considering mainly the interdependence/interaction of spaces, is contemplated: programs using a combination of automatic and manual positioning are developed.

h) The criteria for the automatic collision course finding of work stations with building elements are established.

The end product is an automated tool, assisting engineers to design/optimise the layout, in terms of most economic space utilisation, while maintaining 'technological' positioning.

Alongside the main layout problems it was also found essential to consider:

- Production Management conditions (see 4.2).

- Material Handling problems influencing the Layout and

the size of the Industrial Bay (see 4.2).

- Retrieving work stations for a suggested production line from a chronological list. This happens after the 'technological' position of work station has been determined.

- Capacity calculation for Feasibility Study and Investment Project (e.g. number of work stations needed etc.).

The CAFLAP system was originally aimed at layout and re-layout of a medium-size engineering company with batch type production and with a maximum product weight 60kN.

4.2 SYSTEM MANUFACTURING

In the last decade manufacturing has ceased to be observed as a pure mechanical technology problem. The increase in overall production output is no longer considered to be purely a matter of the introduction of more advanced machining or other technological methods. Studies of machine break-down, for example, have led to a new approach to maintenance. Similarly, concern about the human factor failure in fulfilling the requested tasks accurately and in the shortest possible time and consequently, studies of the

relationship between workers and their environment, have brought about the development of a new discipline: i.e. Human Factor Engineering, or Ergonomics. Attempts to optimise the operator's output have resulted in the development of the subject of Synergetics.

Maintenance:

To avoid excessive wear and tear and break-down of machines a system of 'Planned Maintenance' has been developed. The principles of planned or preventive maintenance have been known for many years, but were formulated methodically in the sixties in the studies of the Ministry of Technology [73]. Since then the interest in Planned Maintenance has been growing steadily: the works of Clifton [74], Heintzelman [75] and Patton [76] are of note.

Planned Maintenance creates conditions for diminishing the losses resulting from machines down-time. In an attempt to minimise the maintenance demands and costs, a new discipline in machnine design, 'Design for Maintenance', has been developed.

Planned Maintenance is defined as an activity including all necessary works on, and services of, work stations (machines), organised in pre-planned time cycles, to maintain them in good working order.

Maintenance requirements are also described in many factory

management books e.g. Lockyer's 'Factory and Production Management' [21]. It should be said that maintenance practice and maintenance cycles vary from industry to industry, and with the type of machinery installed. However, there is an underlying general pattern of planned cycles of improvement and of preventive and corrective maintenance, as formulated by Patton [76].

Larger time scale cycles (years) usually contain provision for:

- Preventive Maintenance (Appendix I-9) (greasing, cleaning, adjusting, repairs taking less than 3 hours, etc.);

- Major Overhaul (complete inspection, parts replacement, renovations);

- Safety Inspections (elimination of safety hazards);

- Modification and Modernisation (alteration of present machines for more demanding functions, e.g. gearing); and

- Emergency Repairs to keep equipment operative (taking more than 3 hours).

From the above mentioned types of maintenance services, Preventive Maintenance is the most important for CAFLAP. It is itself organised within smaller cycles (day or week):

during shifts - oiling, greasing, adjusing;

between shifts - inspection, adjusting, oiling;

during night shift (24 hrs interval) - cleaning, small repairs taking less than 3 hrs, etc.

As the services are performed in the area of the work station, they create demands on Maintenance Space. In the past, when importance of Planned Maintenance was not widely recognised, the space needed for maintenance was often overlooked or neglected at the design stage. Losses resulting from this were evident. It is important to note that in the CAFLAP system developed here, the provision for Maintenance Space is embodied.

Design for Maintenance means giving the necessary support to all the functions of the machine. For example, an easy access to all oiling, greasing and inspection points must be guaranteed. Assembly procedures/provisions should serve easy replacement of parts and for all other maintenance purposes. Energy supply lines (pipes, cables), should be designed in such a way as to avoid crossing problems during maintenance. Lubrication and cooling should always be on the opposite side of the operator's post. Where possible, maintenance free material (e.g.plastic, sintered bronzes) should be used. Swarfing (cleaning of machine tools from all scrap of machining process) should be designed for most ease of removal [22].

Both Design for Maintenace and Planned Maintenance are determining factors influencing the demands on space around any work station. This, denoted in CAFLAP as MAINTENANCE SPACE, is further discussed in paragraph 4.2.1.1 and 4.5.1.

Human Factor Engineering - Ergonomics:

Human Factor Engineering is a branch of technology that helps to design machines, operations, and environment to match human ability and limitations. Human Factor Engineering is a term used mainly in the USA [82].

The term Ergonomics is used mainly in Europe [21,81] and the definition is slightly different from that of Human Factor Engineering. Ergonomics is seen as scientific study of the relationships between man and his work environment. The first studies in what is now called Ergonomics, started as early as in World War Two. Explanations were sought as to why bombs and bullets often missed their targets, planes crashed and friendly ships were sunk without apparent reason: it was discovered that a human factor had frequently to be blamed. After the war research continued in manufacturing industry where the reasons for a high percentage of faulty products were studied.

Again the human factor was found responsible. The main sources of problems were:

Monotony of work (especially on assembly lines);

Fatigue from heavy tasks;

Badly designed machine tools, equipment and instruments;

Badly designed work station layout;

Influence of shortcomings in the immediate environment

(Lighting, Noise, Ventilation, Heating, etc.).

From the above factors it can be seen that the design of Work Station Layout is very relevant to CAFLAP, and especially to the design of a Work Station Module - Man

Space (see 4.2.1.3).

The physical factors of Work Station Layout, which have a dominating influence on the operation are:

- maximum physical comfort of the operator;
- good view, enabling the operator to see all phases of the manufacturing process;
- good access to all important parts of work station;
- a reduction of physical strain to a minimum.

Mental factors of Work Station Layout, which are of equal importance to physical ones from the control point of view, are:

- operator should be able to exercise control easily and with accuracy;
- sources of mental strain that distract the operator's attention from making judgements and decisions needed for the job should be eliminated;
- stress from lack of space or unsafe working practices should be prevented.

These ergonomic factors are determining the demands on space in which the operator is working. This, denoted in CAFLAP as MAN SPACE, is discussed further in paragraph 4.2.1.3.

Synergetics:

Synergetics is a relatively new science which is studying sets of effects of work environment on operators [27,28].

It is trying to establish the best configuration and combination of sets of elements and their influences, to achieve optimum performance. From the Synergetics point of view, CAFLAP is trying to find the best arrangement of work stations in detail layout (see 4.3).

A study of all the above aspects has, in the present CAFLAP work, led to a new appreciation of dynamic and spatial relationships within a manufacturing system, and to their reconsideration for the puposes of CAFLAP.

But, before the system is analysed in detail, the shop floor situation, as it is recognised in today's factories, has to be summed up.

A classical Plant Layout (shop floor space) usually comprises the following Areas:

a) Manufacturing Area

b) Manufacturing Services Area

c) Non-Manufacturing Area

d) Stock Area

e) Aisles Area

f) Unrehabilitated Area

Other areas include:

1. Administration Offices

2. Employee Facilities

3. Factory Offices

4. Garages

5. Services (Energy)

etc.

CAFLAP could, of course, consider the layout of all areas, but because the Manufacturing Area is the most important (sometimes it occupies over 50% of all other areas), the present work is concentrated on this area.

As from the point of view of system approach, complex problems can be seen more clearly, this methodology has been used in the following classification.

4.2.1 SYSTEMS

A manufacturing system expressed in dynamic organisation terms for the purposes of CAFLAP {see Fig.3.} can be classified [15] as follows:

A) Higher Systems - region, state, continent, world.. etc.

B) Wider System - Plant,Factory,Company.

   Systems, within the wider system, are:

   a) System Management and Administration:

   - Management control level (Personnel, Purchasing, Financial, Sales, Marketing, Prodn. control,

Prodn. planning, Industrial eng., etc.);

b) System Research and Development, Drawing Office;

.c) System Services:

- Health and Safety, Catering, Maintenance, Stores,

  Swarfing, Scrap control, Plant and Building

  Services, Power, Energy Supply etc.;

A) Higher Systems are region, state, continent, world.. etc.

B) wider System is Plant,Factory,Company.

a)   System Management and Administration
         Marketing,
Purchasing, Financial, Sales,
         Personnel,
      Prodn. planning,
        Prodn. control,
   Industrial eng.,
         etc

c)   System Services
      Health and Safety,
         Catering,
   Maintenance, Stores, Swarfing,
         Scrap control,
   Plant and Building Services
      Power, Energy Supply etc.

direct influences on Factory Layout

b)   System Research
   and Development,
      Drawing Office.

d)   System Manufacturing:
      Sub-systems:
  - Manufacturing   (incl. Work Stations,
                       Swarfing, Services etc).

  - Man - Manning (Operators, Fitters etc).

  - Material   (incl. Material Handling,
    W.I.P, Product   Intermediate stores etc).

Fig. 3.

MANUFACTURING SYSTEM EXPRESSED IN DYNAMIC ORGANISATION TERMS

d)   System Manufacturing:

Here Sub-systems can be distinguished:

- Manufacturing (incl. Work Stations, Swarfing,
  Manufacturing (Auxiliary) Services etc.)

- Man   (Operators, Fitters etc.)

- Material   (incl. Material Handling, Intermediate
  Stores etc.)

The above dynamic organisation systems have to be physically
accommodated (in spatial terms) and it is obvious that the
systems and sub-systems would have their own specific
requirements on physical properties of buildings (floors,
areas, spaces).

Hence the Wider System, expressed in spatial terms {Fig.4.},
will comprise:

a.   Offices (System Management and Administration,
      Drawing Office, R+D)

b.   Special Areas (System Services, Laboratories, etc.)

c.   Shop Floor/Space (Layout)
      which has to accommodate the system Manufacturing
      and its sub-systems:

A) Higher Systems are region, state, continent, world

B) Wider System is Plant,Factory (Area, Plot, Ind. Estate)

a. Offices (System Management and Administration, Drawing Office, R+D)

b. Special Areas (System Services, Laboratories, etc)

BUILDING - CIVIL ENGINEERING SPACE

c. Shop Floor/Space (Layout) sub-systems:

-Manufacturing Space

-Man Space

-Product Space

-Manufacturing Services Space (Tool crib, Grinding etc).
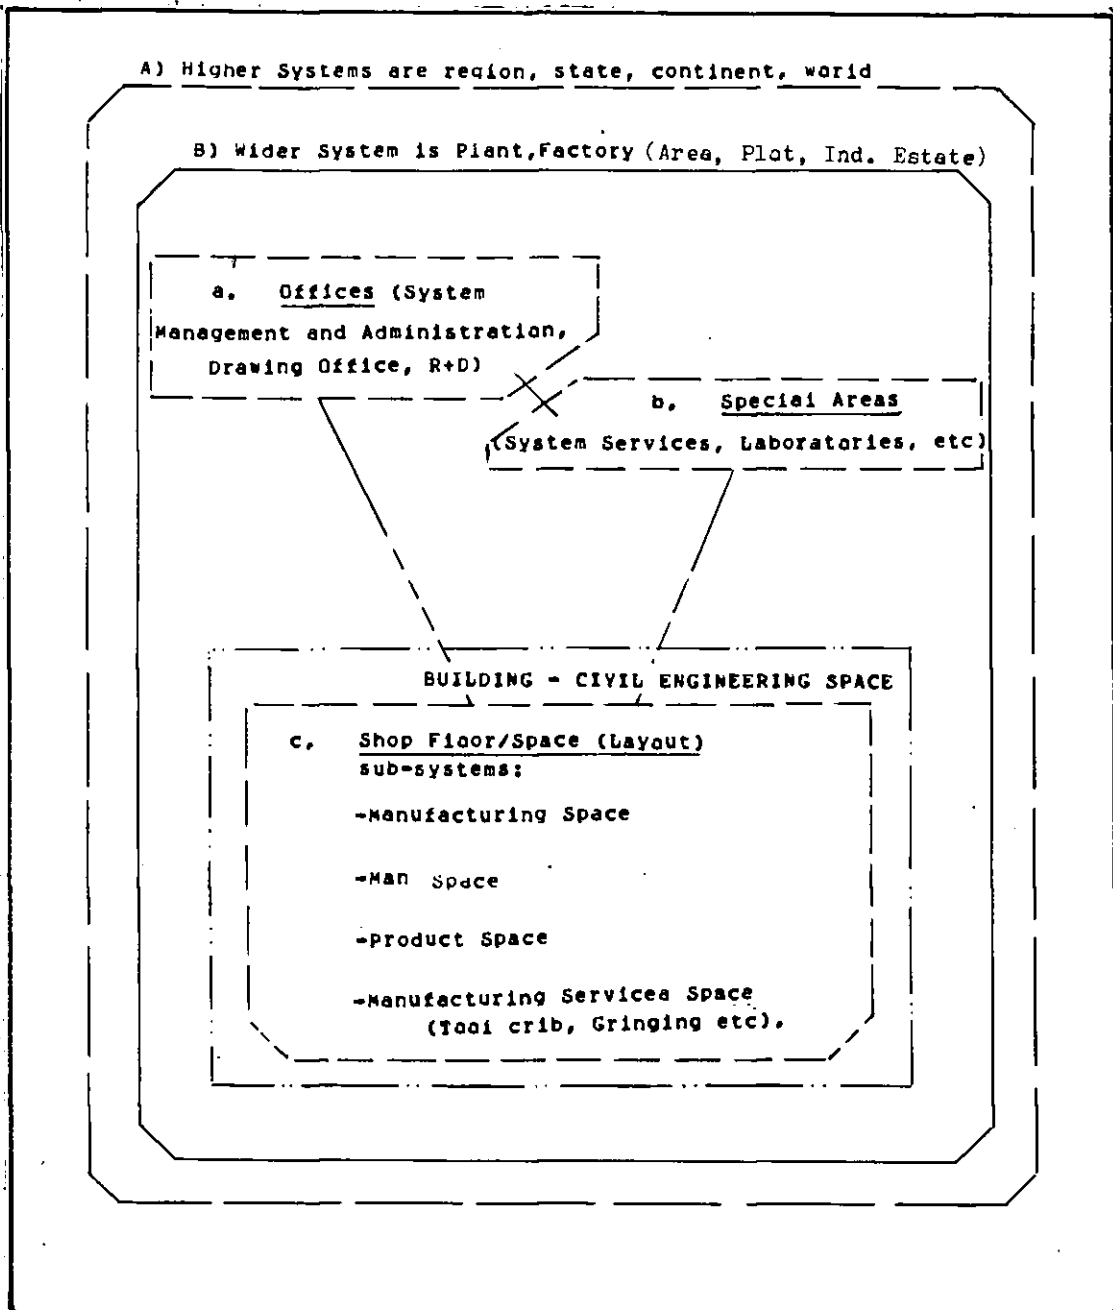
Fig. 4.

MANUFACURING SYSTEM EXPRESSED IN SPATIAL TERMS
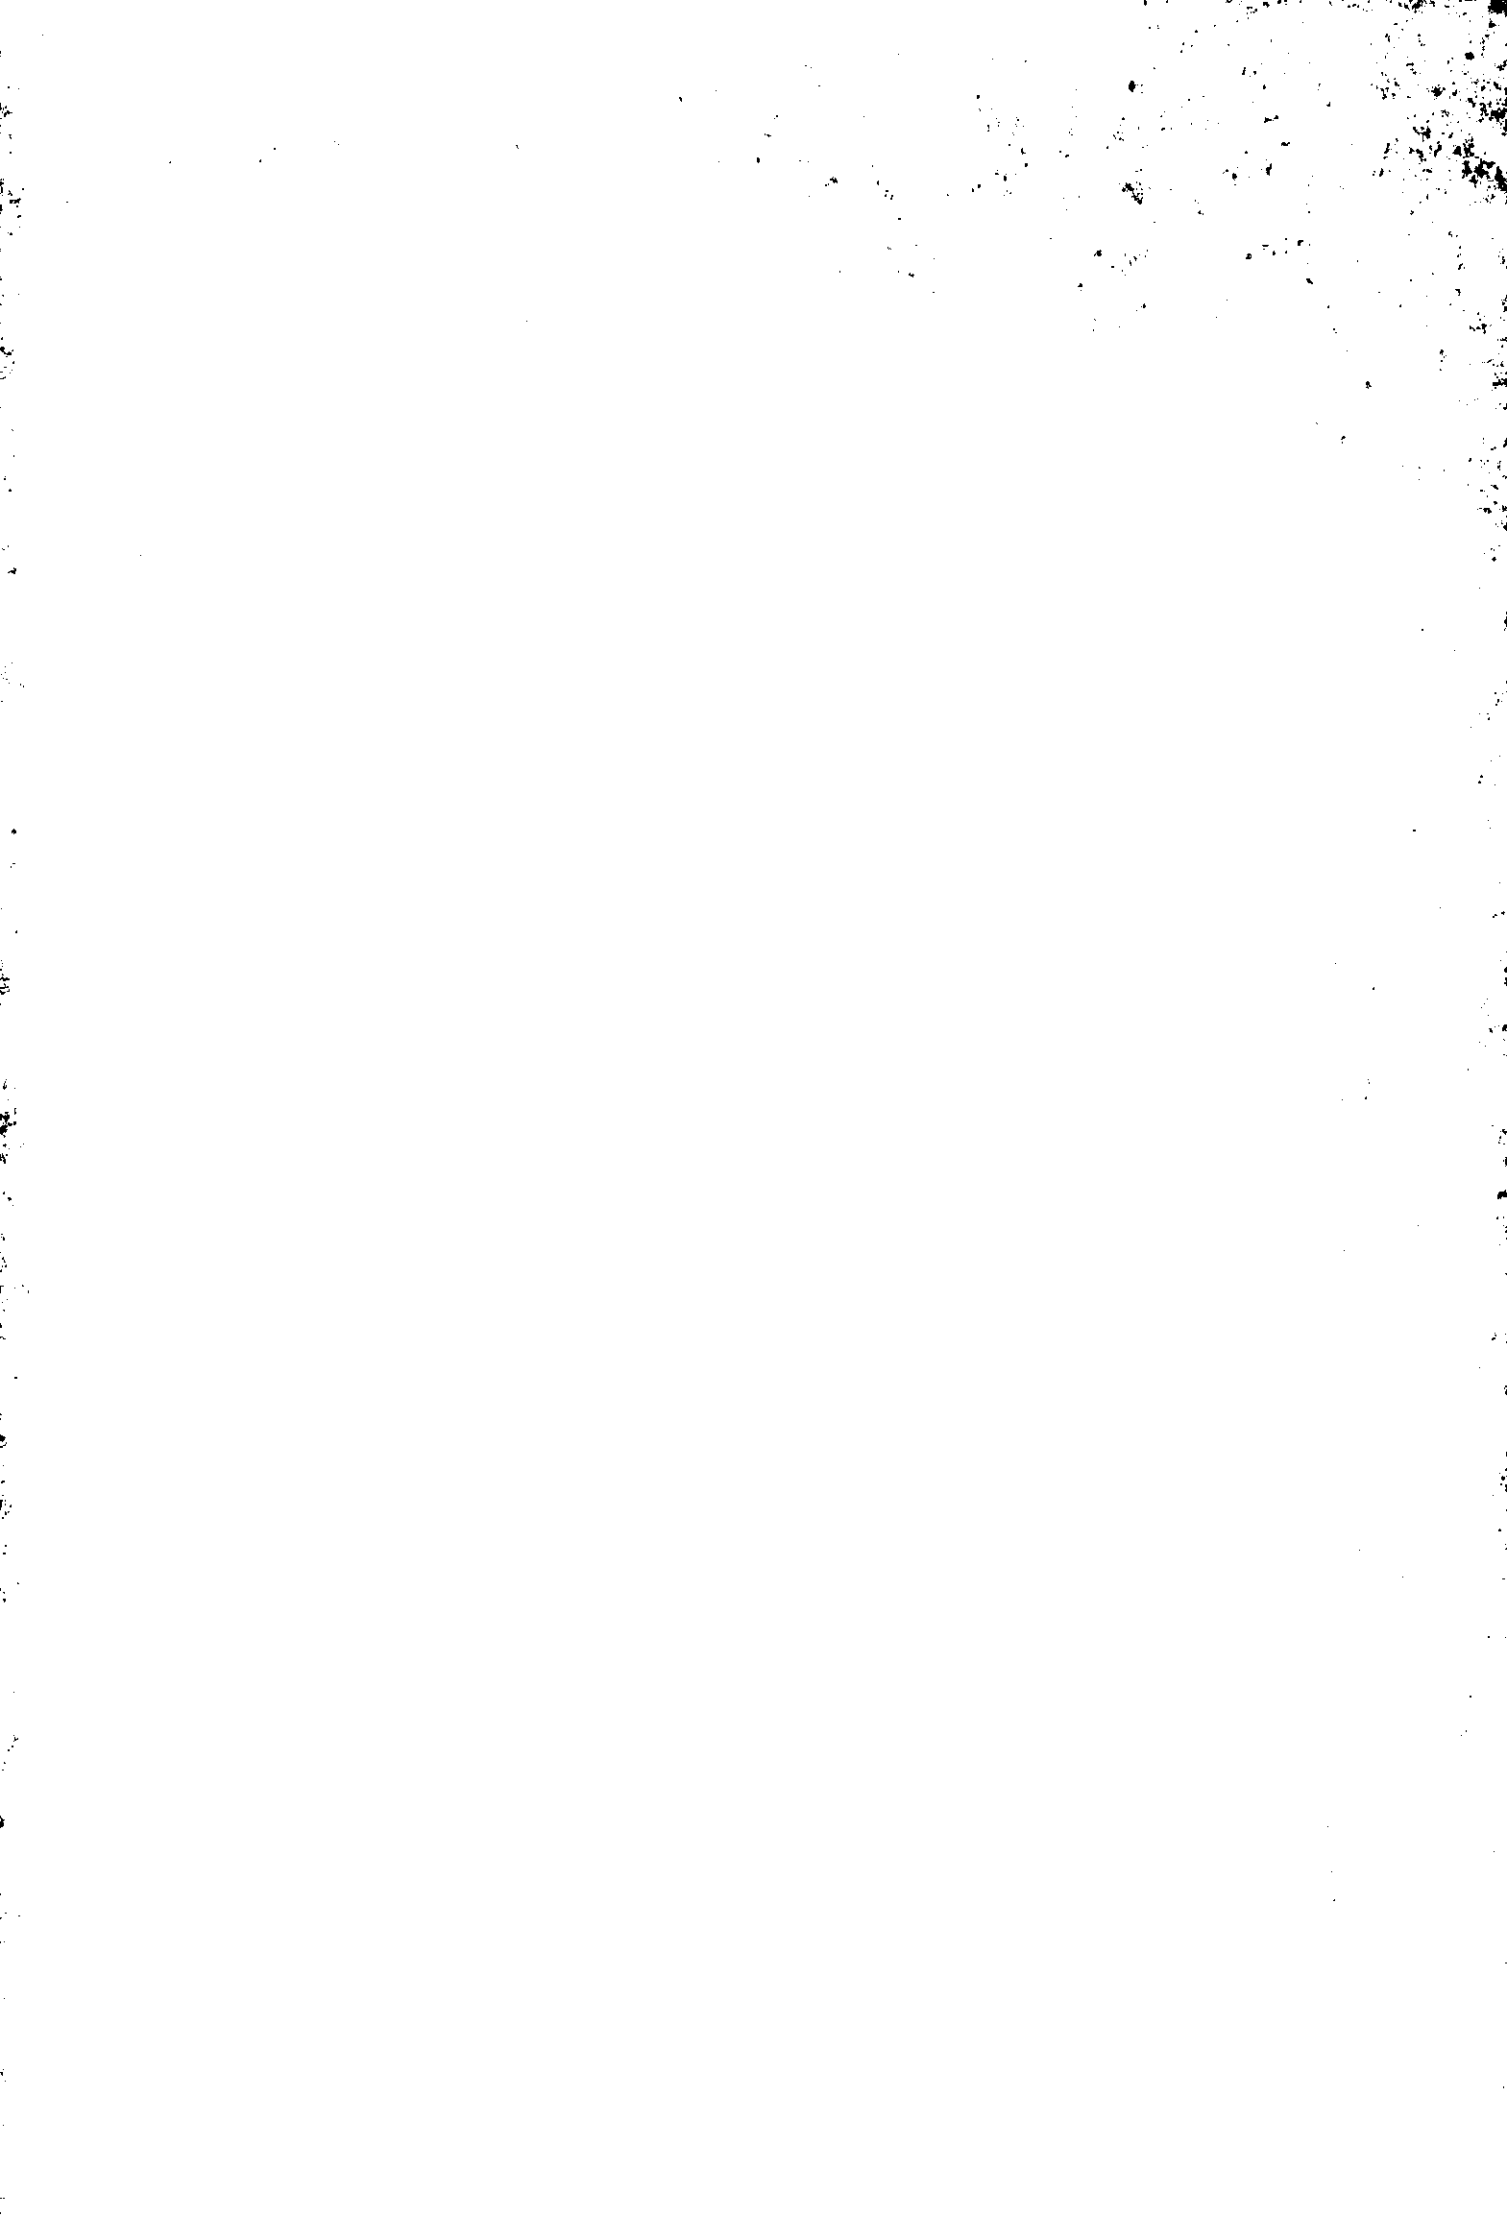
- Manufacturing Space

- Product Space

- Man Space

- Manufacturing Services (Appendix I-10) Space
    (Tool Crib, Cutter Grinders etc.)

- Services (Appendix I-11) Space (Power, Water etc.)

The design of offices and similar areas is usually the domain of architects. The industrial or layout engineer furnishes them with information relevant to administration and production requirements, for example, the number of staff to be accommodated, the office equipment needed, etc.. Special areas are usually designed through co-operation between architects and engineers. In respect of manufacturing areas it is the factory layout engineer who is principally involved. Architects or other professionals also try to exercise their influence in these areas, but such approaches must be considered as secondary because they cannot guarantee technologically orientated, cost effective production.

It is the intention here to highlight the special features of manufacturing areas from a Factory Layout Planning point of view, and a discussion of the spaces of main concern

follows.

4.2.1.1 MANUFACTURING SPACE

Manufacturing Space is defined as the whole space where product [84] manufacturing is performed, i.e. it is the space occupied by:

- Work Stations [84](incl. accessories), Work Centres including assembly, inspection, painting etc.

- Operational Space (space for all movements of work station parts, essential for smooth production flow e.g.robotics, and movements of Material or Work in Progress (W.I.P.) [84] within the work station).

- work station Maintenance and Repair Space.

The smallest, self-contained unit of Manufacturing Space is a WORK STATION MODULE which is a sum total of all three spaces and includes Man Space (see below). It is simulated as a 3-D computer drawn template {see Fig.5.}. See also program 'WSBUILDR.FOR', Chapter 4.5.1, and Appendix II.

The WORK STATION MODULE is also part of the Work Station Card containing manufacturing and other information regarding the work station (Appendix III, Drawing No. 1, sheets 1 to 6).
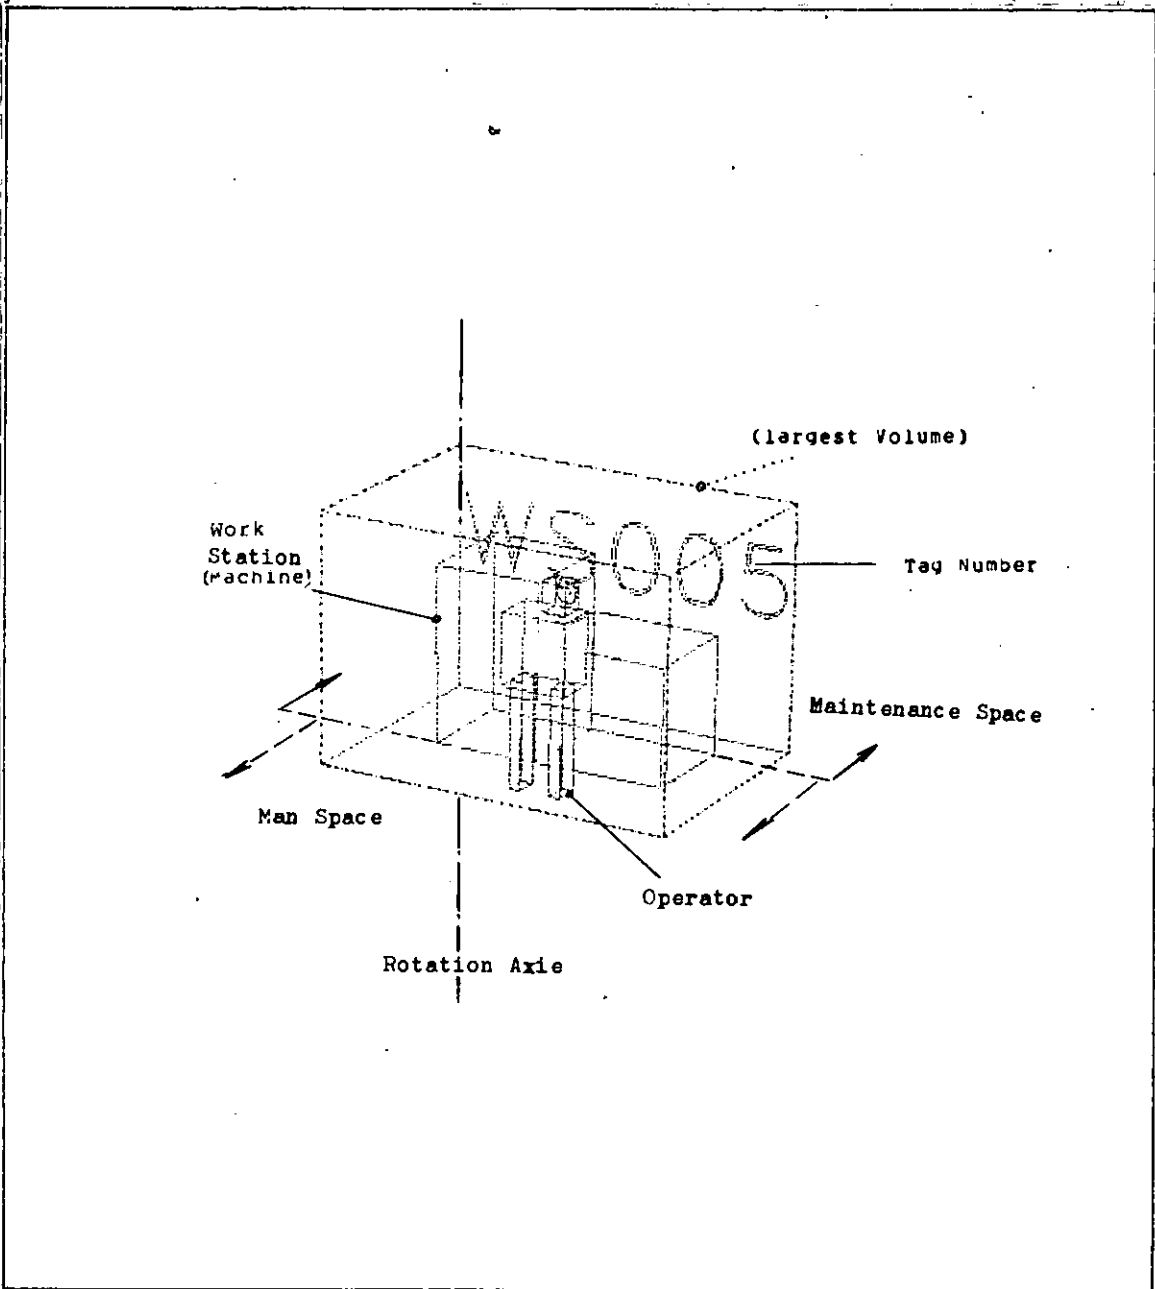
Fig. 5.

WORK STATION MODULE
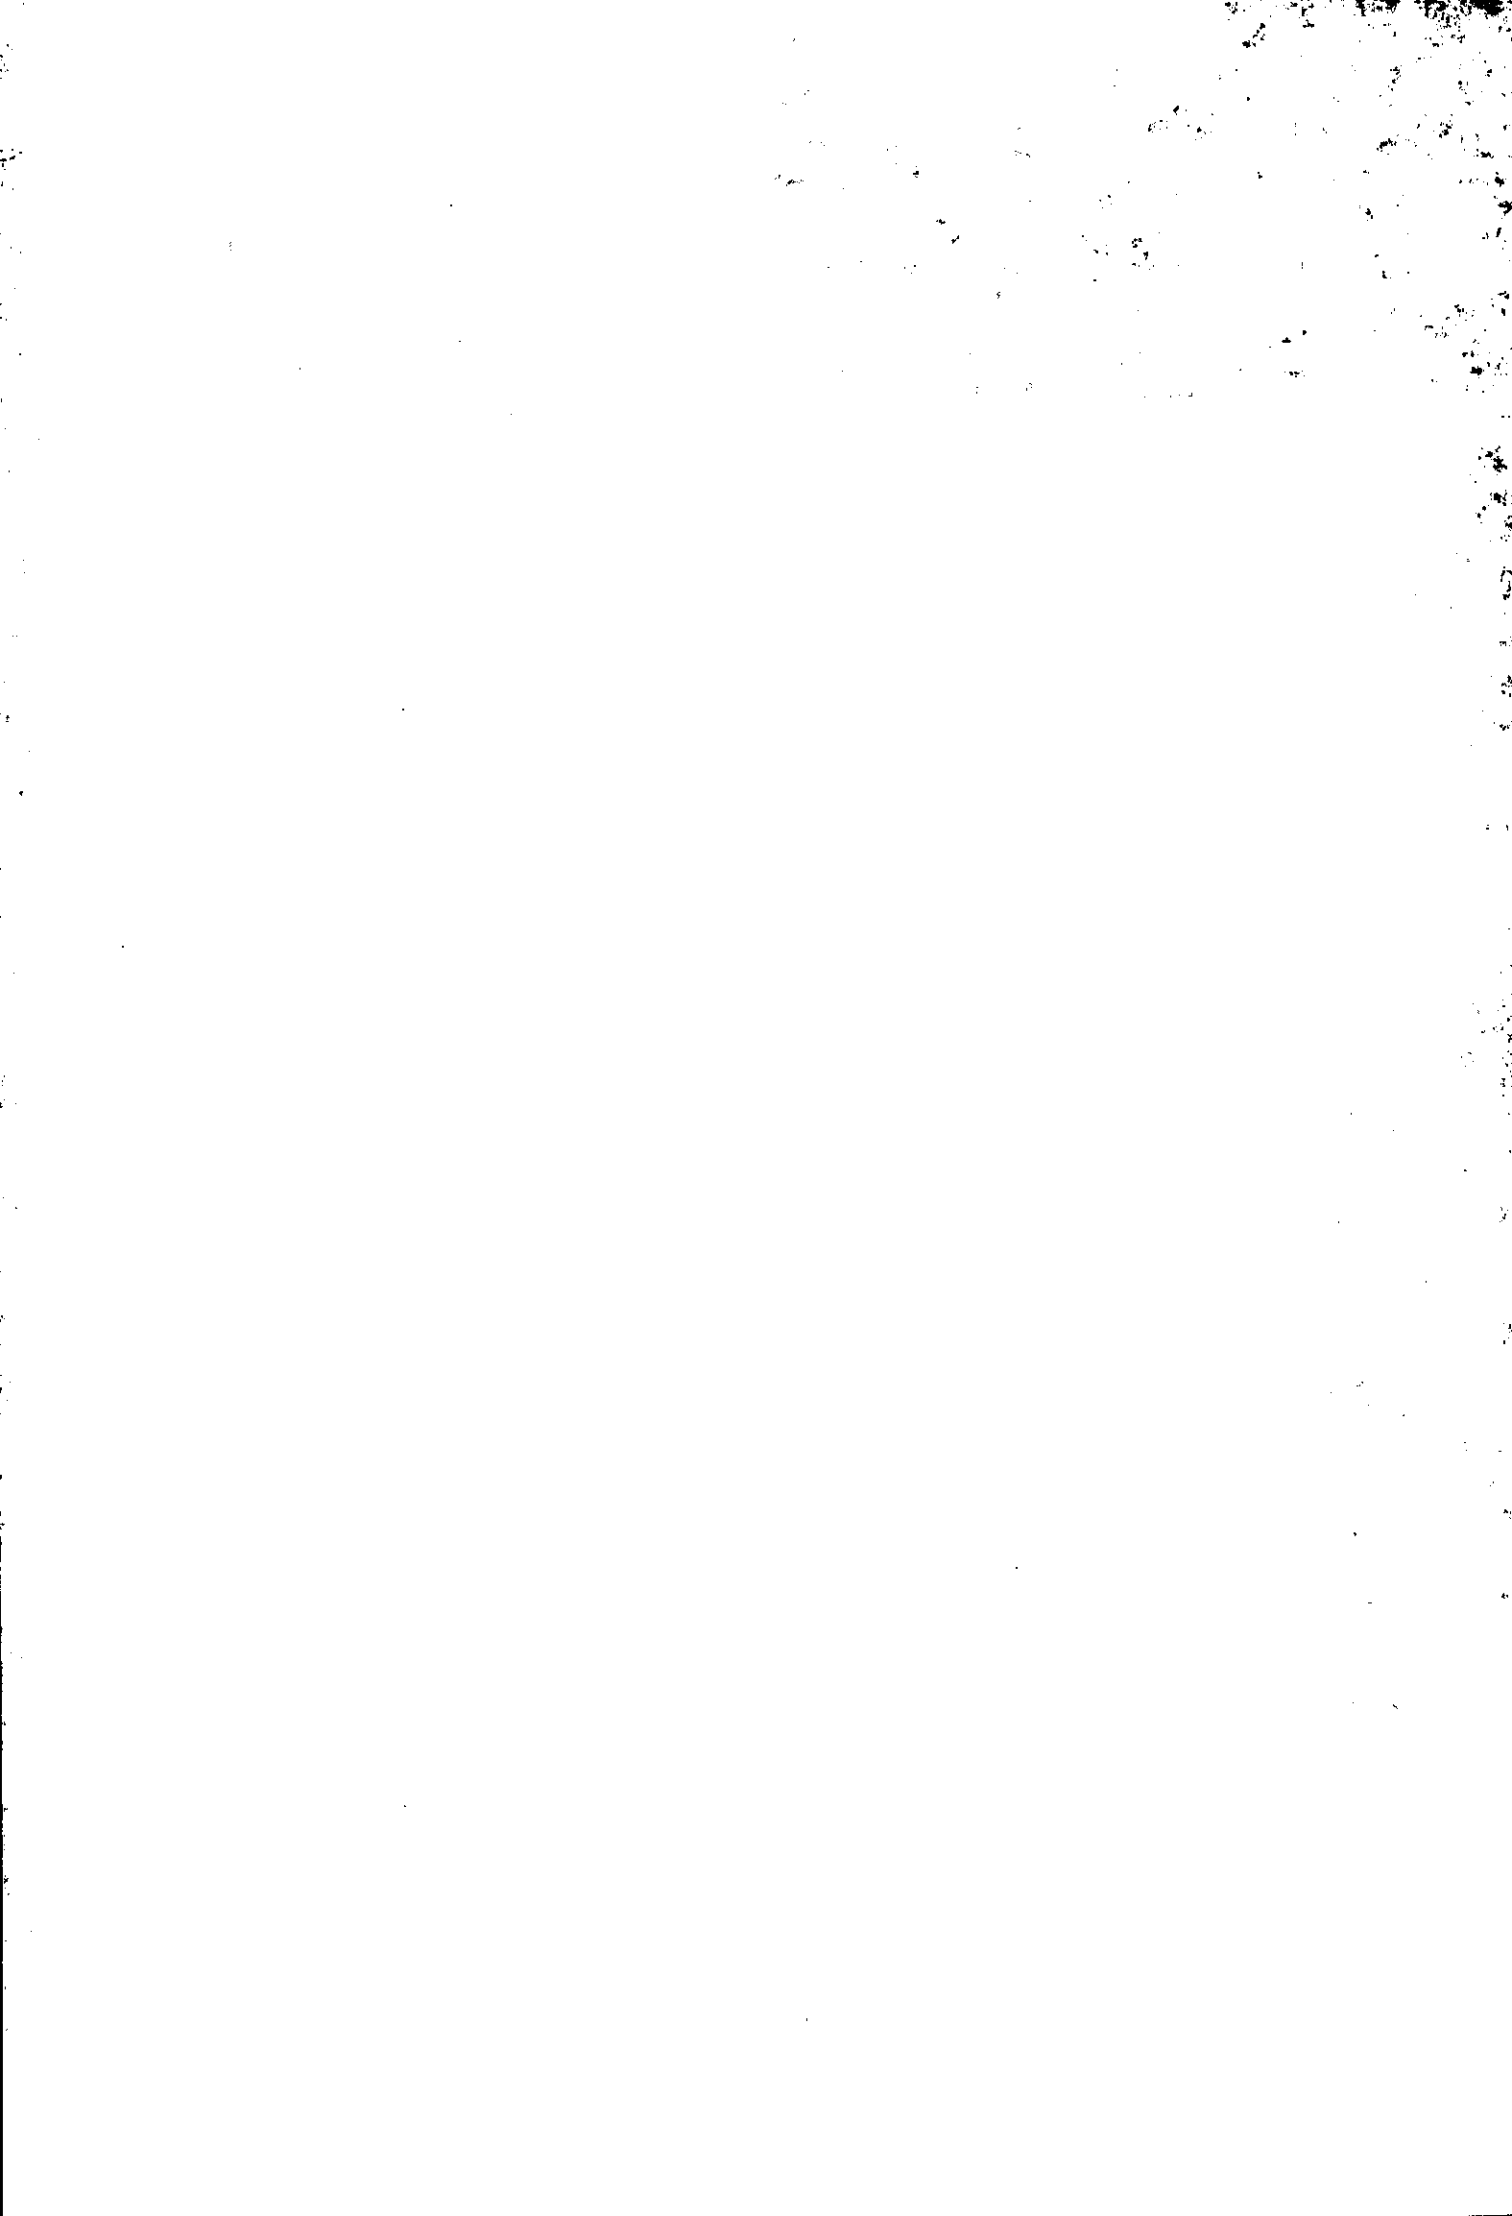
4.2.1.2 PRODUCT SPACE

Product Space is defined as the space occupied by the Flow of Material, W.I.P., Product, Swarf and Scrap. It includes the space needed for Material Handling equipment and Intermediate Stores.

NOTE: For machine interfaces (deployment of robots etc.) Product Space ends from the very moment when/where the W.I.P. is attached to the work station. A moving work station is considered as a special case of Manufacturing Space.

4.2.1.3 MAN SPACE

Man space is defined as the space necessary for operator(s), fitter(s), etc. to perform all the duties regarding the manufacturing process, and is designed in accordance with the ergonomic principles.

4.2.1.4 MANUFACTURING SERVICES (AUXILIARY) SPACE

Manufacturing services (Auxiliary) space is defined as that space required to accommodate machine services, e.g. Tool Crib, Cutter Grinders, Tool Salvage etc.

4.2.1.5 SERVICES SPACE

Services Space comprises ducts, enclosures, cable trays,

etc., and/or maintenance steelwork accomodating supply lines of gasses, power, technological water, coolant, oils etc. for manufacturing purposes.

4.2.1.6 SHOP FLOOR "BREATHING SPACE"

Shop floor "Breathing Space" is the space where NONE of the above spaces are included. (It could be empty). In practice a space like this is usually kept as reserve to accommodate small changes in layout, and expansion. It is usually utilized as additional intermediate store.

It should be noted that all the 'technological' spaces are considered above as well as below zero floor level according to specific situation and needs.

Foundations of work stations, equipment, etc., are considered as being part of the spaces (sub-systems) to which the work stations, equipment, etc., belong (e.g. foundation for a production milling machine is considered in the sub-system Manufacturing Space).

4.2.1.7 BUILDING - CIVIL ENGINEERING SPACE

Building - Civil Engineering Space is defined as the space physically accommodating all 'technological' spaces (Manufacturing Space, Product Space, Man Space,

Manufacturing Services Space, Services Space, and Breathing Space), and is providing a suitable environment.

The space includes:

Foundations of buildings (columns etc.)

Floors, Staircases, Platforms, Pits, Ramps etc.

Columns

Storm and sewerage water ducts

Drinking water piping

Walls, Barriers, Doors, Windows

Roof structure

Any unspecified structural supports, stiffeners, etc.

Heating and Ventilation, and

Lighting.

4.2.2 PRODUCTION PROGRAMME

The reasons for wishing to change the layout of a factory such as market forces, orders and production capacity requirements were considered, but are not part of this study. It is assumed only that the Production Programme has been determined that and a new layout has been requested.

The Production Programme basically conditions the type of production (technology, operations, types of machines, and equipment), and this directly influences the type of layout (as quoted in Introduction, Chapter 1.).

4.2.2.1 INFLUENCES OF PRODUCTION PROGRAMME

ON DESIGN OF MANUFACTURING SPACE

In Chapter 3. were discussed some computer aided systems which also consider Production Programmes. They sometimes use very sophisticated methods to arrive at a very simple, and usually the only possible, solution: i.e., positioning work stations 'technologically' in an order/line, which is at the same time an economic optimum.

It is also the practical layout strategy (see 4.3) of positioning work stations in a real industrial bay that dictates [13] the order of work stations. This could be, in an overwhelming number of cases, only a physical line of interrelated work stations.

Once a 'technological' position of work stations is computed (by any of the suitable systems mentioned in Chapter 3.), or intelligently established, the actual layout may be designed with CAFLAP system in a straightforward manner. CAFLAP system operations start from the very moment when a 'technological' order of work stations is established, and this data is fed into the system. It can be said that the type of Production Programme, or even type of layout, has no bearing on the design of manufacturing space by CAFLAP system. Neither can it influence the performence of CAFLAP itself.

4.2.2.2 INFLUENCES OF PRODUCTION PROGRAMME

ON DESIGN OF PRODUCT SPACE

The Production Programme cannot be considered in isolation and the influences of Production Management techniques (state of organisation) must also be considered. Together they create needs for size of aisles, stores, intermediate stores and Product Space next to work stations.

When designing the size of aisles, the basic unit to be considered is the Unit Load (expressed in dimensions, widthxlengthxheight, and in volume/hr or weight/hr). Unit Load is defined as an optimum load in Material Handling (M.H.) to satisfy all principles of standardization; or simply as " a unit to be moved or handled at one time" as suggested by Tompkins and White [39].

For the purposes of deriving the computer graphics expression, the basic equations from Hydrodynamics was considered:

$$\omega = Q / F$$

where ω = speed of movements
of Unit Loads (m/hr)

Q = Volume of Unit Loads
manufactured per unit
of time (cu.m/hr)

F = sectional area available
for transport (sq.m)

$$F = w \cdot f$$

and

$$f = Q / \omega \cdot w$$

w = Aisle width (m)

f = "filling" of the Bay (m)

is height of the Aisle

utilised for M.H.,

(indicates the density

of M.H.).

It has to be said that the above considerations only serve as an auxiliary guide because the real movement of material in batch production is in paces. However, such equations help to define the optimum dimensions of transport aisles when translated into computer graphic histograms.

Further the value 'f' (filling) can:

a) Indicate any slowdown in M.H. area, or production area and, once the optimum value is established, any deviation could be monitored, i.e. it could be used as a tool for the Production Control Department;

b) Show what speed of movements in Product Space is required; how many M.H. vehicles, fork-lift trucks, or what sort of M.H. means of transport are needed.

Computer Program 'M100.FOR' was contemplated to provide

basic data for the above.

In order to design the size of Product Space at work stations, the following basic systems have to be considered: Two Bin system, Just-in-Time system (KANBAN) and Base Stock control [77,78,79,80]. For any of these systems presentation of Product Space creates special problems, and these are dealt with in section 4.3 Layout Strategy.

The product mix and size of batches can influence Product Space (see 4.2.1.2) considerably, but only if the batches are very small. This has, of course, to be considered in conjunction with M.H. cycle and unit loads.

A unit load (Ul) has requirement for space (Us);
the total time required for machining of a batch is Tb,
and the duration time of a regular M.H. cycle is Tmh.

If a unit load is equal to one batch, and time Tb is N times smaller than M.H. cycle (Tmh),

$$\text{Tmh} = \text{Tb} \times \text{N} \quad (\text{or Tmh} = \sum_1^n \text{Tb})$$

then Product Space (Ps) -space next to work station available for unit loads waiting for machining or transport- must be increased N times.

$$\text{Ps} = \text{N} \times \text{Us} \quad (\text{or Ps} = \sum_1^n \text{Us})$$

Or, vice versa, material handling cycle must be shortened (which would increase M.H. costs).

The above consideration is of general validity, including the increasingly popular Just-in-Time system (JIT).

If the JIT (KANBAN) system in production control is used, each Kanban (Shop sign, card) represents a unit load -or container load, according to Burbidge [77]. Apart from identifying the contents of a material container, Kanban is used to order a replacement supply when a container is issued. Kanban practically defines the size of a batch. The number of Kanbans issued indicates the number of batches (unit loads) in the process, and determines the size of the base stock. In other words: the more Kanbans, the larger the base stock. This leads to demands for increased Production Space generally.

It must be concluded that, apart from style of production management, the Product Space is influenced mainly by the type of M.H. equipment.

Other product spaces, Stores and Intermediate Stores should be designed intelligently, but could be incorporated into automatic layout system as individual modules.

Overall Conclusion:

Insufficient Product Space generally results in difficulties, especially in the following areas:

- shop floor management/production management

- material handling (clumsy and slow M.H., bad access)

- safety

Excessive Product Space results in an overall increase of shop floor/ space and this creates waste in the following spheres:

- material handling costs (bigger distances),

- ventilation and heating costs,

- lighting costs,

- maintenance costs, and

- larger capital investment costs.

The above indicates that the design of an optimum Product Space is quite a difficult task considering the variability of factors involved. It is made even more complicated by the requirements of computer graphic presentation and this leads to the development of a novelty idea: the concept of a PRODUCT SPACE ZONE (see the following section 4.3).

4.3 LAYOUT STRATEGY

One of the objectives of CAFLAP project is to shorten the time of the traditional layout approximation process (as described in Chapter 2.), while maintaining the principles of a good factory layout. This can only be done by preparing the detail layout first, skipping the two initial project stages: Feasibility Study and Investment Project (see Fig. 6.).
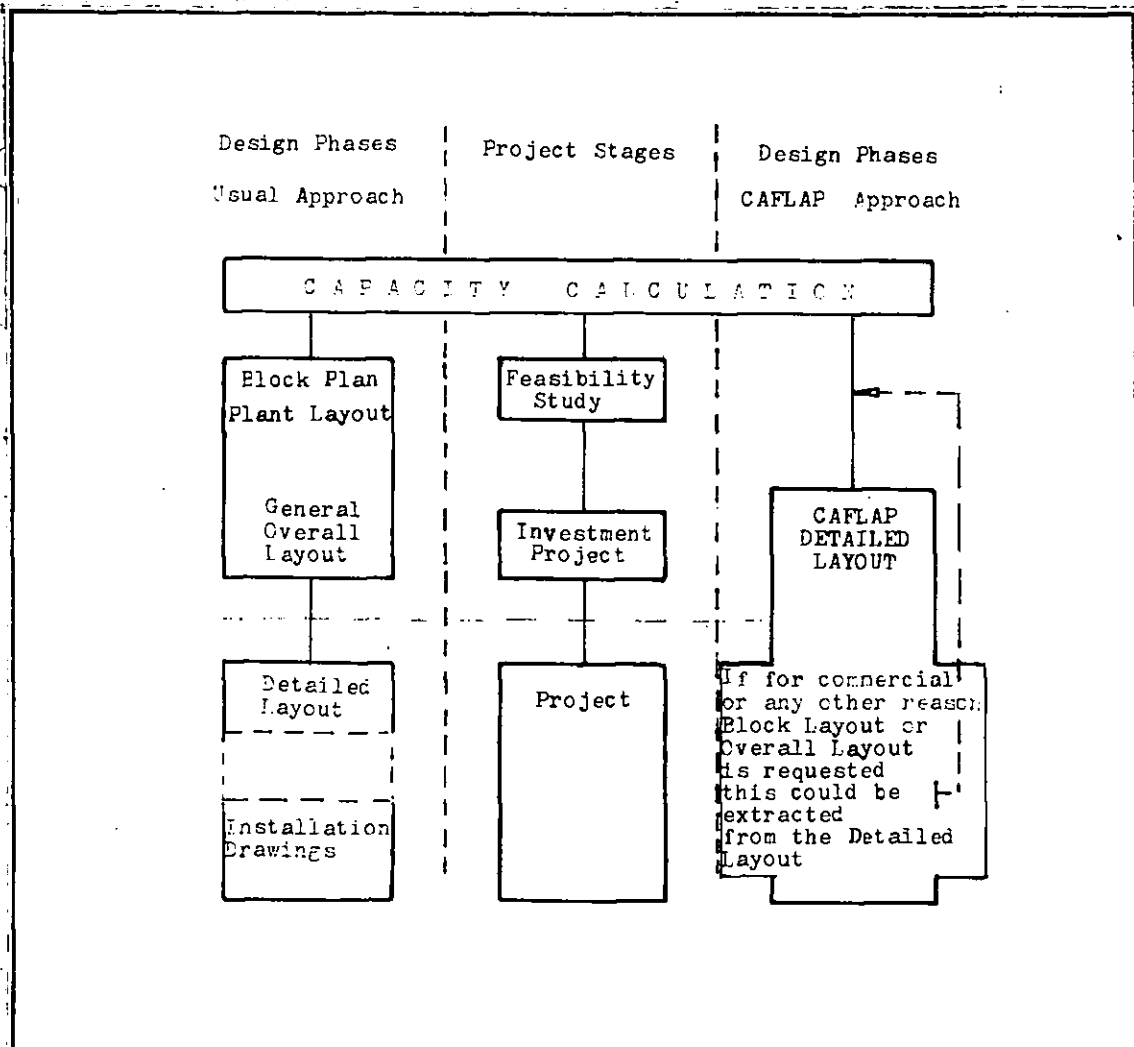
Fig. 6.   PROJECT STAGES - DESIGN PHASES - CAFLAP APPROACH
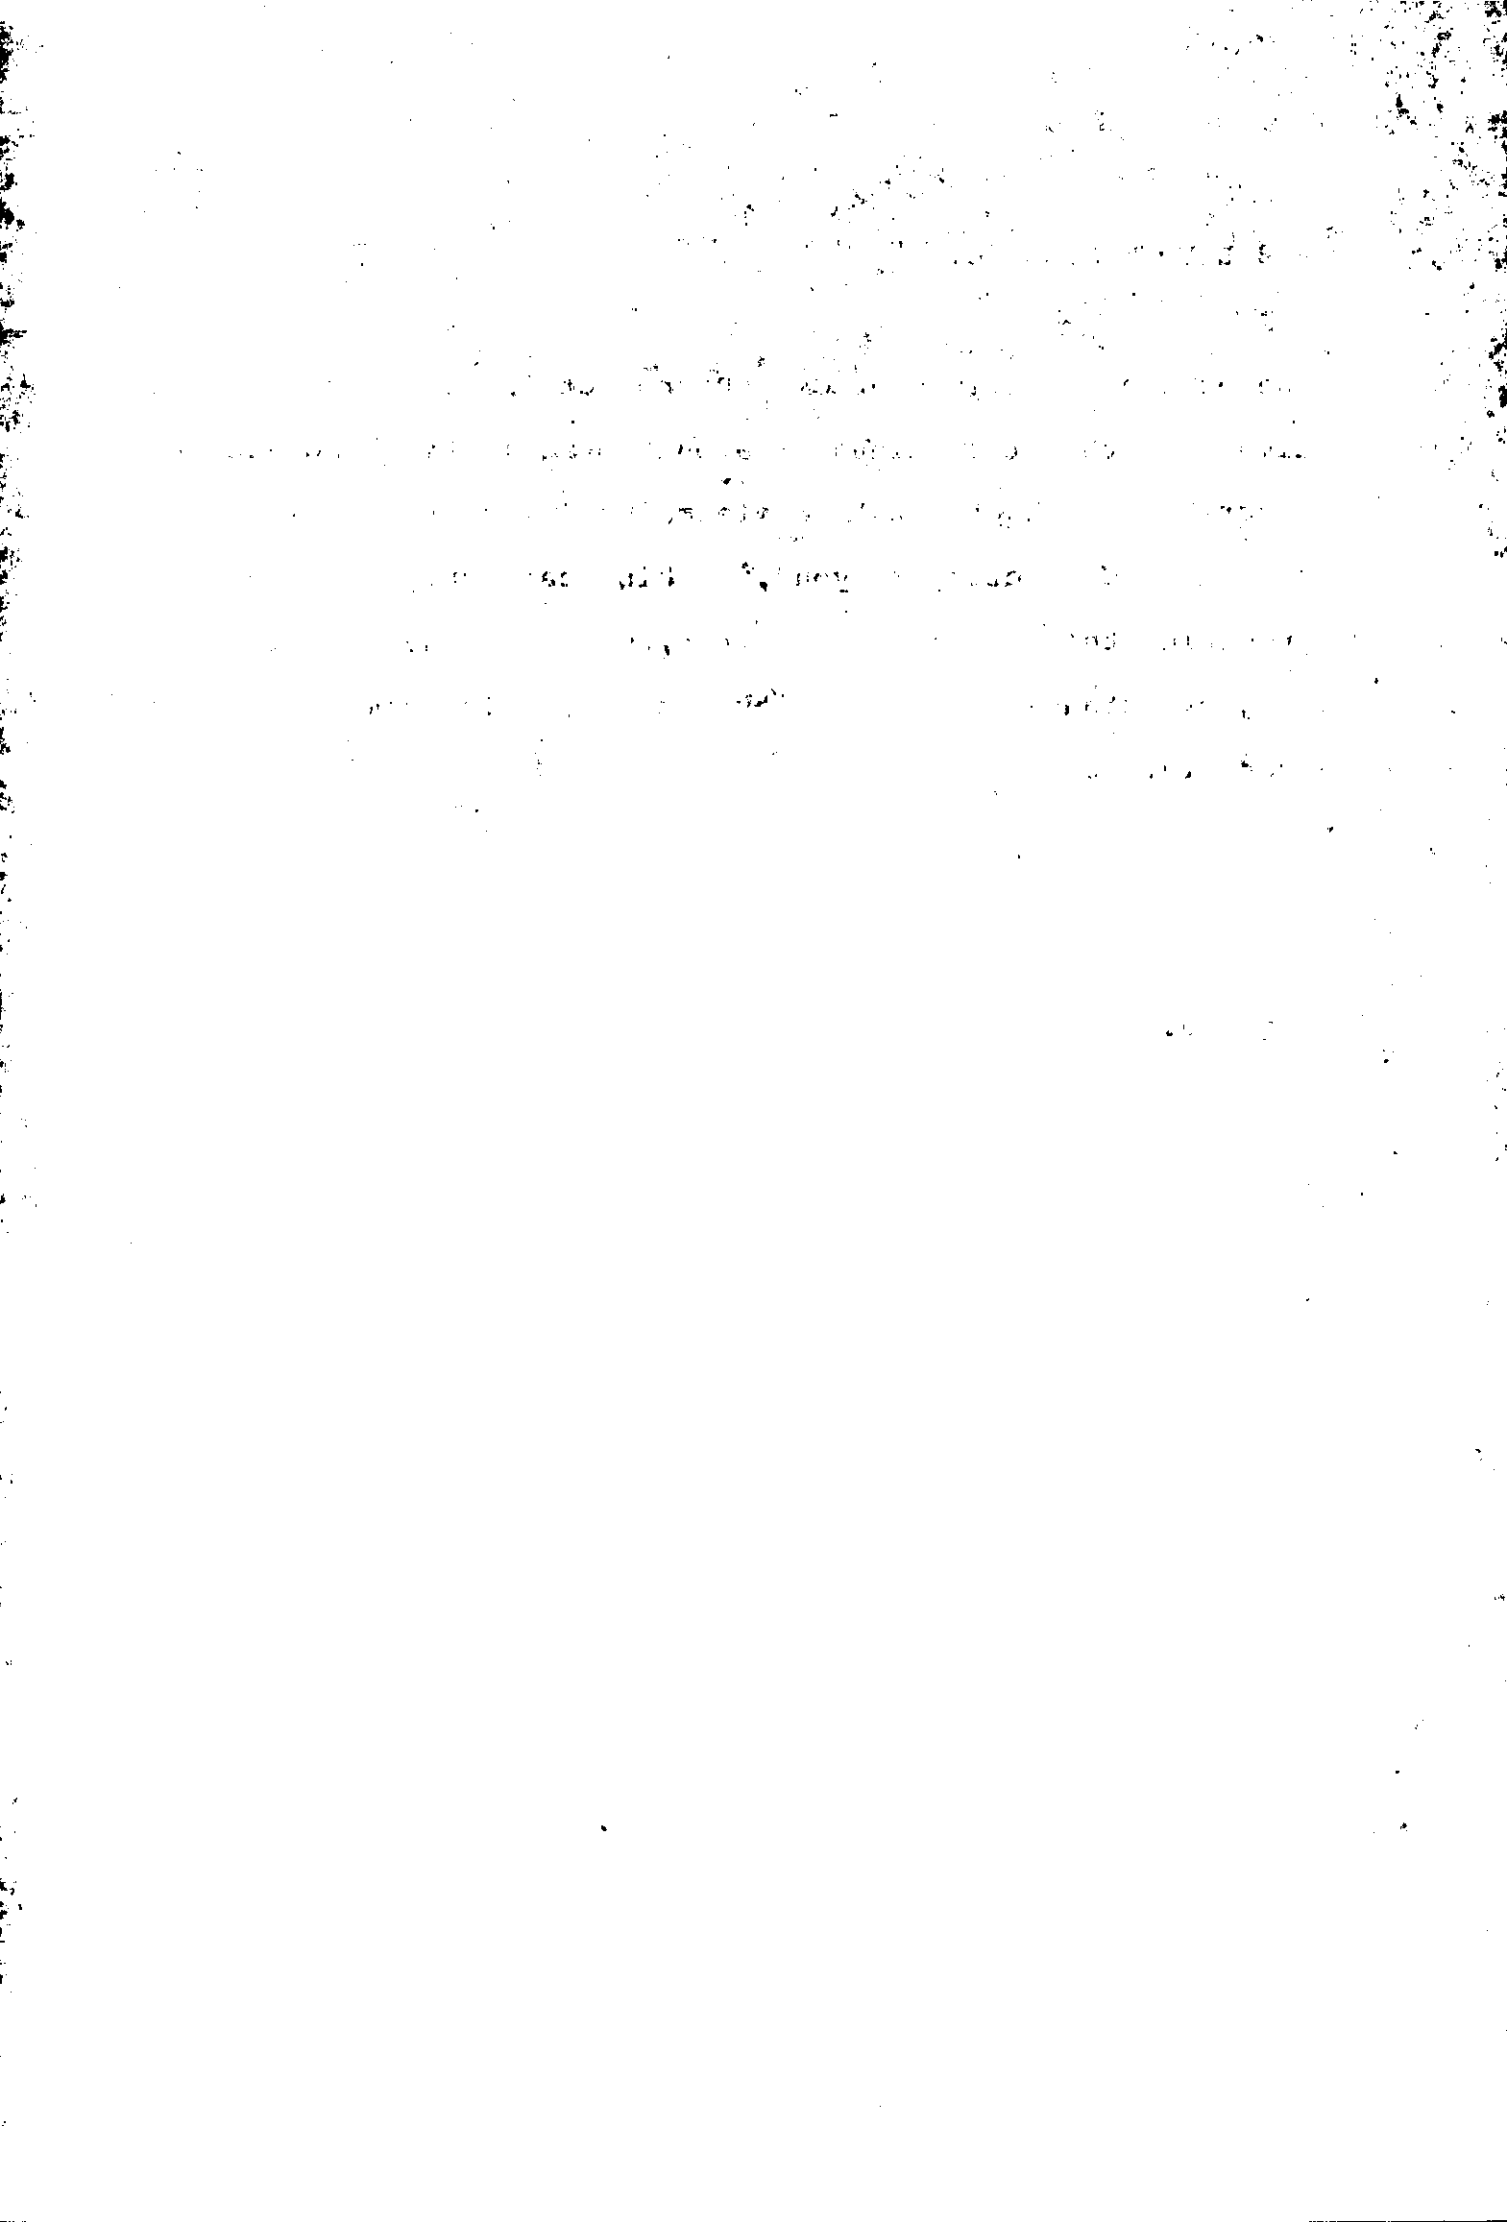
4.3.1 CAPACITY CALCULATION

It is assumed that the number and types of work stations needed will be extracted from Route Sheets (or Job Cards), and the 'technological' positions of work stations will be established (as mentioned in Chapter 3.). The number of machine tools (M/C) can also be calculated via program 'M100.FOR'.

4.3.2 DETAIL LAYOUT

Experience has shown that the actual layout can be prepared effectively only when it is started in the direction of the Flow of Material, and in the 'technological' order of a line of work stations involved.

In Fig. 7., Layouts a) to g) are presented as typical detail layouts of regularly arranged work stations in Industrial Bays.
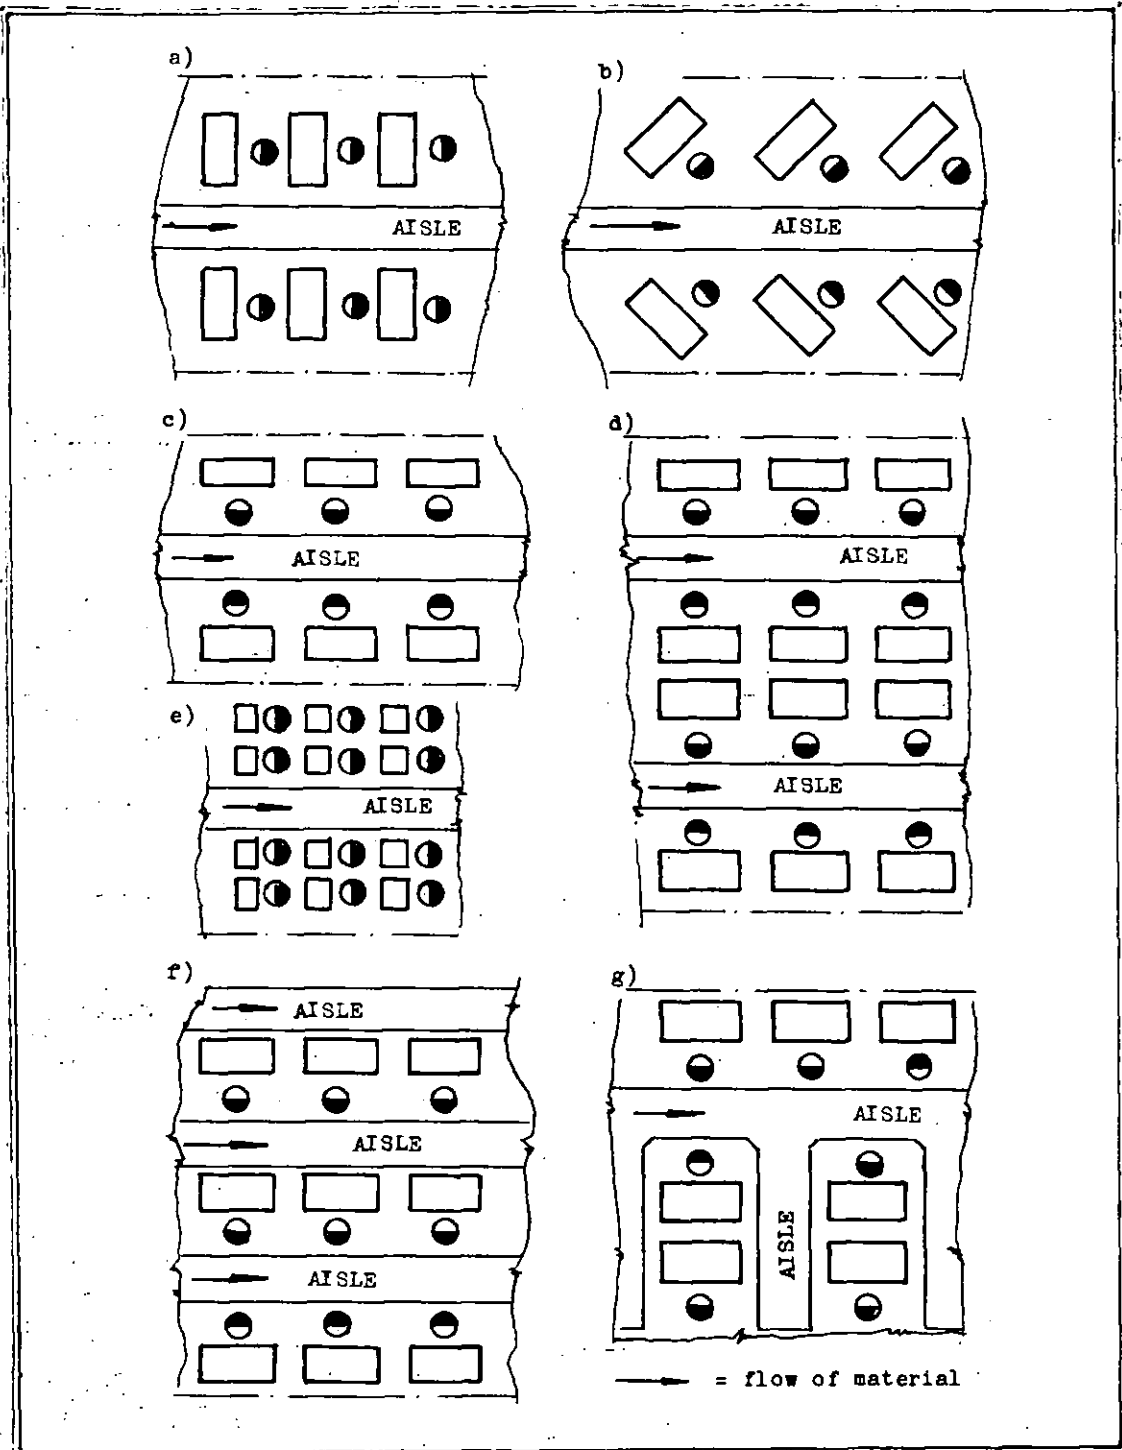
Fig. 7.

TYPICAL DETAIL LAYOUTS OF REGULARLY ARRANGED WORK STATIONS
(Plan views)
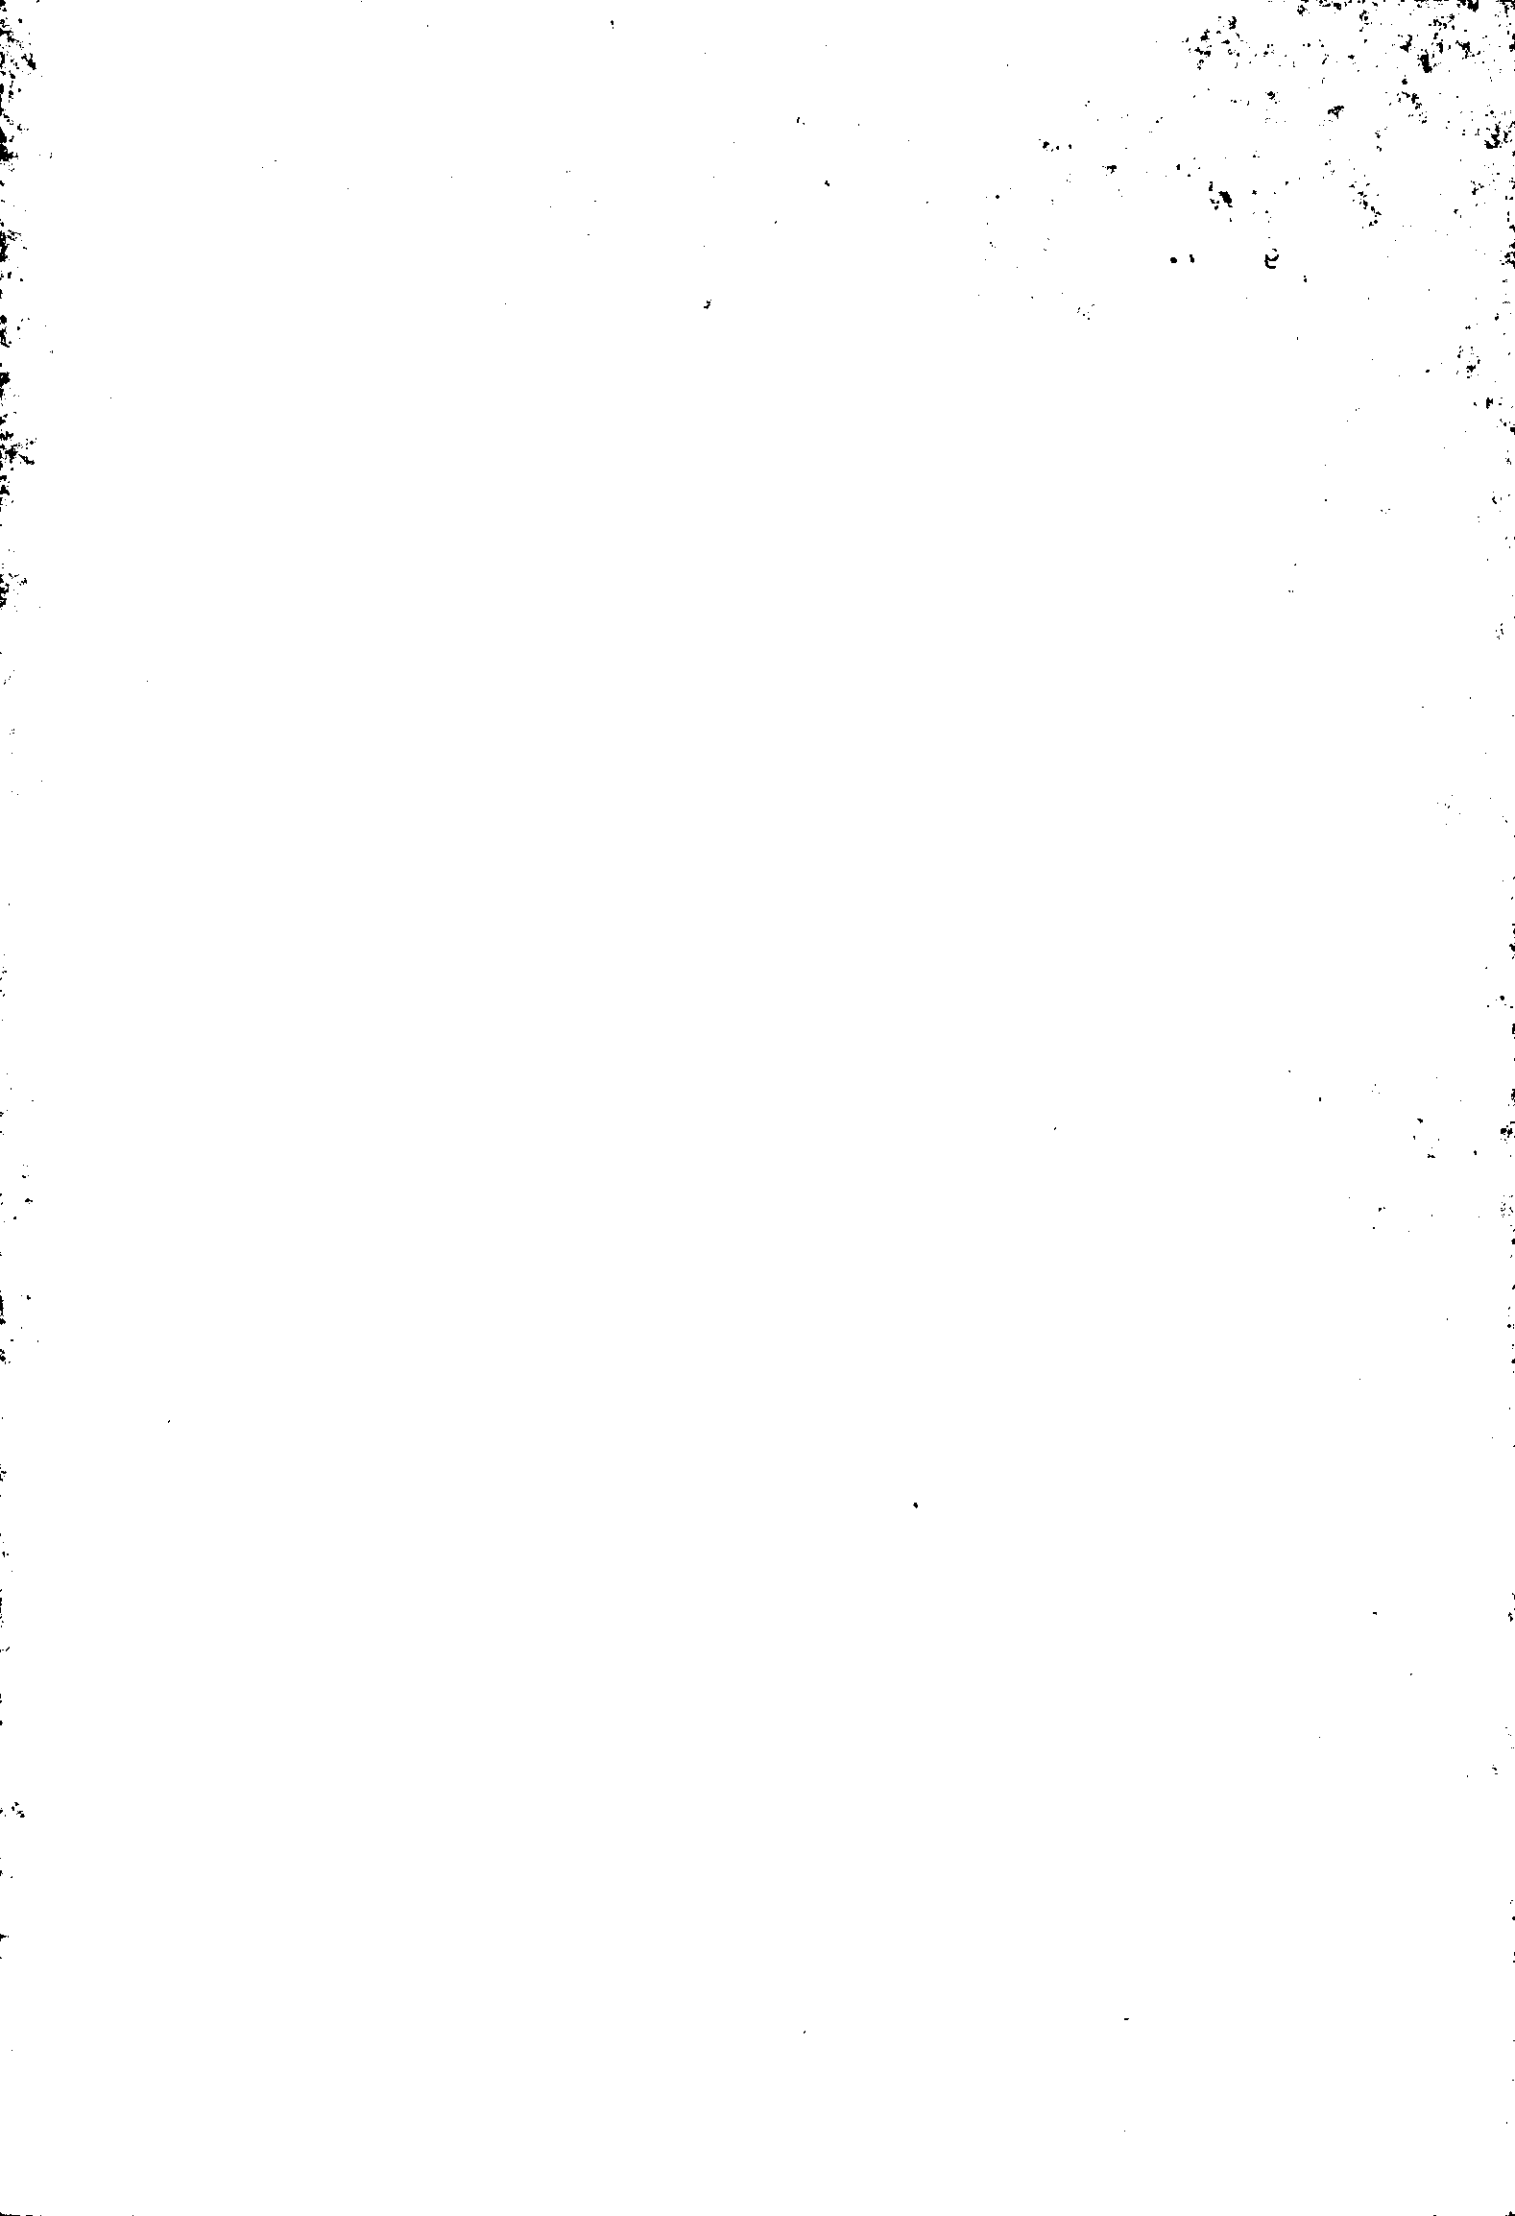
Types a) and b) are considered ideal:

- to satisfy the criteria of a good layout,

   and

- to provide maximum comfort for the operator (create

   a set of environmental configurations in order

   to optimise his performance - all ergonomic

   principles are maintained).

For the above reasons these two types have been selected to be used for automatic positioning in CAFLAP system developed here. The main steps in detailed layout are shown in a system chart {Fig. 8.}.

STEP 1.

The list of work stations is determined and individual Work Station Modules are drawn and filed. The basic width of the industrial bay and the width of the Product Space Zone are determined intelligently according to the width of an everage size Work Station Module and the width of Unit Load {see Fig.9}.

STEP 1.
Basic data

START

Industrial bay is drawn
(Program ①
'CIVES.FOR')

List of work stations
is determined ②
(Programs
'MFEED.FOR' and
'WSVTOTO.FOR')

Individual
Work Station
Modules are ③
drawn and
stored
(Programs
'WSBUILDR.FOR'
and 'WSRECALL.FOR')

STEP 2.

Autometic positioning
(Program 'POSCLASH5.FOR')

First work station
is positioned manually
(POSCLASH5.FOR has its own
manual positioning mode)

Manual positioning
(Programs
'IYTWSFILE.FOR' and
'IYTVAXOO.FOR')

STEP 3.

Next work station
position followe
in 'technological'
order

Individual work stations
are called in arbitrary
order and positioned
manually in any place.
(Entry from ① is not
necessary)

Collision course detector
checks the position, and
signals and identifies
clash.

Layout developed is shown
on VDU.
Session can be interrupted
and again resumed or
abandoned)

yes

yes

Is there
the next work st.
in the file?

Is the position
O.K. ?

The developed layout
can be printed

no

no

Final layout
is presented
and can be printed

Do you wish to see
the scene of the clash ?

yes

EXIT

no

Situation is presented
in detail

Repositioning of the clashing
and any following work
station is done in
the manual mode.

EXIT

When the manual
override is ceased
the automatic
positioning can be
resumed.

The developed layout
can be observed in
any perspective
(Program 'DISPLAY.FOR')

Fig. 8. CAFLAP SYSTEM
SIMPLIFIED SYSTEM CHART

'obstacles' (columns, walls, beams,
maintenance steelwork, etc.)
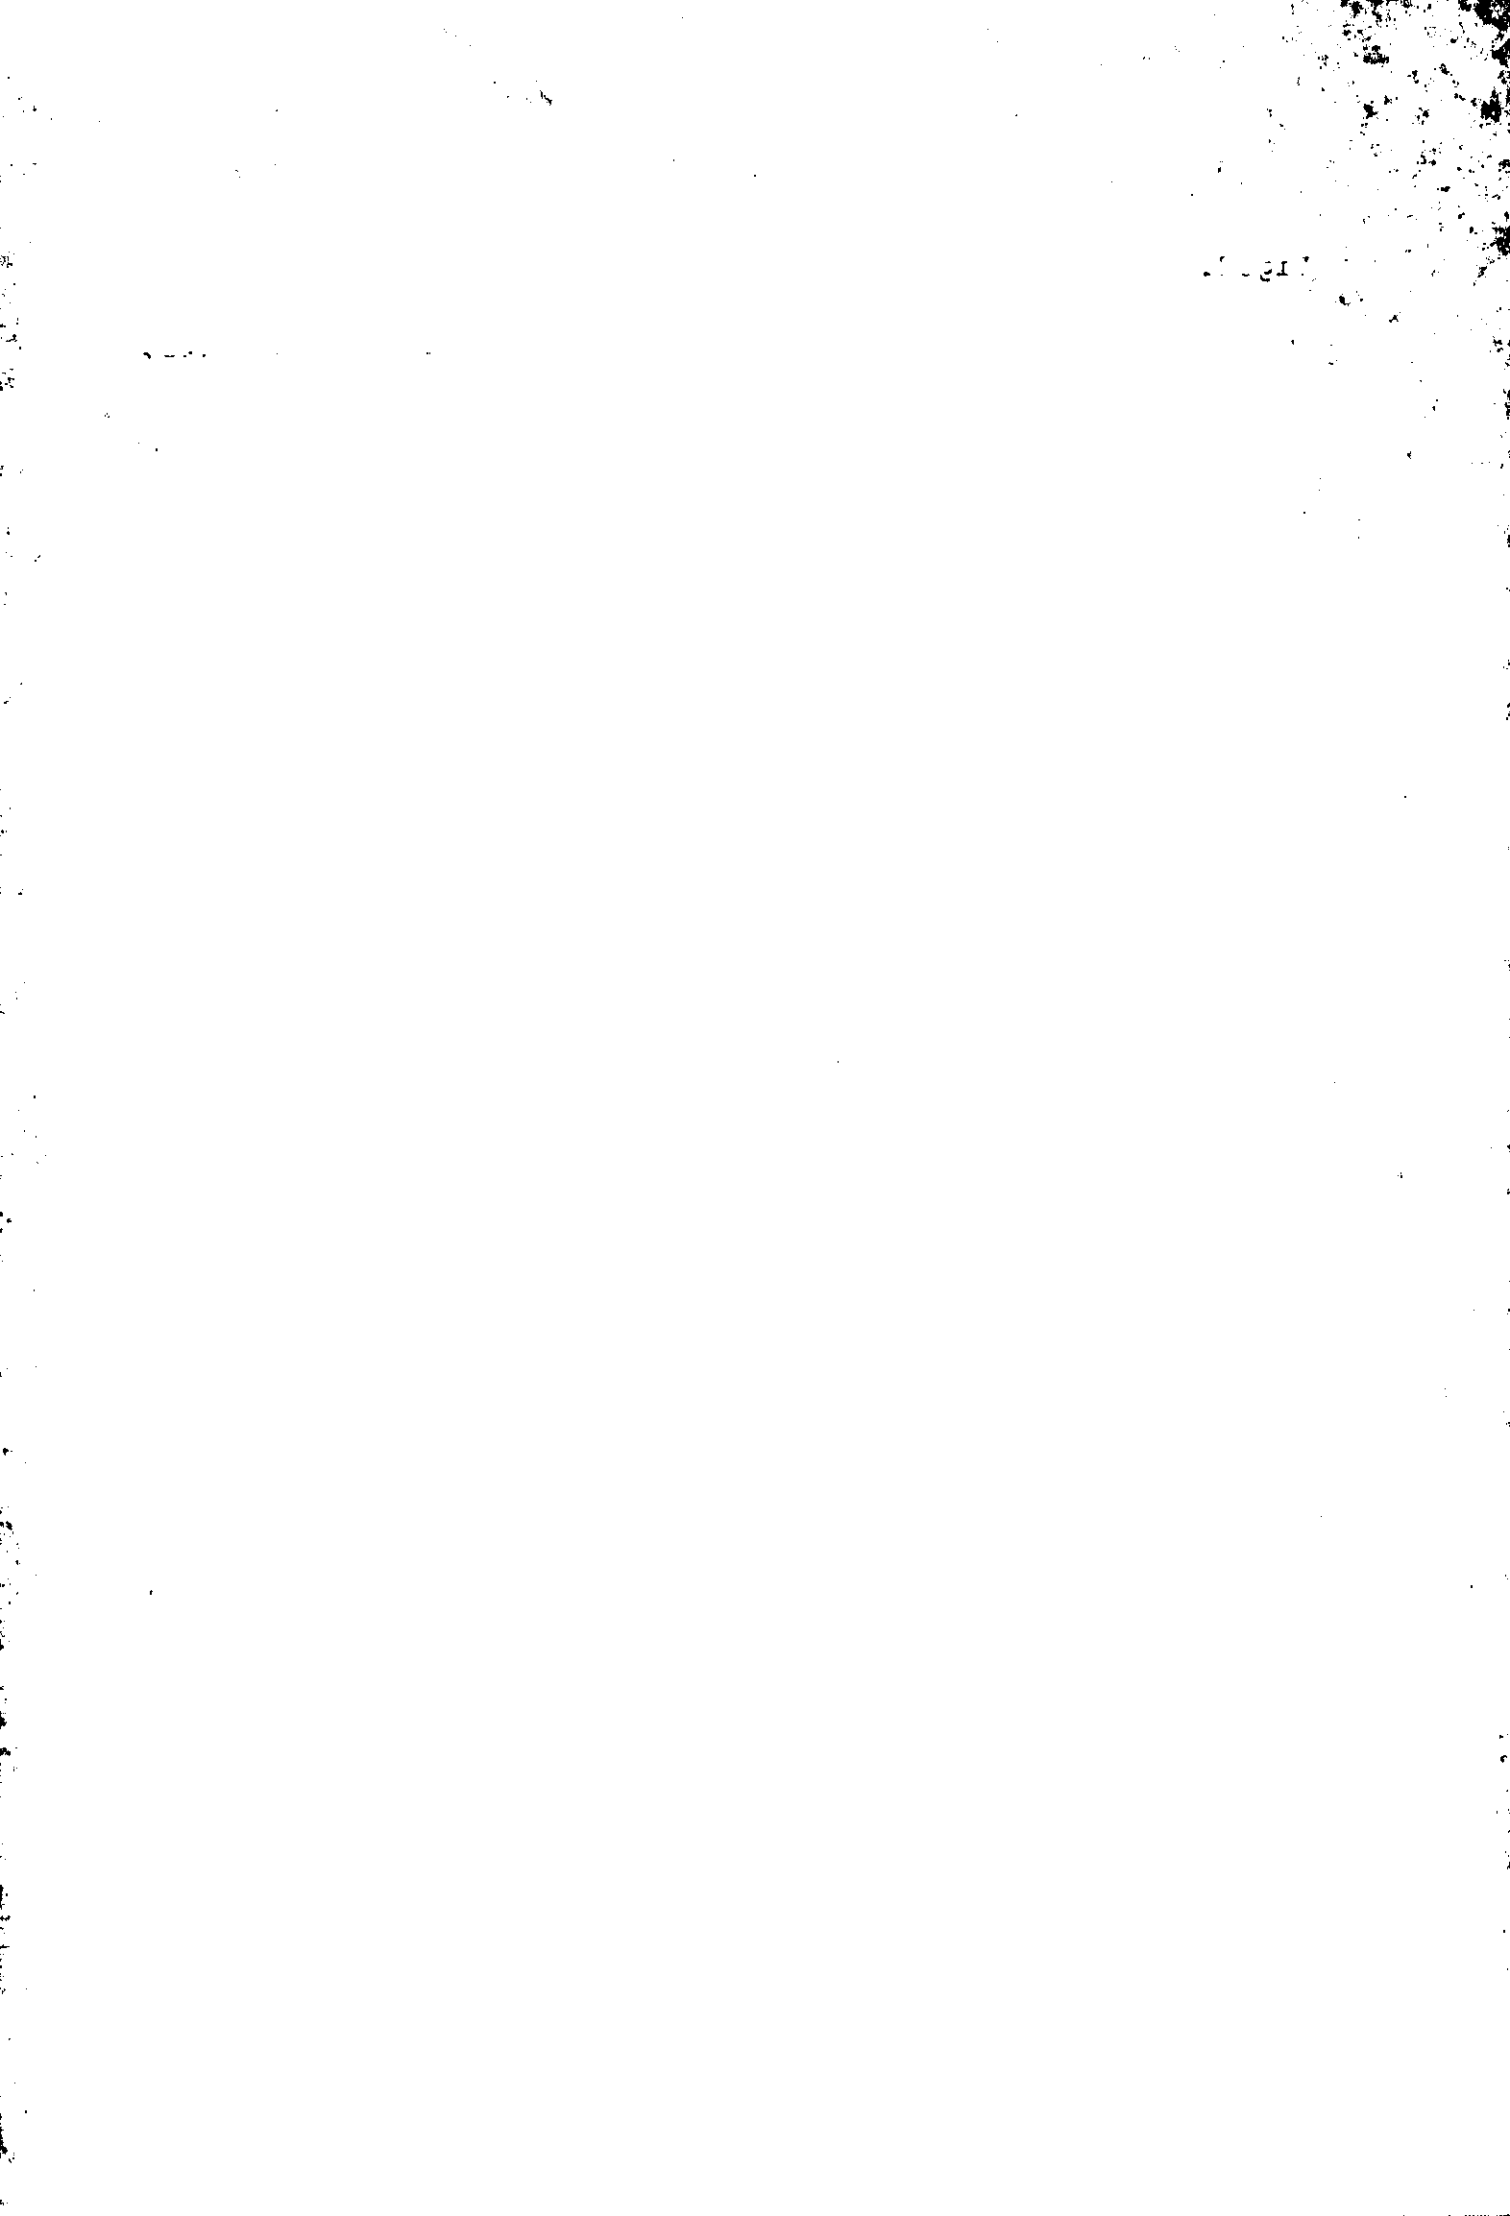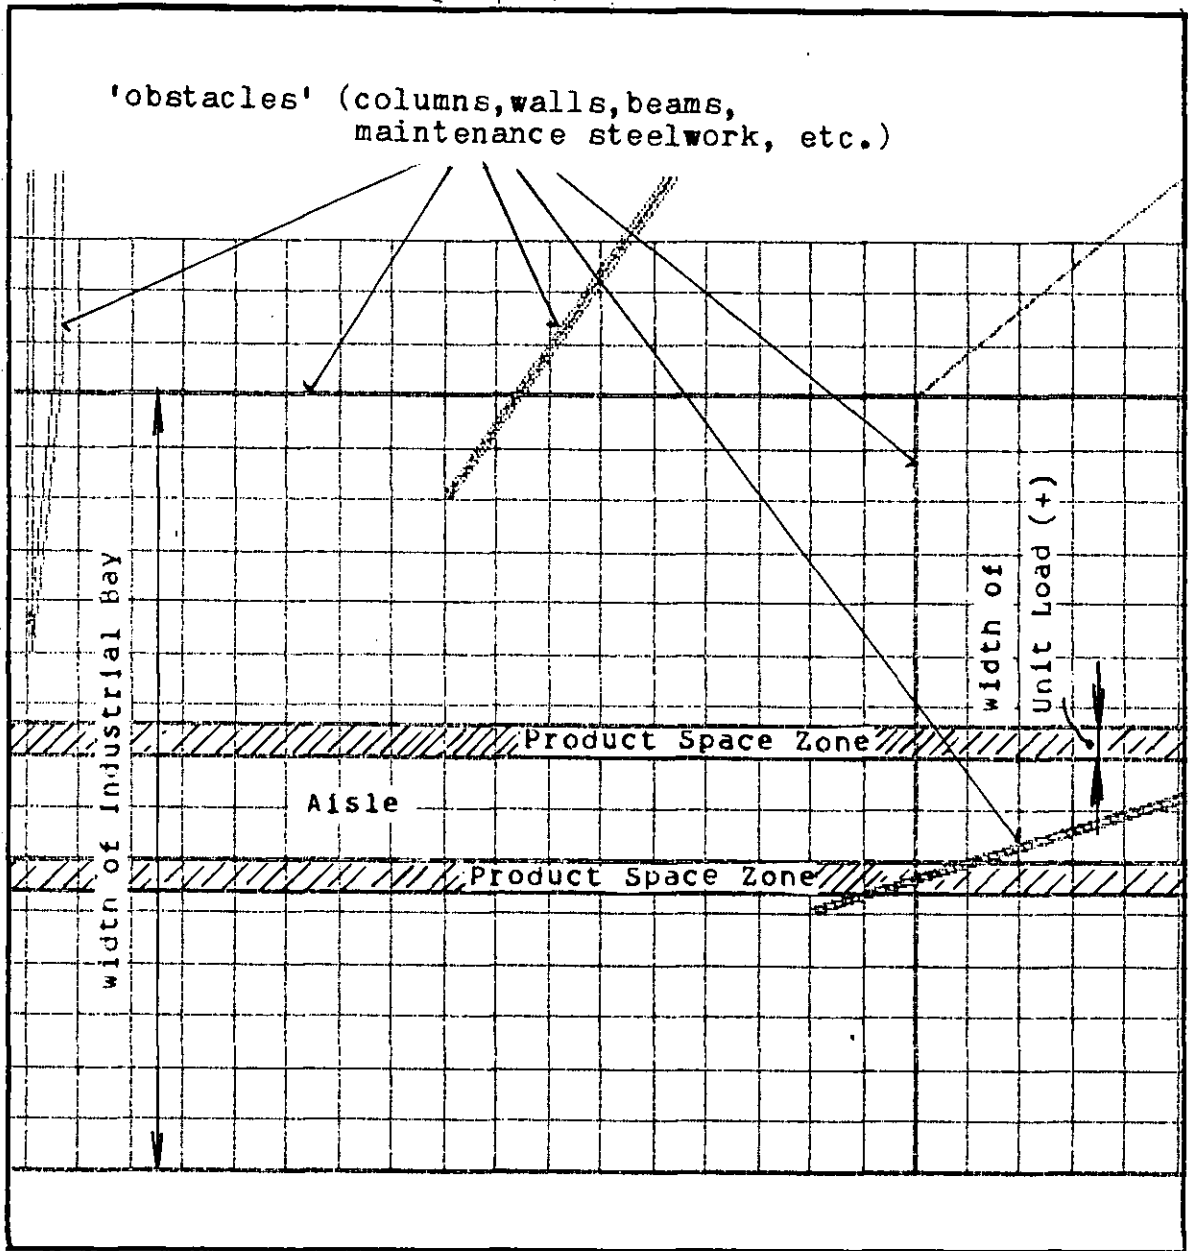
Fig. 9.

DESIGN OF AN INDUSTRIAL BAY

(3 - D   representation, viewed from above)
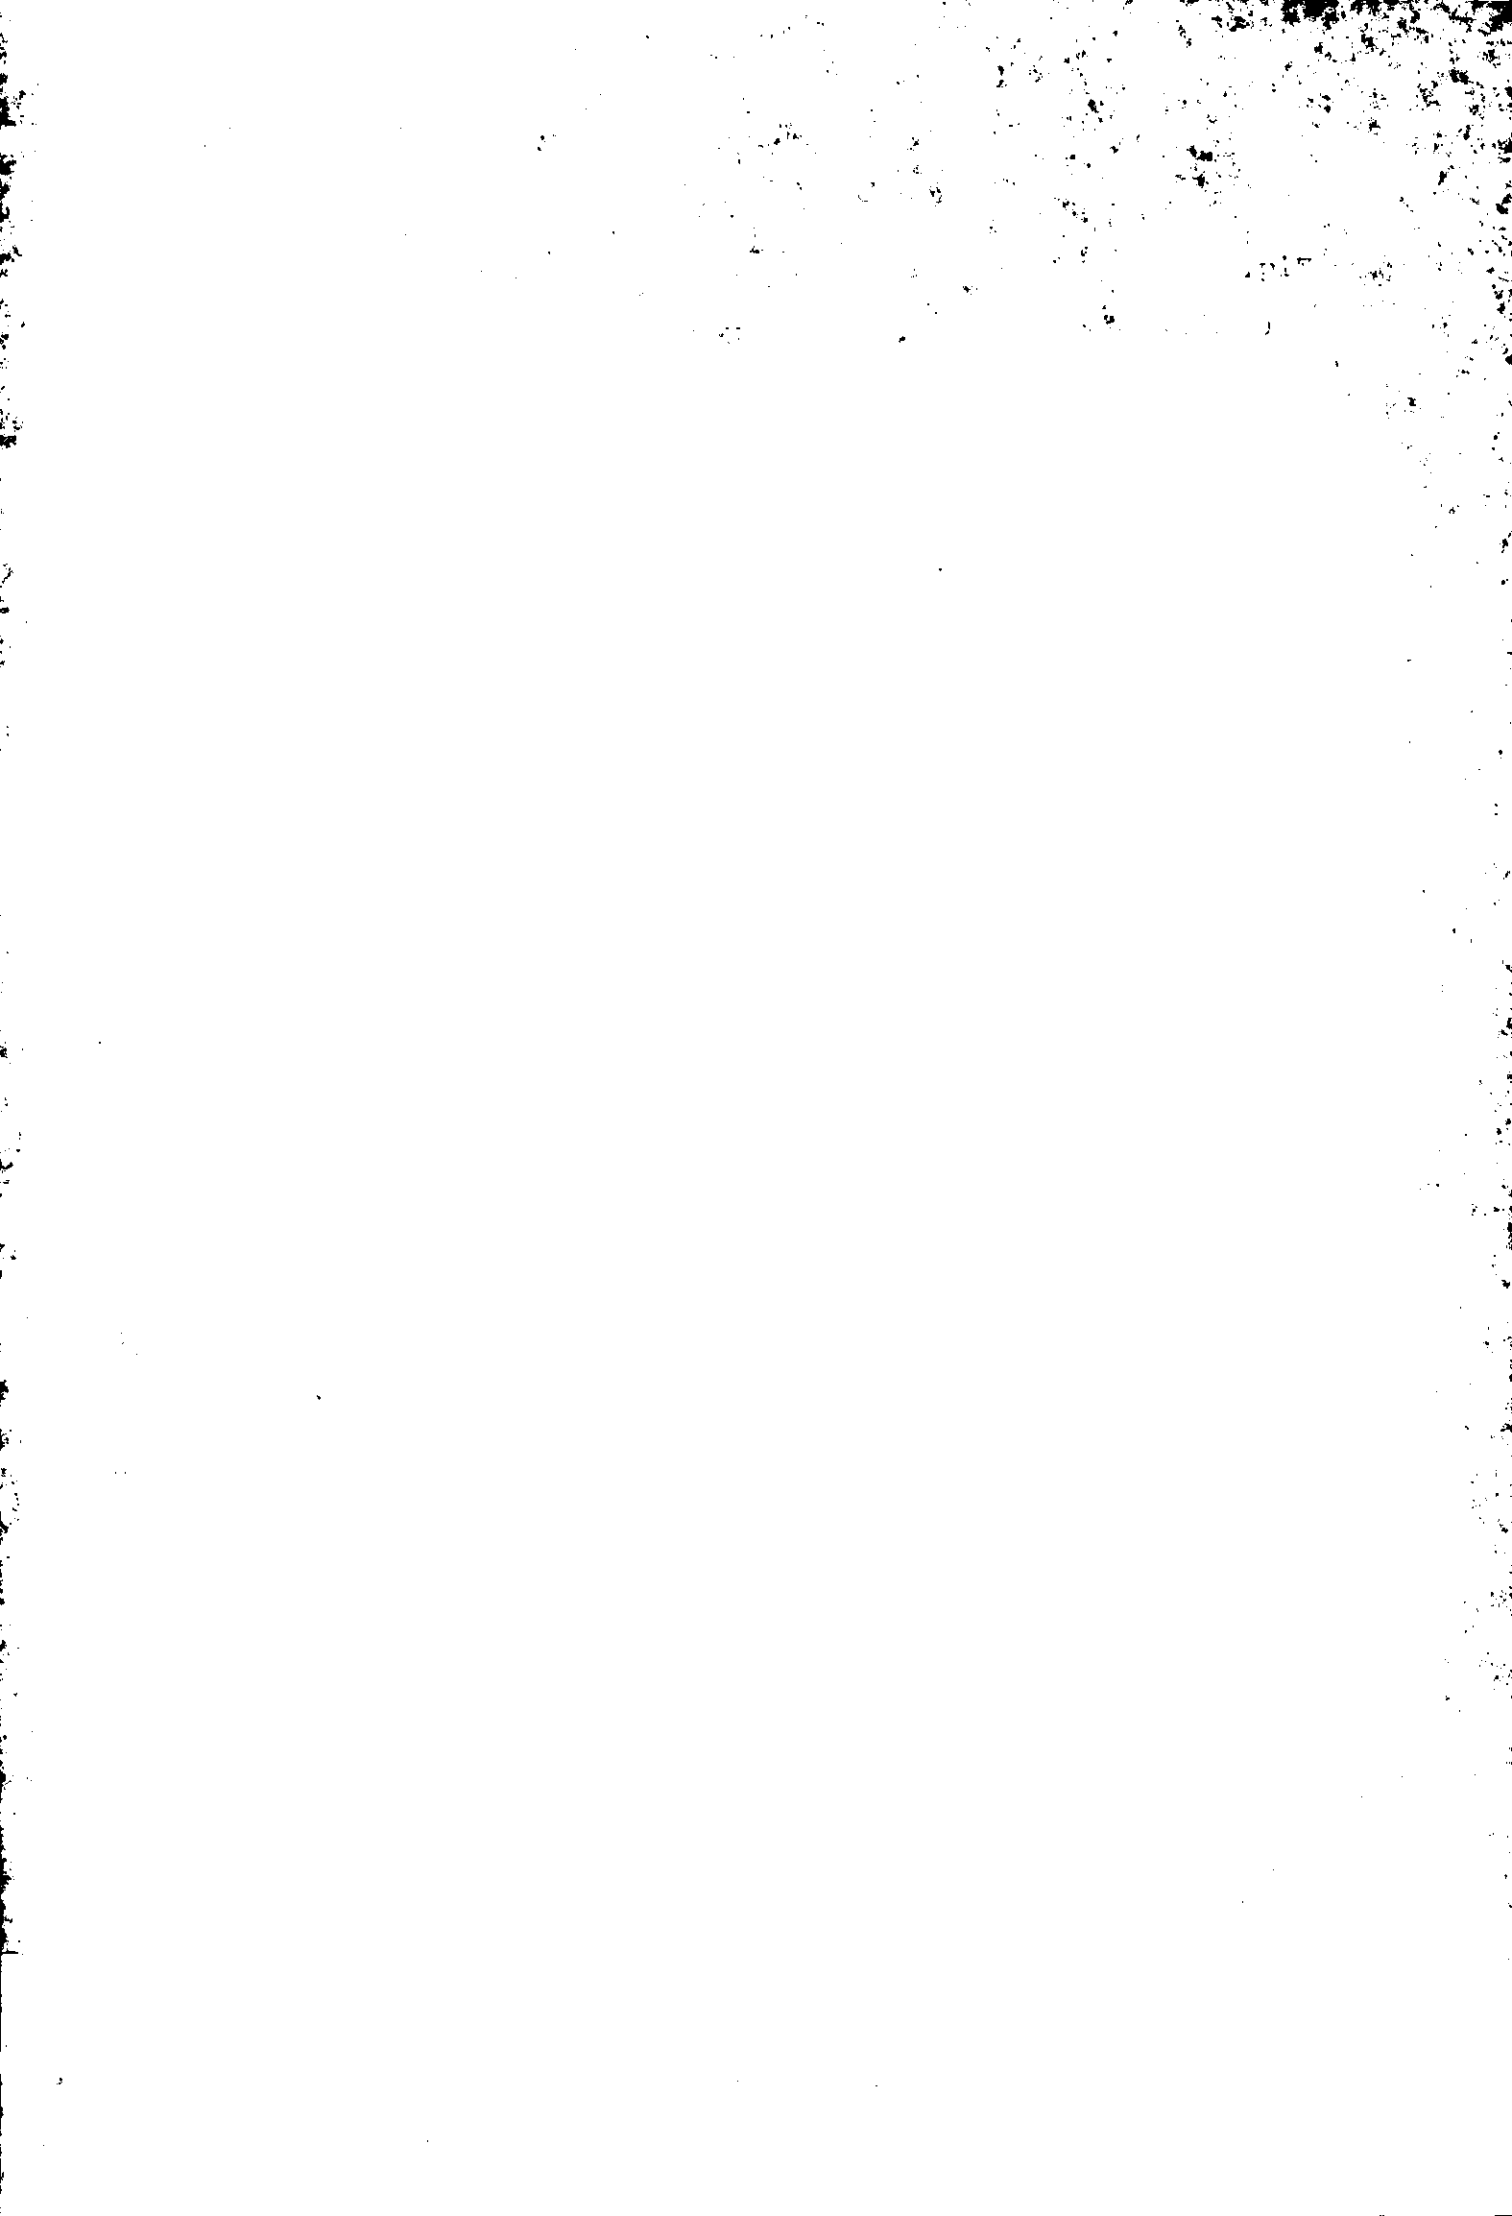
The PRODUCT SPACE ZONE is defined as a 'hard shoulder' type area; a continuous strip of space running alongside aisles, which is designed:

    a) to serve for storage of material, W.I.P. and products (Unit Loads, pallets etc. [39,83]) next to work station, and

    b) as a 'boarder' for automatic positioning mode in CAFLAP.

The width is determined by the width of Unit Load. The Product Space Zone can accommodate all the different demands (i.e., Two-bin, Just-in-time, and Base-Stock Control) on Product Space resulting from the above mentioned systems. The only space loss is limited to the width of the Man-Space, allowing a safe passage for the operator.

If the automatic positioning mode was considered in isolation from the rest of the CAFLAP system, it could be classified according to Moore [30] as an improvement type procedure because it starts with a predetermined industrial bay.

STEP 2.
The first work station is positioned manually in a requested place/section of the industrial hall either at a right angle to the aisle or obliquely to it (see Fig.6. a) and b)}.

STEP 3.

The rest of the layout development follows according to the
mode selected (see section 4.5.4). If a collision course is
indicated, a facility for manual positioning (manual
override) is used in order to reposition one or more work
stations as necessary to avoid the collision. If then
requested, the automatic positioning mode can be resumed.

This method can also be used to find the optimum width of an
industrial bay {see Fig.10.}, i.e. if the work station is
found to be colliding with the 'border' (Product Space Zone,
aisle, walls etc.) it is repositioned into an oblique
position. This, intelligently assessed, could lead to an
even narrower bay design, especially if work stations are
long and 'slim' (e.g. a turret lathe).

saving space
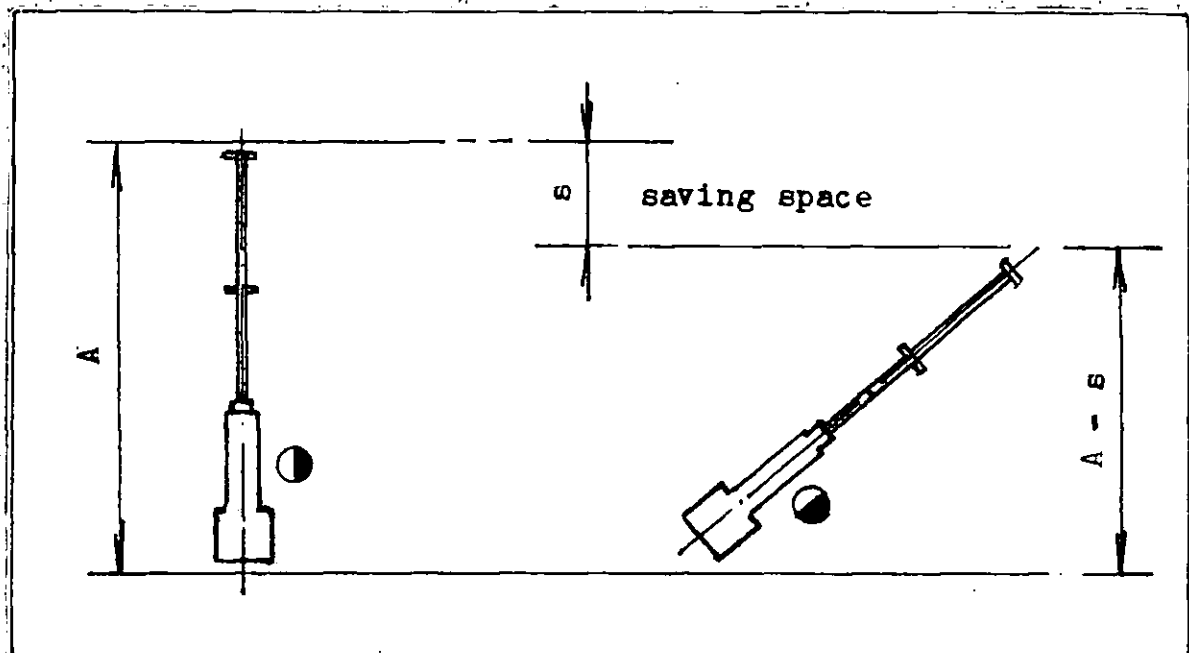
Fig. 10.

FINDING THE OPTIMUM WIDTH OF INDUSTRIAL BAY

The value of this procedure for a 'green field' layout design is obvious.

A narrow industrial bay is much more cost effective than a wide span industrial bay, which is not only expensive to build (initial high capital investment), but also to maintain. The larger span bay requires a higher roof structure which also increases the volume of air to be ventilated and heated: a further consideration for costs. The construction height of the building cannot be fully utilised technologically. If cranes are used, it is again the larger span of the bay that dictates higher cost of cranes and may influence their performance.

In a practical layout, there are two types of work station formations: regular and irregular (see Fig.4). CAFLAP system has been developed to accommodate both: for the irregular formation case the manual positioning mode of CAFLAP may be used, while the automatic mode serves in the case of regular positioning.

4.3.3. OVERALL LAYOUT OF INDUSTRIAL HALL

CAFLAP can be used as a tool for design of an industrial hall of any shape. The following describes a typical case. A flow chart in Fig. 11. shows the methodical steps in layout design of an industrial hall. For typical production

line flow patterns see Fig. 13.

① A 'Continuous longitudinal bay'
is designed, regardless the shape and size
of the existing or newly designed industrial
hall (program POSCLASH5.FOR).Total length
of the bay 'L' is obtained.

② If the hall length 'Hl'(e.g. depending
on the size of the plot available) is
n-times shorter than 'L', then 'L' is cut
in 'n' bay sections.

③ The shape of the flow pattern is chosen
(U-shape, S-shape, parallel).

④ The bay sections are fitted into the
hall, following the chosen flow pattern.

⑤ The bay sections are checked against the
corresponding civil engineering space.
The layout is revised and adjusted if
necessary. (POSCLASH5.FOR)

⑥ Improved layout is printed.

⑦ Alternative designs of the industrial
hall (changing the flow patterns and
detailed layout) follow.

⑧ Alternative designs are evaluated
using the ratio of spaces, and minimum
space needed is sought.

Fig. 11. MAIN STEPS IN THE DESIGN
OF INDUSTRIAL HALL-OVERALL LAYOUT
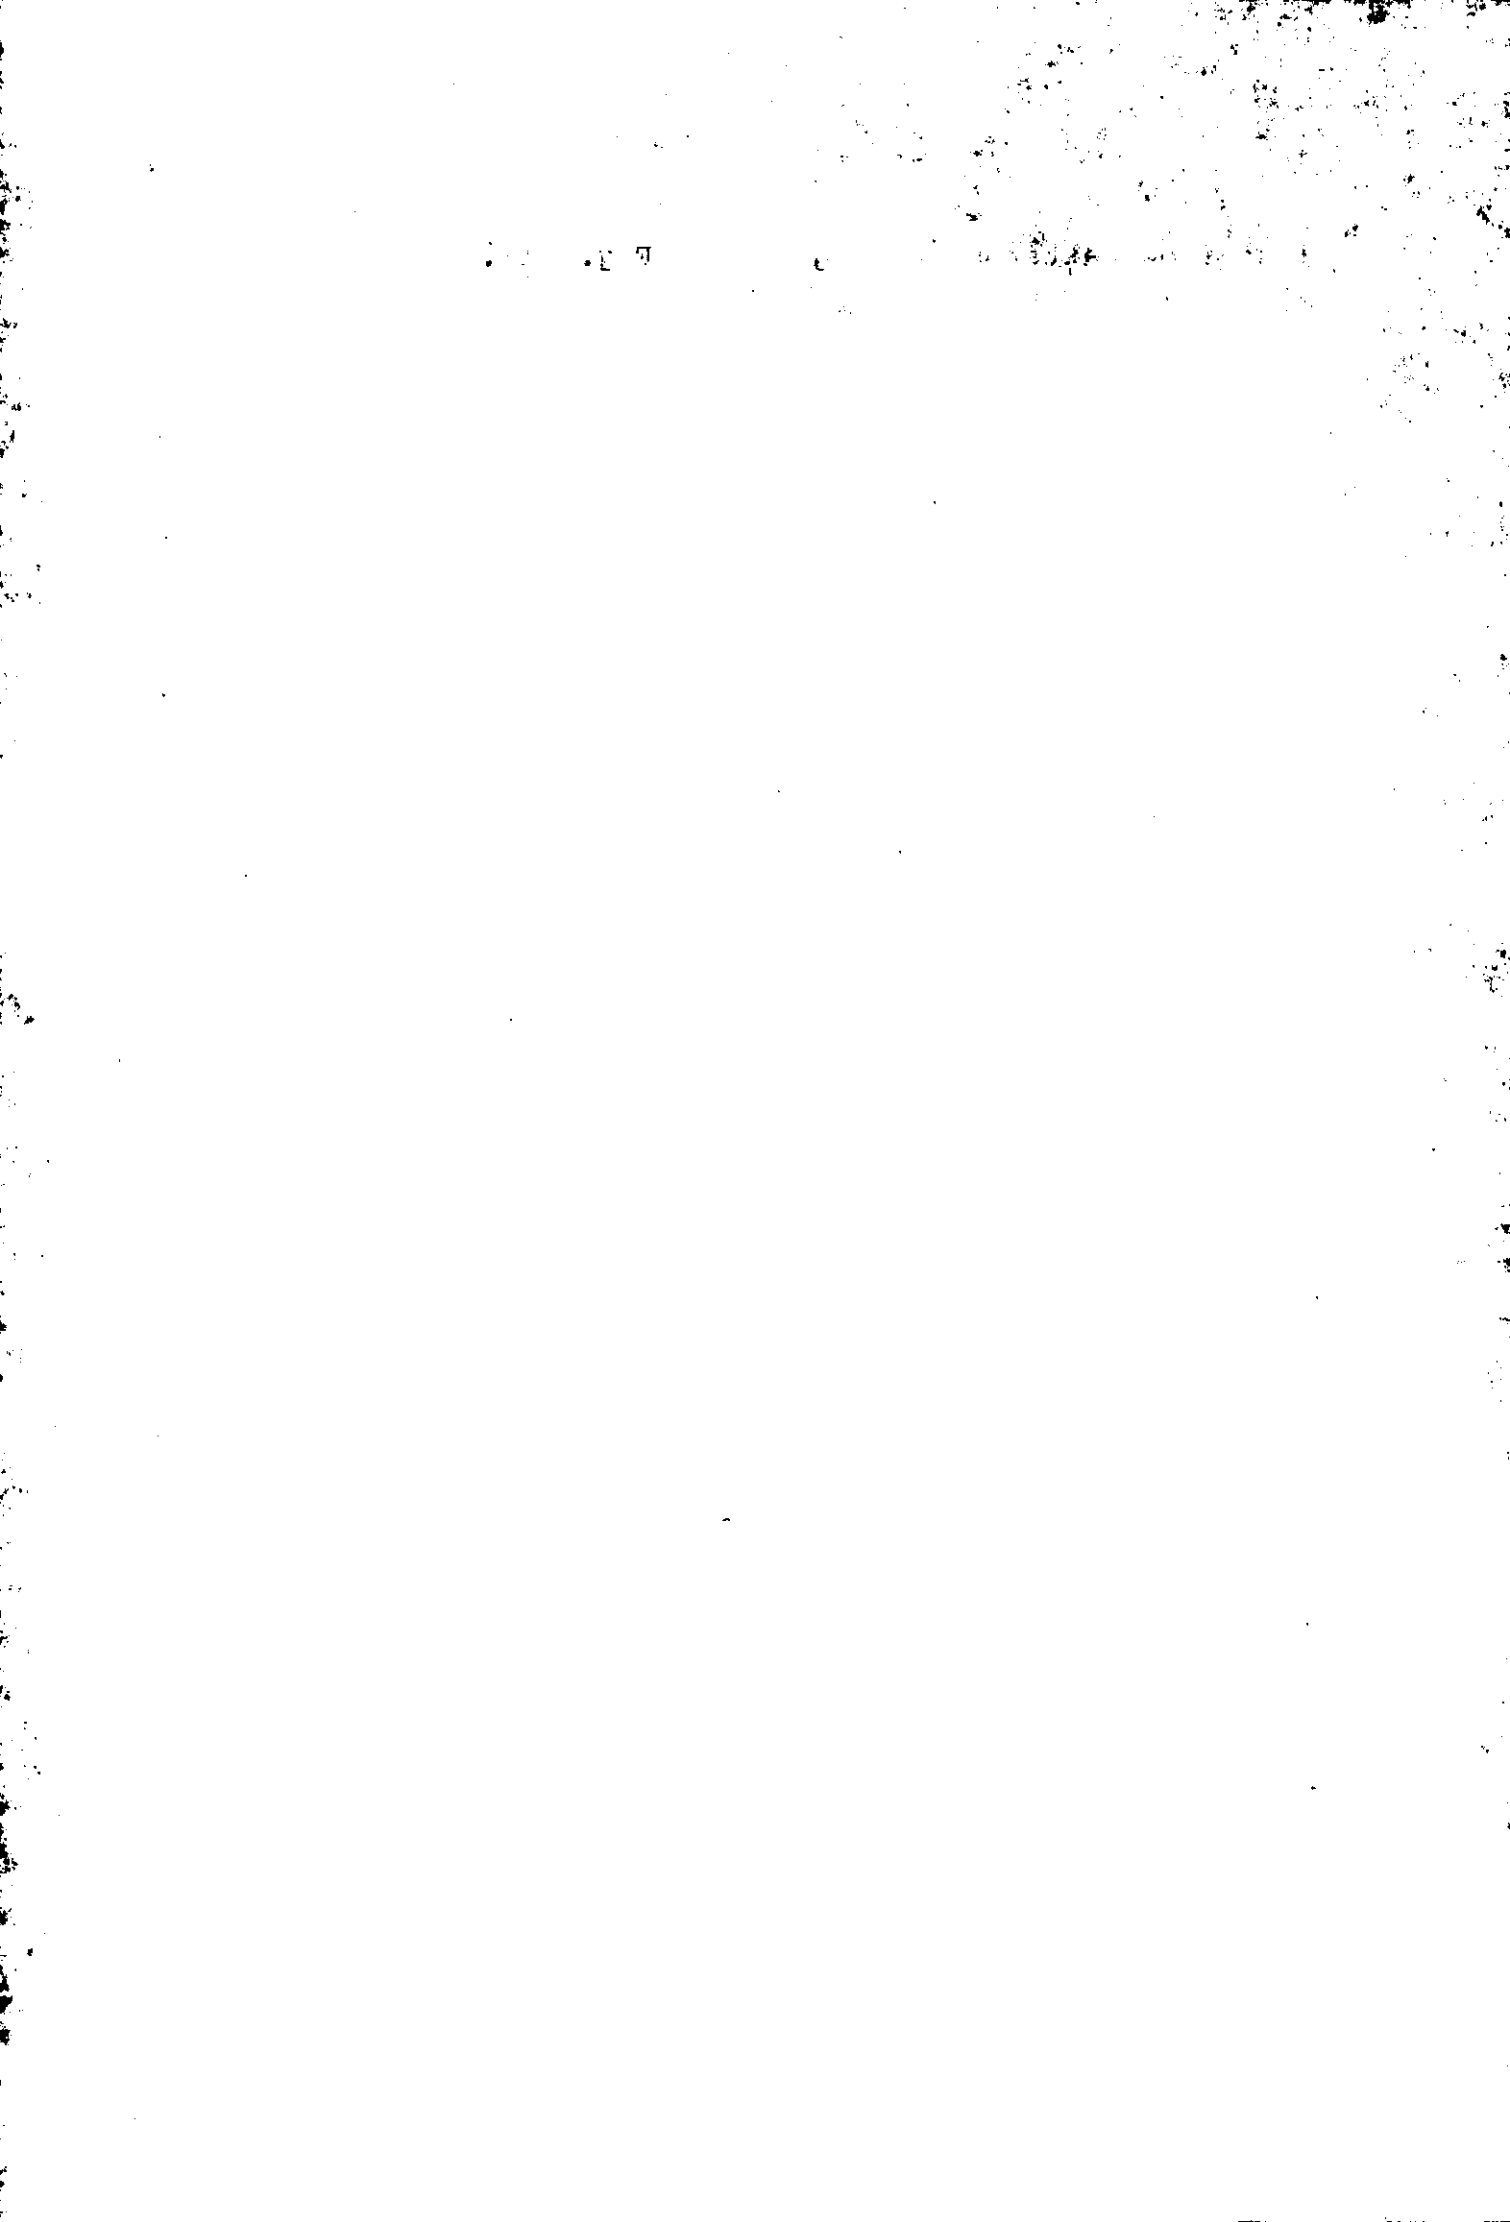
A detail layout of 'technologically' self-contained sections (i.e. an interdependent line or group of work stations), is continued in a straight 'continuous' line. This also satisfies Muther's [4] layout fundamentals {see Fig. 12}. A 'continuous longitudinal bay' is thus designed {corresponding to Fig. 13. a)}.

The principle of a 'continuous industrial bay' is an aid for layout planning using automatic positioning mode (see section 4.5.4). It provides for fluent positioning of work stations in the bay.

The continuous bay is designed in its total length regardless the length of the industrial hall. The hall usually accommodates more than one bay {see Fig. 13.d)}. The work stations may be positioned on both sides of the aisle.

When the length of the industrial hall 'Hl' is shorter then the length of the continuous industrial bay 'L' and a U-shape or S-shape Flow Pattern is used {see Fig.13. b)}, the total length of longitudinal bay has to be cut (while 'technologically' self-contained sections are maintained), into lengths which can be accommodated in the industrial hall.

When a Parallel Lines Flow Pattern {see Fig.13. c)} is used, individual lengths have to be cut accordingly.

RELATIONSHIP
degree of closeness   OPO1 → OPO2 → OPO3 → OPO4 →
desired
among M/Cs   operations

SPACE
configuration
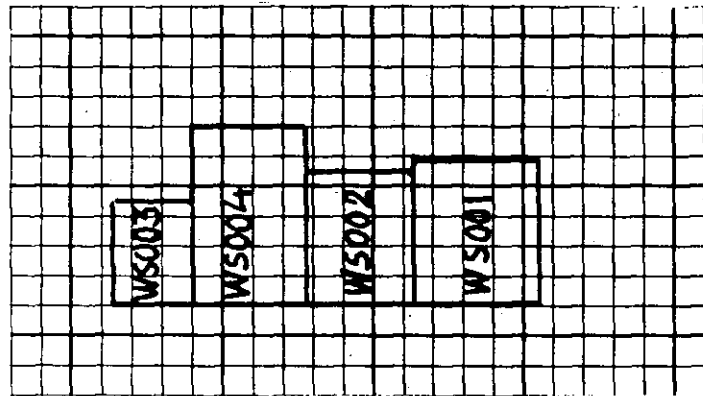
ideal position of work stations

ADJUSTMENT
realistic best fit
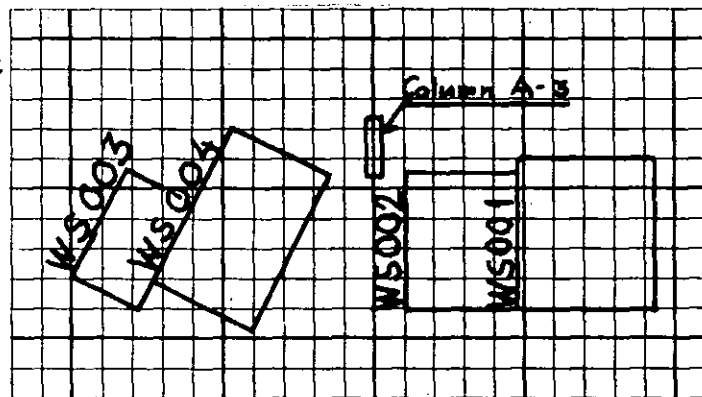
realistic position of work stations

Fig. 12. 'CONTINUOUS' LINE SATISFIES LAYOUT FUNDAMENTALS

a)   STRAIGHT LINE

START   FINISH

b)

U - SHAPE

S - SHAPE

c)   FINISH

PARALLEL LINES

START
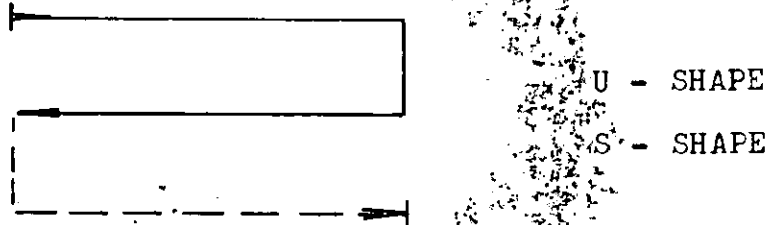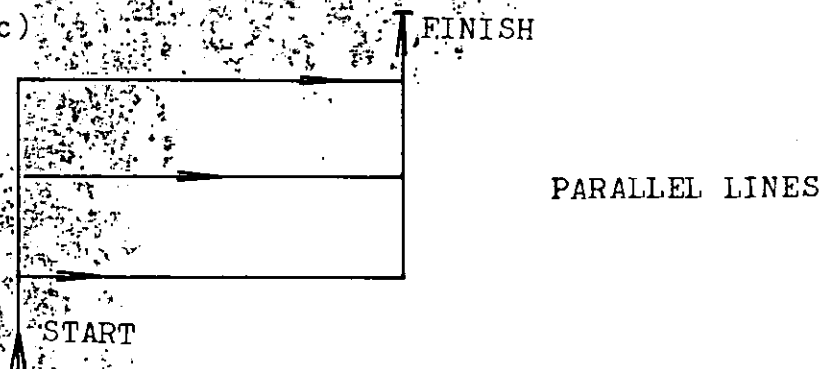
d)   TYPICAL LAYOUT OF AN INDUSTRIAL BAY

| cross bay | longitudinal bays | cross bay |
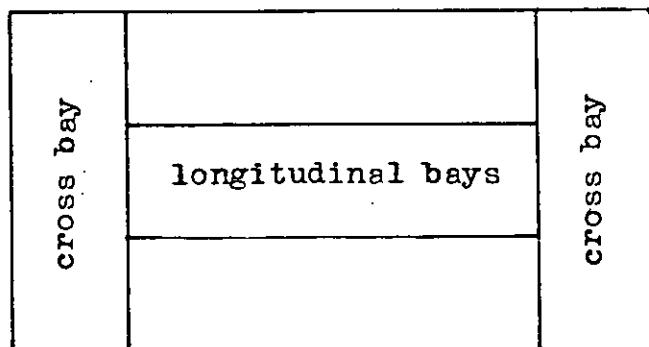
Fig. 13.   FLOW PATTERN FOR PRODUCTION LINES

4.4 LAYOUT USING INTERACTIVE COMPUTER GRAPHICS

In the preparatory stage of this project it was essential to select an existing commercial software system suitable for the purposes of CAFLAP methodology. The selection was influenced by CAFLAP demands for a computer graphics system and also by several other factors, which are summarised as follows:

The system should have a facillity for a simple design of all objects/spaces in 3-D. This refers especially to the design of Work Station Modules and to the Civil Engineering Space with all its elements.

The system should have a facility for marking the designed objects with identification or tag numbers.

The system should have a suitable potential for the development of facilities for manual and automatic positioning of 3-D objects and collision course finding. Kinetic function ability is essential for the positioning of Work Station Modules in the Civil Engineering Space and for Collision Course Finding. It is also important for the observation of the developed scene.

The obvious choice available was a CAD drafting system, for example MEDUSA (in possession of Middlesex Polytechnic).

The system was tested and part of the Project was investigated with the participation of some engineering undergraduates.

In spite of the fact that MEDUSA offers an exellent drafting facility, it was realised that modification of the system for the purposes of CAFLAP would be far too complicated (if not impossible). Therefore the development using this system had to be dropped.

Another system in operation at Middlesex Polytechnic is PICASO (PIcture Computer Algorithm Subroutine Orientated) developed by Dr.John Vince [93, 94].

It is a FORTRAN-based computer graphics system, designed to ease the interface between programmer and graphical problem areas. PICASO subroutines may be incorporated into any FORTRAN or PASCAL based programs. It offers a comprehensive library of 2-D shapes and 3-D objects which may be manipulated through a wealth of manipulating algorithms. The system's conceptual space allows the user, through the 'observer', projection mode and projection space (using system commands), to observe and manipulate any designed scene. For shapes and object analysis the system is equipped with some thirty six analysis commands. For shapes and objects presentation there are over thirty drawing commands. Drawings generated by PICASO are normally drawn on high resolution VDU and could also be plotted upon any suitable plotter. Since PICASO was apparently developed for

visual arts, it has a variety of built-in features to suit that purpose. Because of its versatility, it offers considerable potential for creative use even to engineers. It also has a capacity for modification and for further development. These are the reasons why PICASO was adopted for use in CAFLAP work.

The hardware used was originally Prime 550 computer which was replaced by VAX/VMS VERSION V4.5 computer system. Terminals used were Applied Digital Data System, Model ADDS-Regent 25; Insight Terminals Ltd., Model vdt-1; and printer EPSON FX-80.

4.5 PROGRAMS AND THEIR SOLUTIONS

The CAFLAP programs developed here were compiled in FORTRAN 77. The major reason for using FORTRAN was because the research project exploited the PICASO computer graphics library, which was implemented in FORTRAN 77. Although PICASO can be treated as a library of subroutines and functions, and therefore is accessible to other languages such as: PASCAL and C, it was decided to implement all programs in FORTRAN as the CAFLAP system needed to modify some of the original code of PICASO. Maintaining this language consistency only involved the Writer in learning one language. Furthermore, Middlesex Polytechnic - where the research was undertaken - had used FORTRAN as its primary scientific/mathematical language and was able to

provide a reliable software support service.

Although FORTRAN has played a very inportant part in the development of scientific/mathematical software, and is still used to implement original code for some companies, the language in favour at the moment is C. It offers a more rigorous programming environment with strengths in: data structures, structured programming, interaction with UNIX and reduced program development times.

CAFLAP could be implemented in C, and also in other languages such as PASCAL, or BASIC, but would require modification to exploit the benefits offered by PICASO. If CAFLAP was to be made independent of PICASO, it would require substantial support in the area of computer graphics.

Developing any program requiring computer graphics facilities presents problem to the programmer, mainly because of the variety of graphic specification available for workstations. To help overcome these implementation problems some computer graphics standards have now been developed, e.g. GKS, GKS-3D and PHIGS. None of these systems were available to the Writer during his work; nor was it possible to have access to sophisticated colour grahpics workstations that would have had an impact upon CAFLAP's interface.

CAFLAP was developed as a vehicle to explore the Writer's ideas in developing strategies for automatic factory layout, and in this respect it was successful. To be considered now as the basis for a commercial system, it has in future to be rewritten specifically to meet the demands of any particular commercial environment.

The development of layouts, using computer graphics, generally followed the steps outlined in the Layout Strategy (Chapter 4.3).

In order to maintain an efficient programming technique [96] the main programs have been kept short (i.e. not more than 100 lines), and the subroutines have been mostly built-in, in a tree-like hierarchy. The imput data are manipulated via COMMON areas, subroutine arguments, external files and an interactive terminal, for the convenience of the user, in some cases in conjunction with a printer. Each program is internally documented by comments in natural language, for the benefit of the user or another programmer. The comments are divided into two categories: Macro Introductory Comments and Micro Continuous Comments.

The Macro Introductory Comments describe the general qualities of the program:
- name of the program;
- the purpose for which the program was built;
- if the program is long and complicated, there is a

short description of previously written sub-programs of which it consists or with which it co-operates;

- size of the program, i.e. for which number of work stations it is designed;

- program output.

The Micro Continuous Comments are those relating to the main operations, and these help to clarify and expand the significance of the FORTRAN written code.

The layouts of programs produced here have purposely been kept simple for easy reading and understanding. Great care has also been given to Statement Numbering so as to keep them in an ascending numerical order sequence, which is easy to follow. The resultant layout, and especially the included comments, thus make the programs largely self-explanatory.

The programs were developed as an integral and major part of this work but, because of their large physical volume, it was not considered appropriate to include them here. They are instead described in the following sections and included, in their entirety, as Appendix II.

4.5.1 WORK STATION MODULE BUILDER

Work Station Modules are built by the program 'WSBUILDER.FOR'. A 3-D template is built-up from a

hand-drawn sketch of the Work Station Module. The sketch includes Maintenance Space, Operational Space, Man Space, and work station (i.e. the machine tool itself including accessories), maintaining recommendations from manufacturers and all ergonomic principles. The steps in Work Station Modules design via the interactive program are following:

- requested objects (boxes, cylindrical parts, anchoring bolts, operator(s), Tag Number etc.) are selected according to a pre-printed code;
- instructions are given in the program regarding size and position requirements;
- the engineer feeds in requested dimensions and positions of the objects, starting from the origin $(x=0, y=0, z=0)$;
- this process continues, object after object, until a complete Work Station Module is built;
- the work station is then filed under a unique Tag No. for future reference/recall, and the procedure is ended.

'Drawing' of the next work station can follow.

Any Work Station Module picture may be recalled by program 'WSRECALL.FOR'.

NOTE:
Information for the hand-made sketches of Work Station Modules is usually taken from the machine tool

manufacturer's drawings, foundation plans and manuals (including installation and maintenance recommendations and instructions).

Some well established manufacturers of machine tools helpfully supply, with their installation manuals, pre-printed simplified 2-D templates of their machine, on the basis of which the sketch of the Work Station Module could be prepared. The original intention was to identify Man-Space, Maintenance Space and Operational Space in the drawing by hatching. But this was found impossible in a 3-D representation because hatching would obscure the picture. Therefore the Spaces are drawn inside the 'largest volume' of Work Station Module {Fig. 5.}, without any further identification (hatching or tinting).

4.5.2 BUILDING (CIVIL ENG. SPACE) DESIGN PROGRAM

For the purpose of designing an Industrial Bay interior, Program 'CIVES3.FOR' has been compiled. A fully-detailed 3-D image of an industrial bay may be built from PICASO objects (presently only Boxes are used).
The method is following:

Individual civil engineering elements and 'borders' (i.e. Product Space Zones, aisles, etc.), are input. The 3-D image is shown on a VDU and individual elements can be changed, replaced, or added until the simulation of the bay interior is completed.

NOTE:

In case the layout is being planned in an existing building, the Civil Engineering Space will be built exactly according to the civil engineering drawings available.
The writer's experience is that even well established old factories often possess unreliable civil engineering information, so that, an industrial hall survey may have to be taken and new reliable drawings produced.

4.5.3 MANUAL POSITIONING PROGRAMS

For the manual positioning of Work Station Modules (largest volumes only) in the bay, or for the positioning of departments, bays in the hall and halls in a plot, a program 'IYTVAXOO.FOR', using a joystick, has been compiled. Examples of drawings prepared by this program are shown in Appendix III, Drwgs Nos. 02. and 03.

Any objects, represented here by boxes, can be entered into a list and marked individually by Tag Nos. or any other identification (e.g. name of a department). They are then positioned against the background of a grid representing the requested area.

For manual positioning of work stations only, program 'IYTWSFILE.FOR' has been compiled. This program has a facility to retrieve detailed Work Station Modules and incorporate them into a required layout in a similar way as

in the program 'IYTVAX00.FOR'.

4.5.4 AUTOMATIC POSITIONING PROGRAM
WITH COLLISION COURSE FINDING PROVISION

For automatic positioning of Work Station Modules inside the industrial bay, program 'POSCLASH5.FOR' has been compiled.

The functions, satisfying the layout strategy of section 4.3.2, shown on a VDU or printer, are as follows:

- list of work stations available with facility for any required changes {Fig. 14.};
- present situation of development {Fig. 15.};
- new development of the layout in manual and automatic mode, and in any combination of modes {Fig. 16. and 17.};
- facility for collision course finding of Work Station Modules with building elements, 'borders' and other 'obstacles';
- automatic stop at any work station colliding, with identification of work station Tag.No.;
- facility to show {Fig.18.} the situation at a clash;
- manual override allowing to find intelligently the best new position for the colliding work station in the bay;
- continuation of the development of layout in manual or automatic mode {Fig. 19. and 20.}, with a facility to

stop or to continue the development of new alternatives of the layout.

The system is controlled (positioning, repositioning etc.) by unique identification numbers or Tag Numbers.

NOTE:

The rotation axis for Work Station Modules manipulation is the Y-axis running through the far corner of the module on the left of the operator, as shown in Fig.5.

The Tag Number is a part of the Work Station Module and has to be treated as such.

The display area on a 12 inch VDU, which could be used for layout development, measures 18x33 meters in scale, with 77 maximum Work Station Modules.

Fig. 14.

File of existing Work Station Module volumes
1 300.00 200.00 270.00 WS001
2 280.00 200.00 220.00 WS002
3 250.00 150.00 150.00 WS003
4 350.00 190.00 210.00 WS004
Do you wish to extend/update the existing file...YE or NO

Fig. 15.

LAYOUT...The existing situation of development
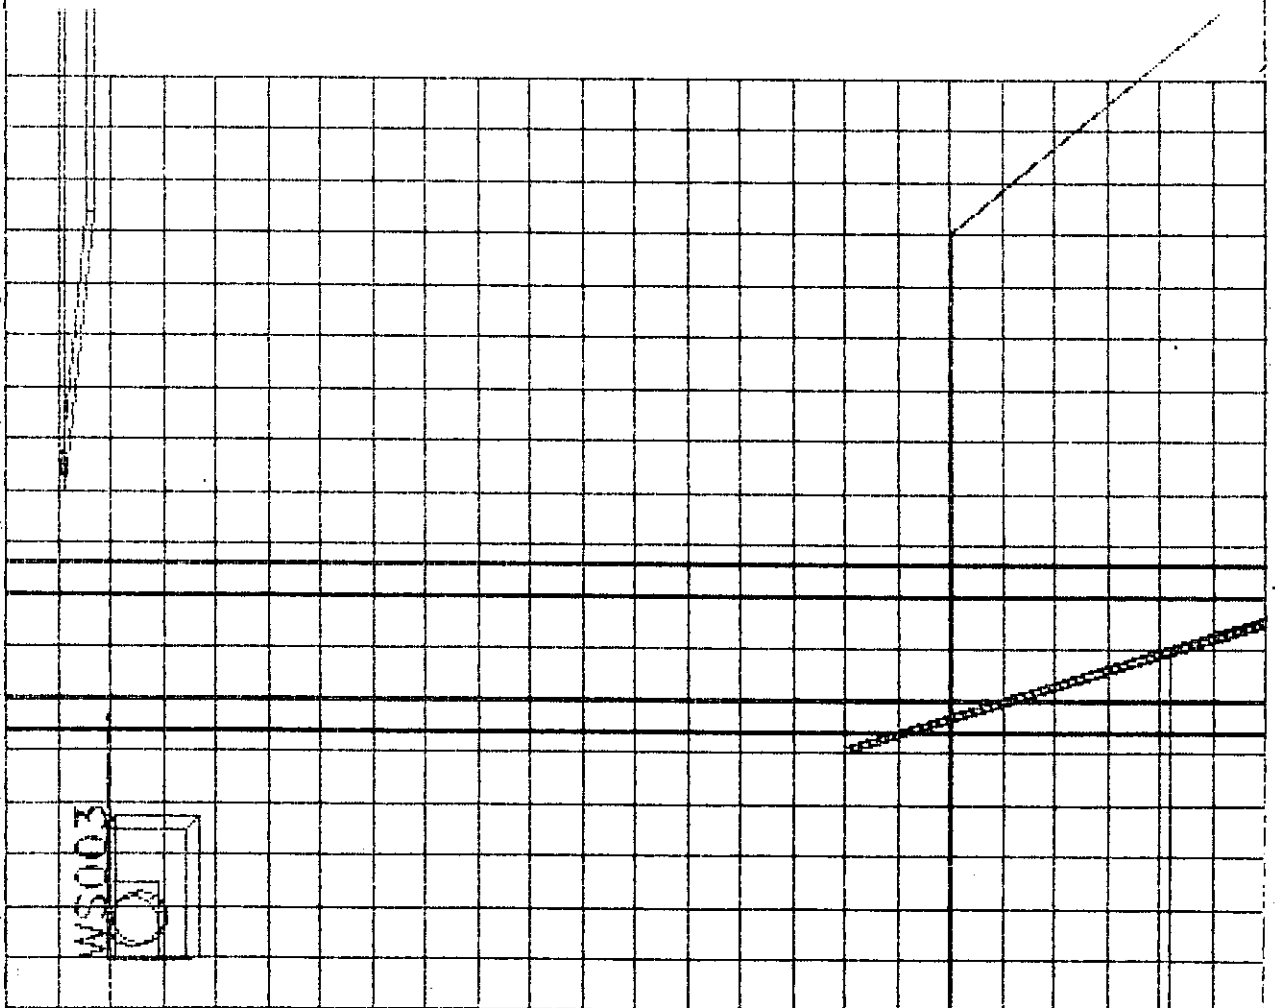
Do you want to continue/change the layout...YE or NO ?

Fig. 16.

You are now in POSITIONING MODE
Are you starting a NEW layout.from the first W.St.in technological order?
..YES or NO
Do you wish to POSITion the considered WorkStation manually ... YE or NO

Please POSITion the W.S. by cross-hairs...

Fig. 17.

TOTAL VALUE OF -Z- DIMENSION IS
500.25
YOU ARE NOW IN AUTOMATIC MODEto activate press return/new line once!

TOTAL VALUE OF -Z- DIMENSION IS
752.50
YOU ARE NOW IN AUTOMATIC MODEto activate press return/new line once!

1 = INSIDE
2 = TOUCH (O.K.!)
3 = OUTSIDE

3
3
3
3
3
3
3 Do you wish to save these clash
3
3
3
3
3
3
3
3
3
1
1
1

RESULT

1

CLASH !!!

WS002
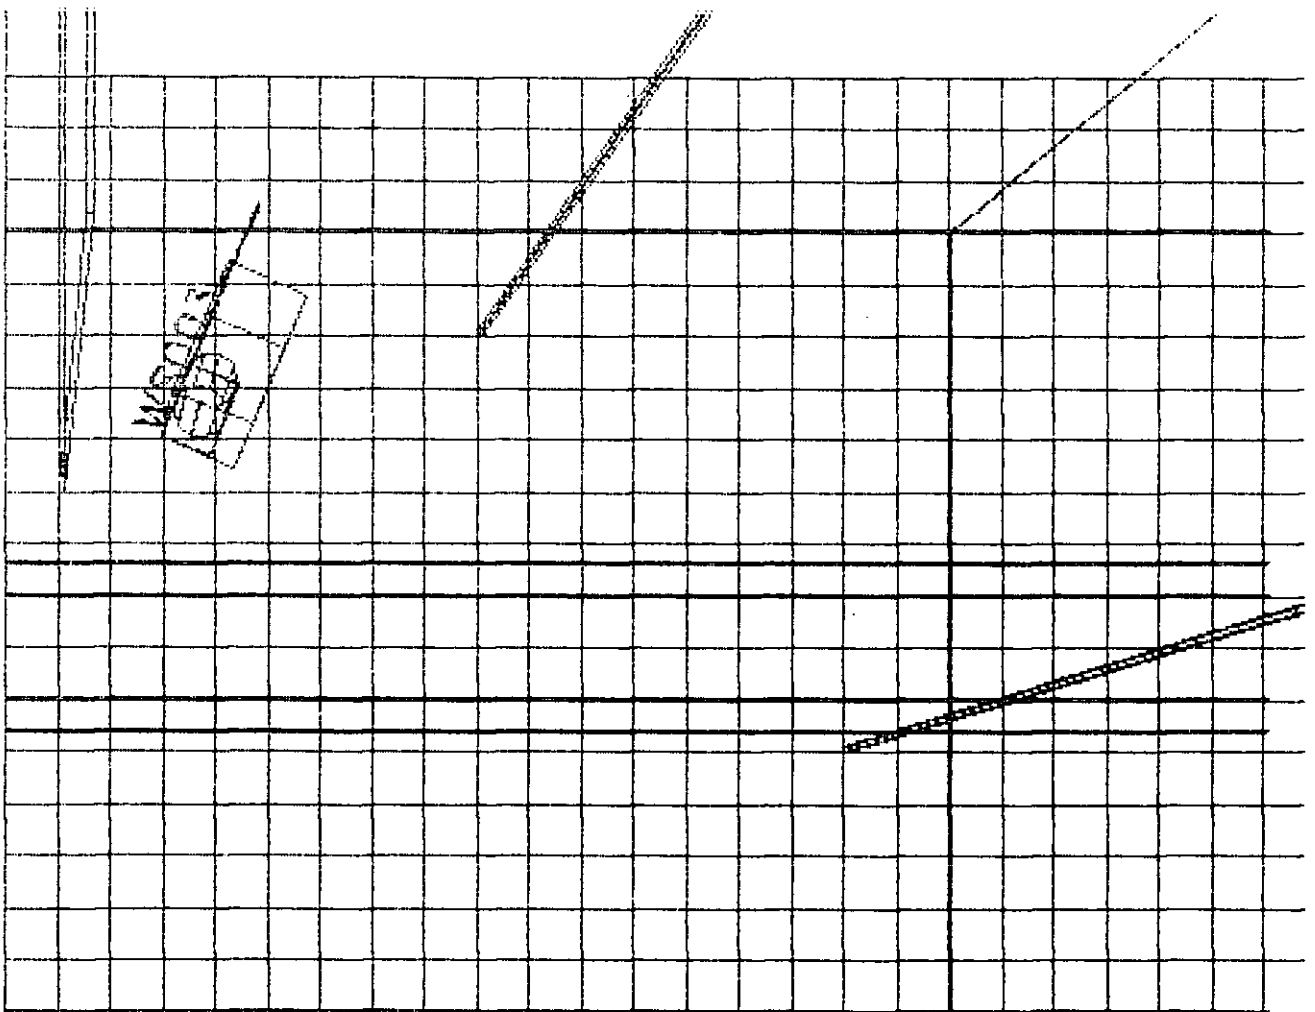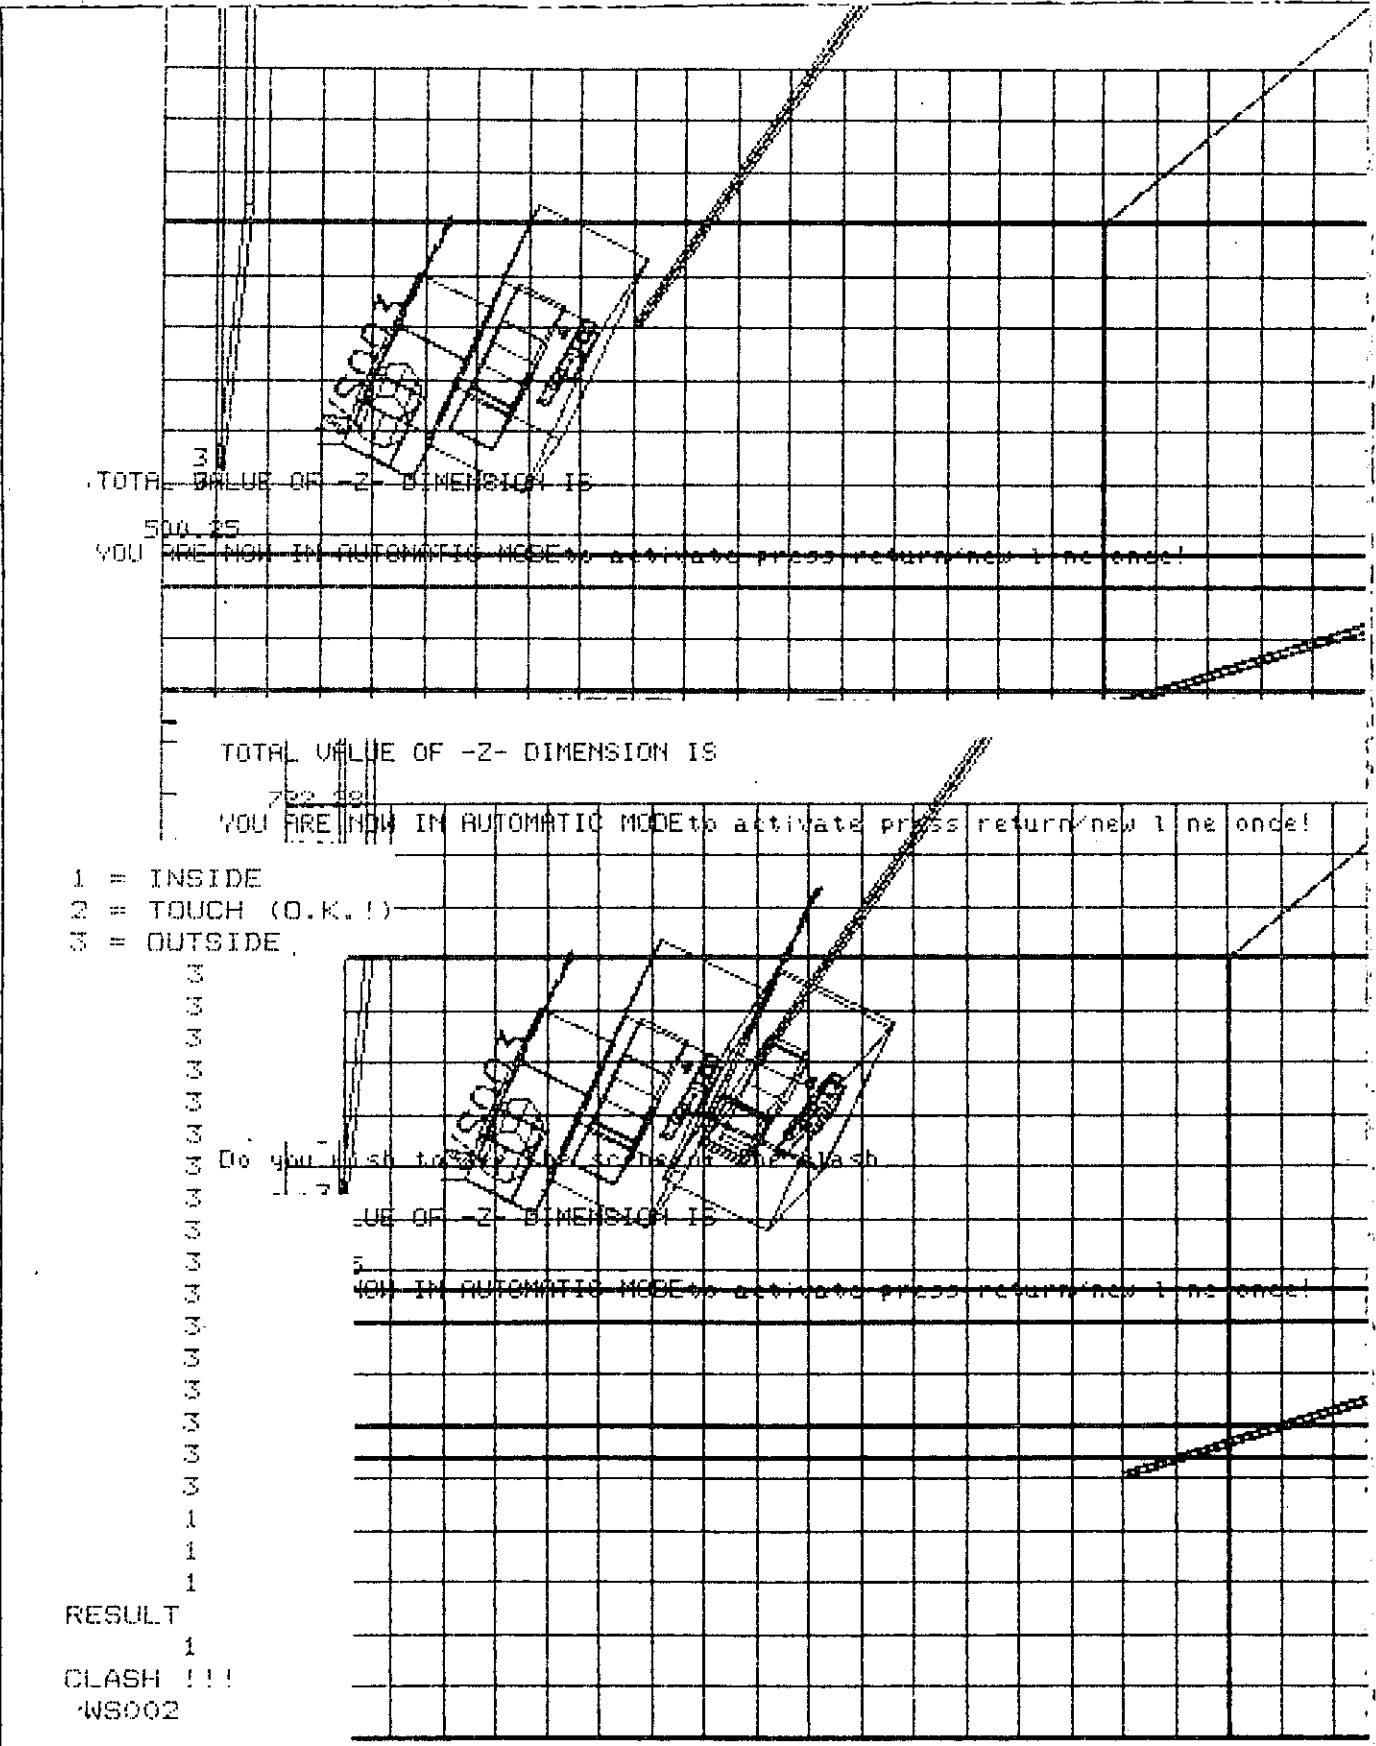
Fig. 18.

DO YOU WISH TO RE-POSIT THE CLASHING W.S. ONLY
..YES,NO...If NO you can reposition any No.of W.S.
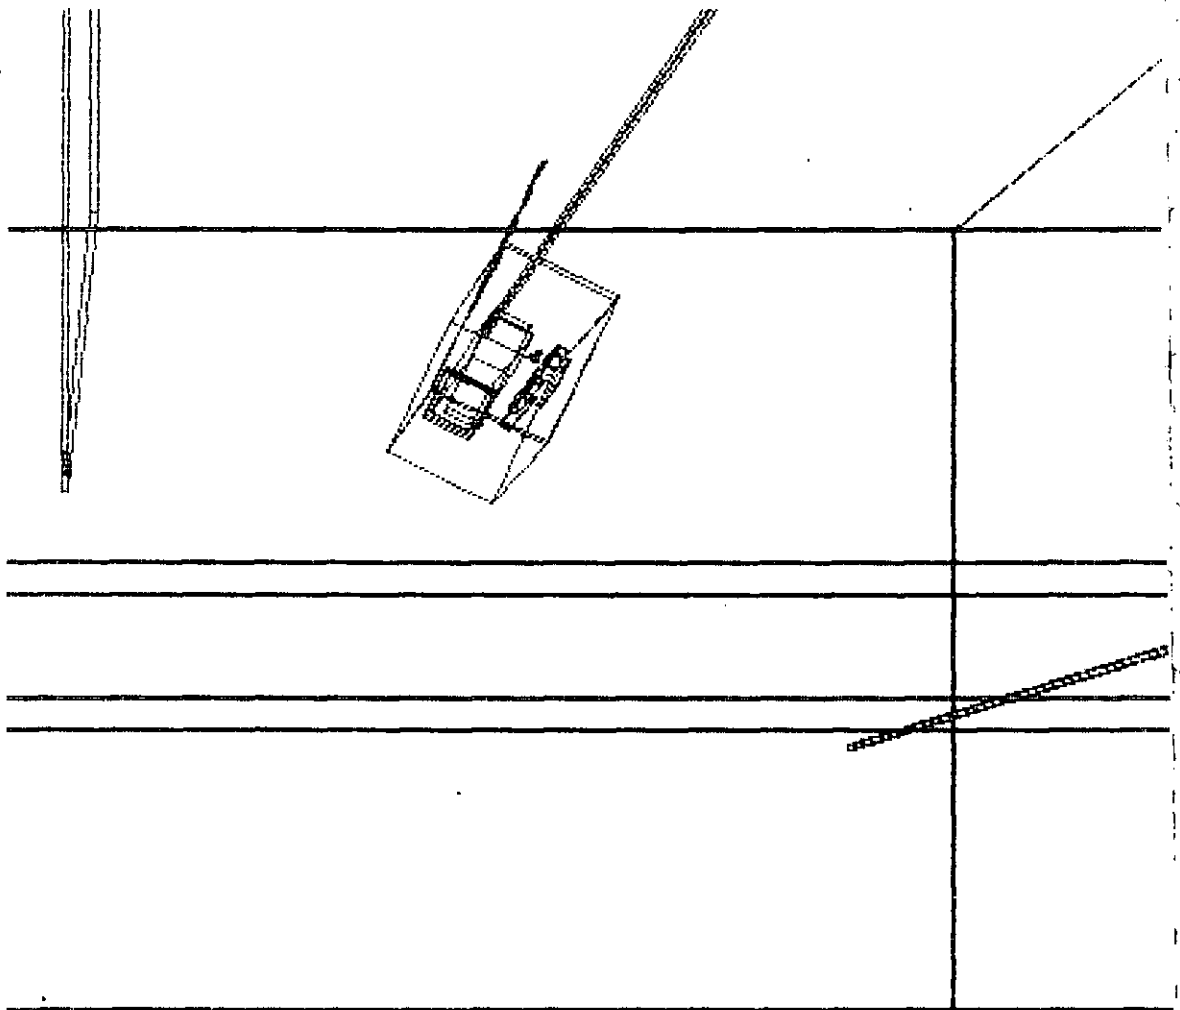
Fig. 19.

You are now in the Manual ..to..Auto Mode

Do you wish to re-POSITion the Work Station...YE or NO
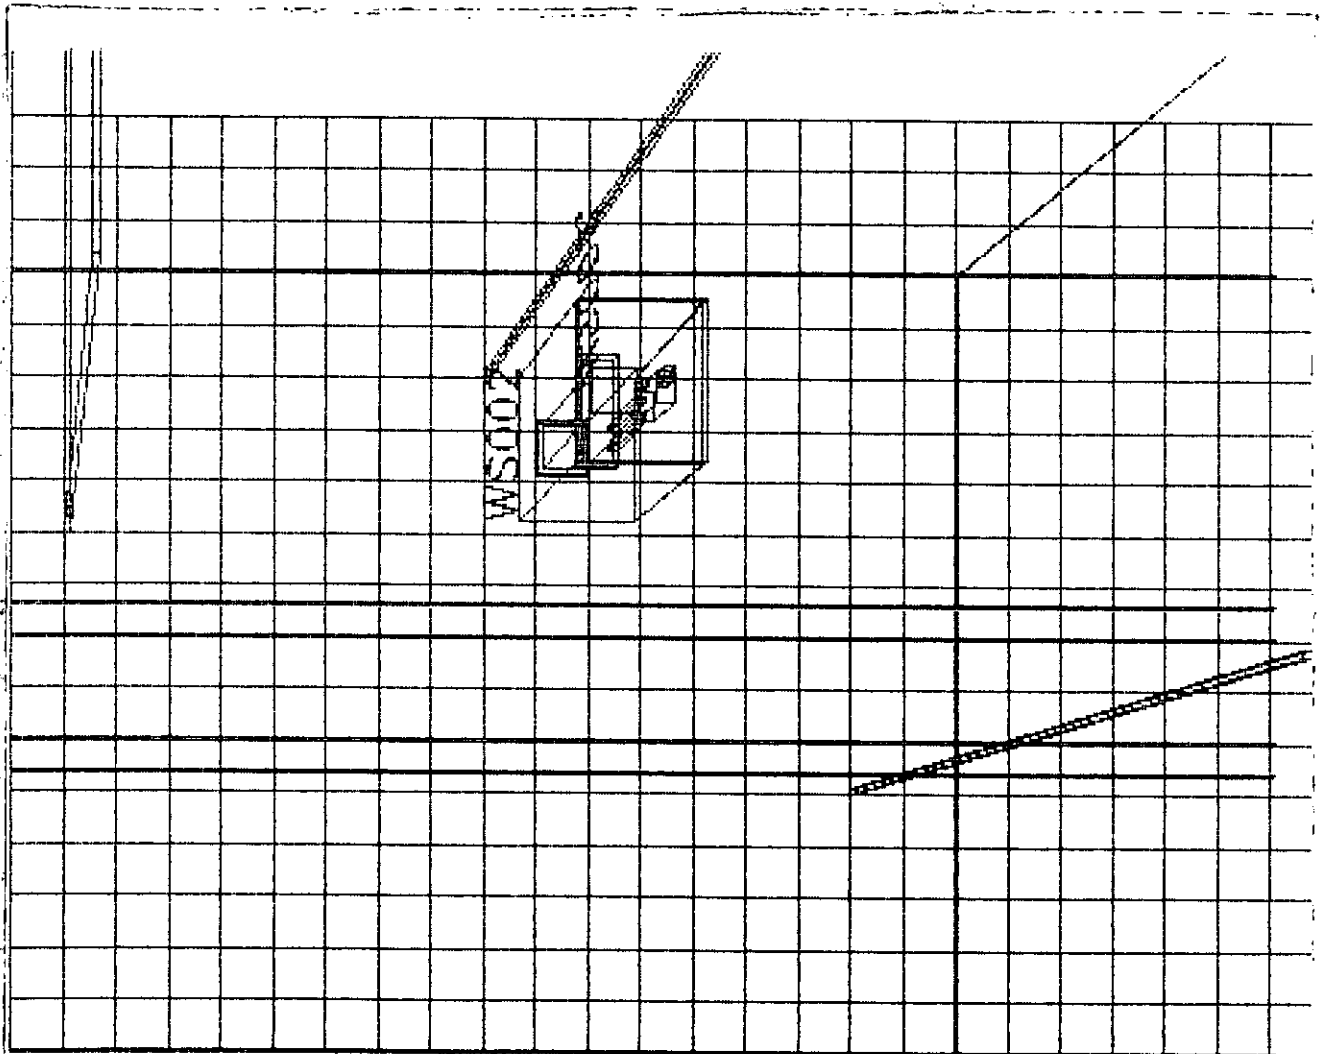
Please POSITion the W.S. by cross-hairs...
Is the POSITion of W.S. according to your wish...YE or NO

Fig. 20. a)

Do you wish to continue developing the layout...

in automatic mode ... YE or NO
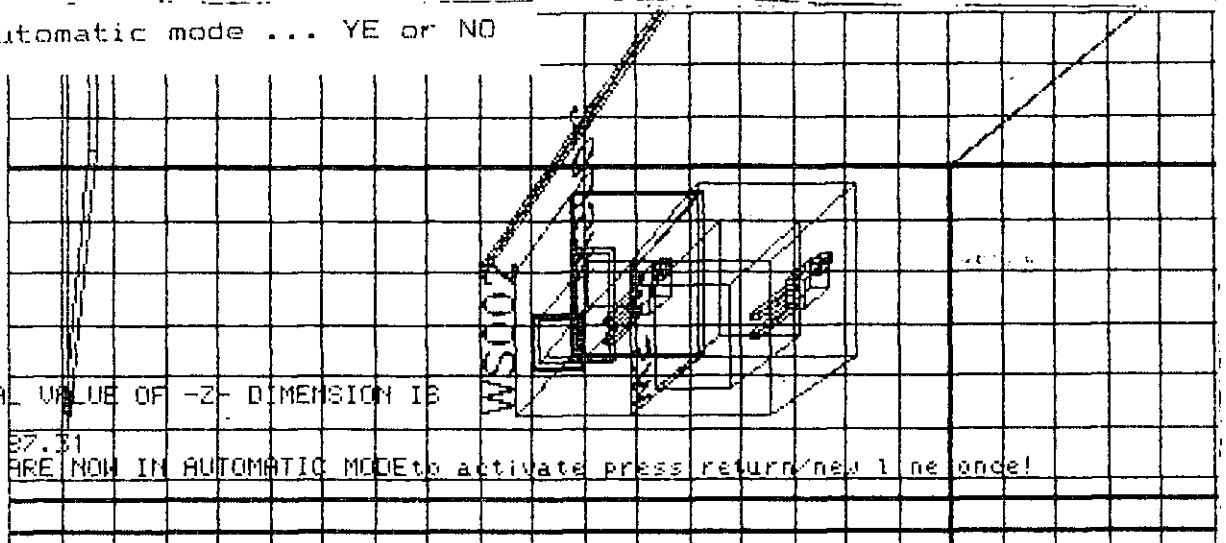
TOTAL VALUE OF -Z- DIMENSION IS
1187.31
YOU ARE NOW IN AUTOMATIC MODEto activate press return/new line once!

LAYOUT ACCEPTABLE
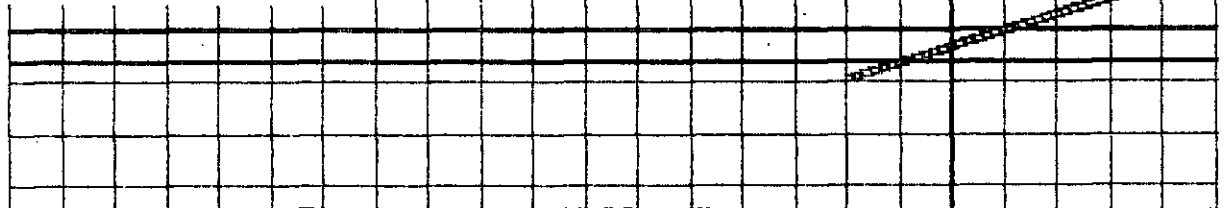
Fig. 20. b)
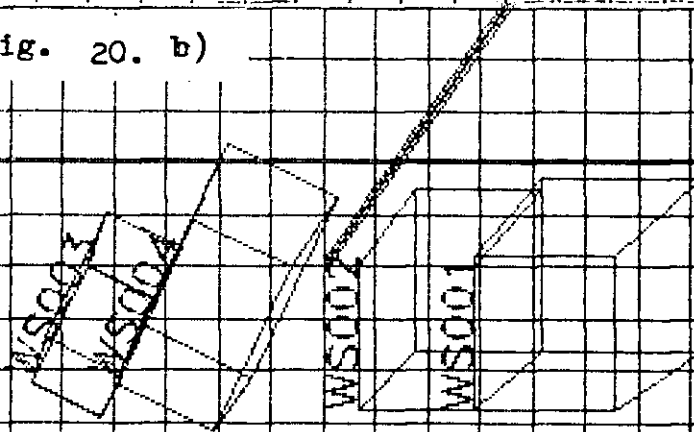
LAYOUT...The existing situation of development
Do you wish to redraw the layout?...YES,NO..
If NO is typed, the session is over

4.5.5 DISPLAY PROGRAM

Program 'DISPLAY.FOR' has been compiled for displaying the layout and manipulation of the whole scene. It also allows the user to study developed alternatives, and provides a better 3-D presentation on VDU and/or printing.

The user feeds in a requested distance, rotation, and elevation, and the layout is shown on VDU {see Fig.21.}.

ENLARGEMENT OF THE SCENE
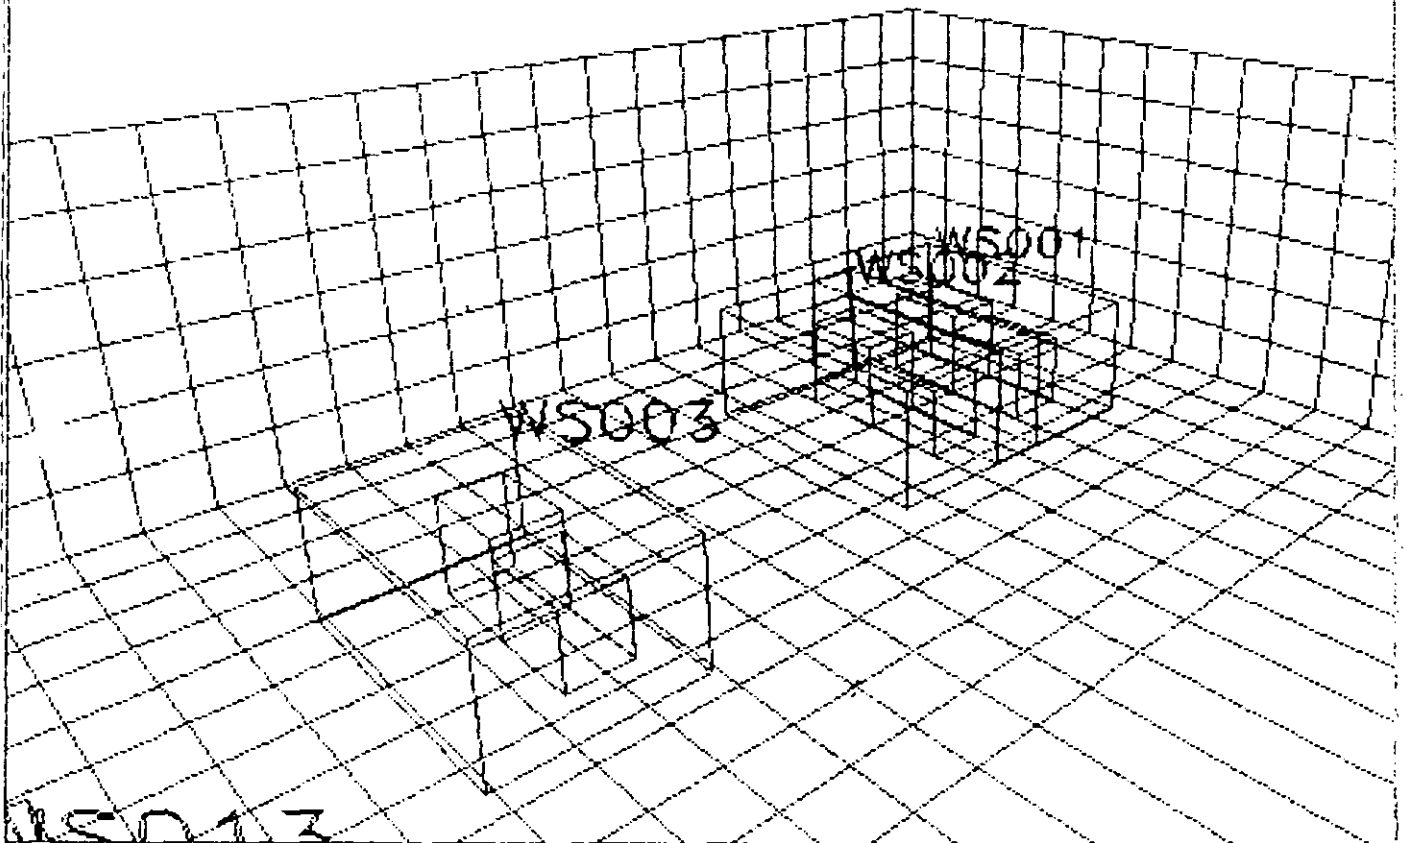
Fig. 21.

RESULT OF 'DISPLAYO' PROGRAM

4.5.6 AUXILIARY PROGRAMS

To simulate real situations in Factory Layout Planning some Auxiliary Programs have been compiled:

4.5.6.1 MANUAL FEEDING OF WORK STATIONS

Frequently, in practice, the plant layout engineer has a list of work stations available for the manufacturing programme. From the list, suitable machine tools and equipment must be selected and a 'technological' order of their relative positions in the layout has to be established. Interrelations of these operations is illustrated by Fig.22. Programs for 'technological' positioning developed at Strathclyde University (Dr.Carrie [13,14]), were originally intended to be used here. However, because of some technical difficulties experienced in the transfer of the Strathclyde programs, the program 'MFEED.FOR' was compiled instead. The program is substituting the results of Dr.Carrie's programs and feeds in a ready designed 'technological' line of work stations needed for the job. The program allows the user to change the 'technological' order, with changing requirements.

To accompany 'MFEED.FOR', program 'WSVTOTO.FOR' was written, which allows the reorganisation of Work Station Modules (in 'largest volume' presentation, see Fig. 5.), according to 'technological' order. This step was found necessary

because the 'largest volumes' of Work Station Modules are only used in some parts of programs, while in other parts the detailed Work Station Modules are used. The 'largest volumes' give a clearer presentation and understanding of layout development {see Fig. 20.b)}, while layouts using detailed Work Station Modules may be used for detailed study or final placement of machines (anchoring bolts,etc.) on shop floor.
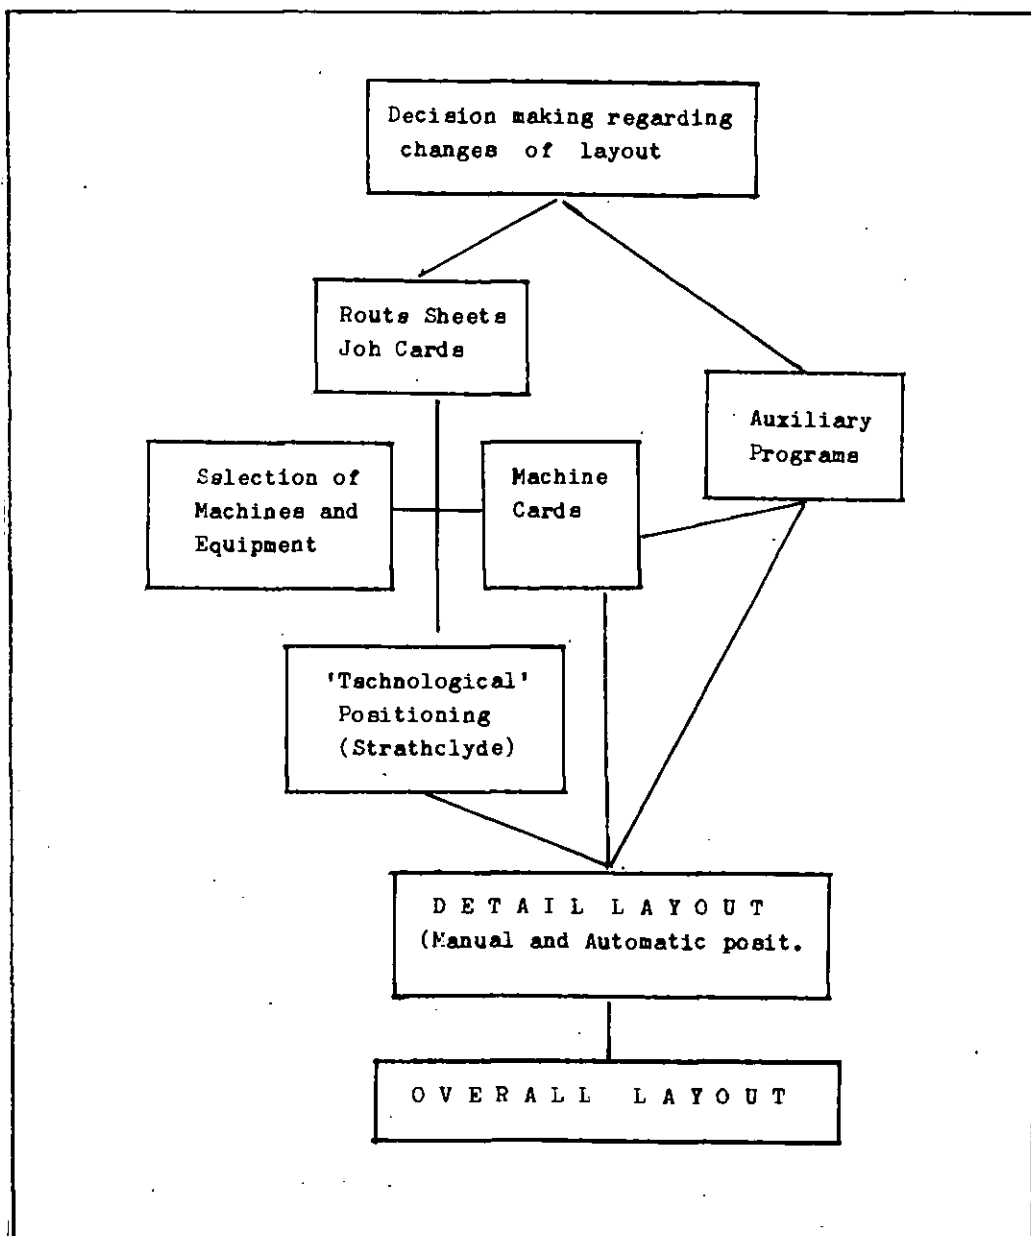
Fig. 22. T O T A L   CAFLAP   SYSTEM

4.5.6.2 CAPACITY CALCULATIONS

The layout engineer must of course be in possession of some basic figures about the new layout (see Chapter 2. Project stages 1. and 2.). The capacity calculation program 'M100.FOR' is intended for basic capacity calculations for the case where no detailed information about production is available.

The program provides calculation of:

- Volume of Material Handling;

- Number of work stations needed;

- Manufacturing area needed;

- Total length of industrial bay.

This program is an example of others which may be developed in the future to estimate and plan, e.g. manning levels, production capacity in relation to shift coeficient, general effectivnes of layout, etc..

5. THE TESTING OF PROGRAMS

All programs were running and were tested for required functions.

5.1 'WSBUILDR.FOR' Program

To produce a 3-D template of an average Work Station Module takes 10-15 minutes. The template gives a reasonable image of the work station and, even if positioned on a one meter grid, it was found that it could be used for the placement of machines within the usual shop floor tolerances of 10 cm.

The 'WSRECALL.FOR' program retrieves the filed 3-D template.

5.2 BUILDING 'CIVES3.FOR' Design Program

To place any civil engineering element via this program takes about 30 to 60 seconds, and any change could be introduced equally fast. The 3-D model of the interior of the bay produced gives a good image of the space available for the layout. The capacity of maximum 200 building elements is more than sufficient.

5.3 MANUAL POSITIONING PROGRAMS

These programs were most thoroughly tested and no special

problems were encountered by users. The positioning of objects was found to be very fast and easy procedure. The only disadvantage is the inaccuracy that arise in connection with the use of joystick. Due to that, incompatible pictures on VDU and printouts are produced, if an adjacent position of work stations is intended. The printout from the CALCOMP 960 plotter shows a double line where work stations touch, while the optical reading of crosshair/work station on VDU gives a single image. This is evidently caused by a combination of both hardware deficiency and the human factor error.

5.4 AUTOMATIC POSITIONING PROGRAM

The composite program 'POSCLASH5.FOR' was found to be easy to use and produced very fast automatic positioning of Work Station Modules according to the design specification.

When ever a clash with building elements occurs, the collision course finding is immediate and the manual override can start without any delay.

Similar problems to those mentioned in the last section have been found with the joystick position accuracy.

IDENTIFICATION BY TAG NOS:

The Tag Number of the 'largest volume' of work station is placed horizontally at the base plate level; while the tag

number of the detailed Work Station Module is written vertically in an upright position. This design is a result of the findings during the testing of 'DISPLAY.FOR' Programs, and makes the reading of Tag No. easier in any display position.

5.5 DISPLAY PROGRAM

'DISPLAY.FOR' program ran without any problems, and the device for observation of the scene from any angle and distance proved useful.

6. DISCUSSION OF RESULTS

The use of PICASO for 3-D design and simulation has proved to be very useful. PICASO is a unique 2-D and 3-D computer graphics system developed at Middlesex Polytechnic to symplify the human interface when manipulating shapes and objects. As with any software environment there are limitations imposed upon the user when using the available commands. CAFLAP's interface would have been greatly improved if the user had had control over line types when objects were subject to hidden-line removal. Objects would have looked tidier if their surfaces could have been shaded or even transparent; there was a need to move elements around the screen in real-time. These problems are not identified as specific criticisms of PICASO but rather to identify the type of graphics facilities CAFLAP could benefit from in future with access to a sophisticated real-time full-colour graphics workstation.

It is felt that the drawing of work stations or buildings by use of a joystick should be attempted in future development of CAFLAP, despite the knowledge of possible inaccuracies inherent in the joystick-VDU-printer combination.

Experience has shown that accuracy, using a scale of 1:50 and a layout grid of 250x250 mm, is satisfactory for the needs of any type of layout for any type of mechanical

engineering production; so inaccuracies resulting from use of joystick are within usual plant layout design tolerance (10cm).

The interactive program 'IYTVAX00.FOR' for manual positioning has all positive functions specified, and it is believed that it could be used for any plant layout almost universally. Small adaptations, for example the listing of Work Stations or, vice versa, printing Work Station lists not only in chronological but also in the 'technological' order, could easily be made on request. The same is true for the 'IYTWSFILE.FOR'program.

Athough the 'POSCLASH5.FOR' Program is the most developed program of all, it has scope for further development as a more versatile tool. For example, collision course finding could be extended (on the principles already developed) for clashes of work station foundations with underground piping or power ducts network, etc.. Similarly, principles for positioning according to Fig.7. a) and b), could be applied to layouts such as Fig.7. c) etc.. This could spare present users possible errors with a negative reading of joystick. However, selfguarding mechanism, protecting user against the error during manipulation (negative angles), would be useful to add.

During the automatic positioning, with the hardware used here and system of identification of spaces (no hatching,

no tinting), the Maintenance Space cannot be placed in the Man-Space of the previous work station to increase the shop floor utilisation. This has to be considered as a calculated loss at this stage of development.

BENEFITS OF CAFLAP TO THE PLANT LAYOUT ENGINEER.

CAFLAP programs testing showed there are two main areas of benefits for the user:

Firstly, it makes plant layout work easier, and the task is accomplished faster.

Secondly, CAFLAP functions as a methodological tool, guiding the user to perform the plant layout tasks systematically and with a holistic approach. This improves the quality of the work and and expands user's potential, leading towards a deeper understanding of the nature of plant layout problems. CAFLAP stimulates the user's creativity, giving an opportunity actually to override the computer when necessary. The user is thus the master of the computer, not just its follower. This is illustrated in Fig.23, which shows how CAFLAP benefits the plant layout engineer.
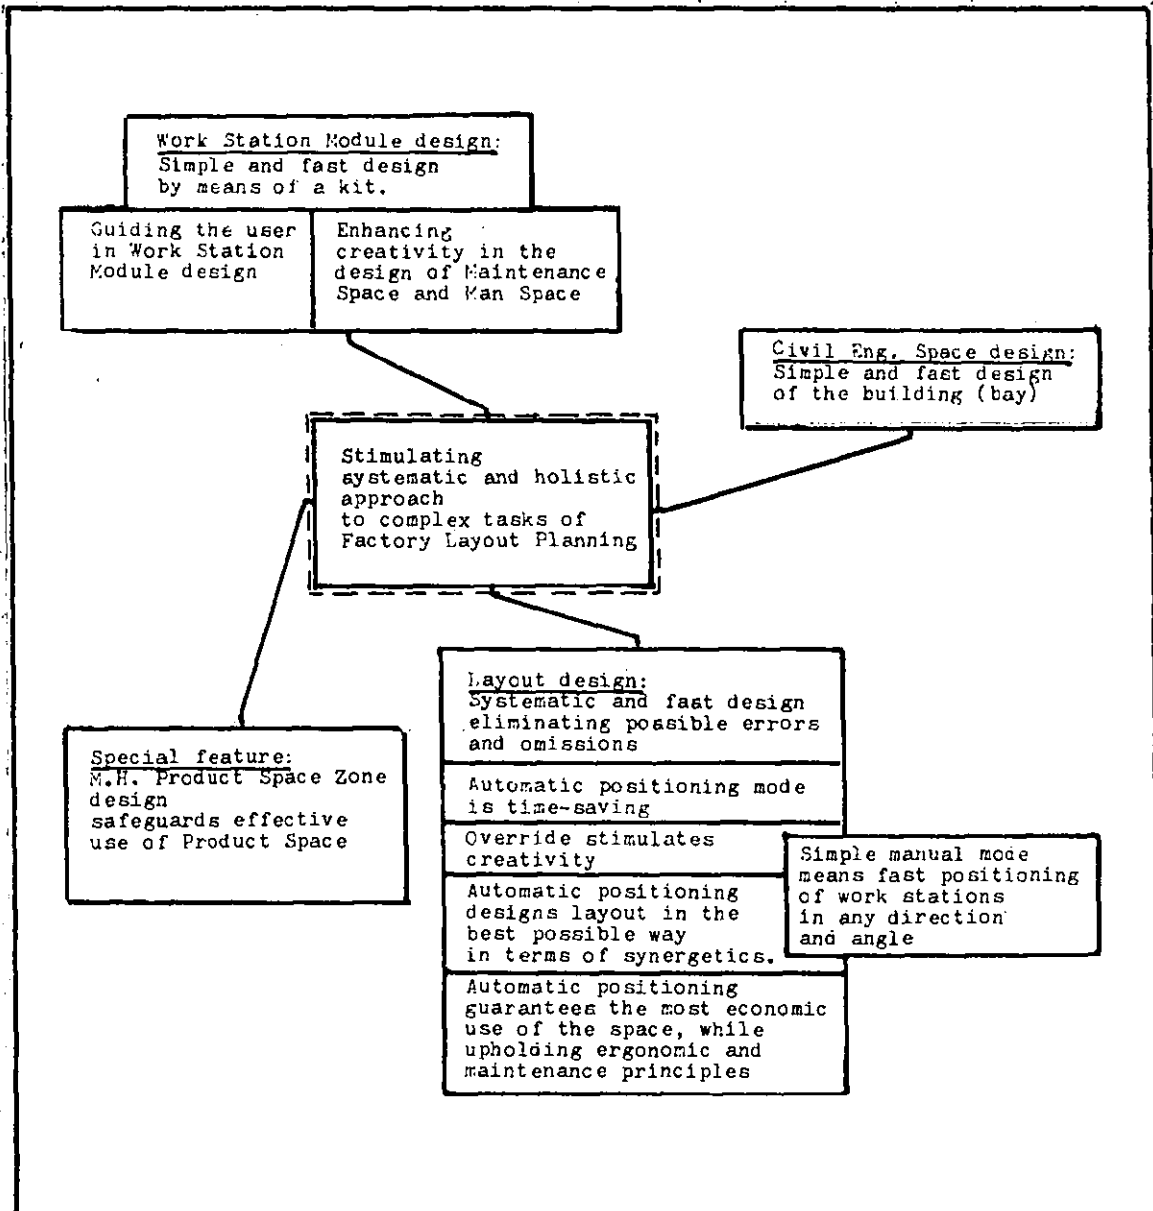
Fig. 23.   THE MAIN BENEFITS OF CAFLAP
            TO THE PLANT   LAYOUT ENGINEER

7. INDUSTRIAL APPLICATION OF CAFLAP

The interactive program for manual positioning was used during 1986-87 Factory Layout Planning projects for Eltron (London) Ltd. Eltron (London) Ltd., established in 1927, has three factories employing over 200 people and is one of the world's leading manufacturers of industrial electrical heating systems and equipment.

Eltron required new layouts for a two-fold increase of production capacity on 'green field' site, and cooperated with Middlesex Polytechnic on development of necessary layouts. For examples see Appendix III., Drawings No. 2. and 3.

Although it was not possible to do any detailed and exact quantitative control-study evaluation, work on the layout using CAFLAP proved much faster than had been possible hitherto by traditional methods.

Final results, with drawings printed on the CALCOMP 960 plotter, were also of a superior quality to those previously obtained. The results produced were more than satisfactory in fulfilling the practical needs of the production management team. Certainly if detail Work Stations Modules had also been incorporated at that time, the result would have been even more remarkable and well received by

Industry.

The automatic positioning program was also not then fully developed so that it was not possible to test its impact in a real industrial environment. However, test runs have shown that the method of automatic positioning of individual work station 3-D templates in construction or improvement situations, with the use of collision course finding and clash indication, is viable and very fast. Originally, as stated in chapter 4.2, the development of CAFLAP was aimed at layout and relayout of a medium size engineering company with batch production and with a maximum product weight of 60kN. These limits were set because the development of CAFLAP was targeted on companies with limited resources, premises, and manufacturing facilities. It was originally wrongly contemplated that the span of an industrial bay, or the type of M.H. equipment (e.g. cranes, fork lift trucks, conveyors) and shape of aisles, could limit the use of CAFLAP automated layout system. These factors could be restrictive and could cause problems for the use of computerised methods designing block plan plant layout (Chapter 3.2). But the CAFLAP method of positioning individual work stations in a 'technological' line is not restricted in this way. Hence the advanced development of the automated positioning method has actually disproved the existence of such a restriction, and CAFLAP may be used for any general application.

EVALUATION OF PROJECT ALTERNATIVES

Projects and alternatives, in a classical plant layout approach, are usually evaluated by means of comparison of the following main parameters:

- production programme per time unit
  (expressed in terms of quantity of products,
  weight, etc.)

- areas

- number of production machines

- number of operators

and indicators derived from the above e.g:

Ratio of Manufacturing Area to Total Area;
Area per one work station (in m sq./ 1);
Production output per 1 m sq. of Manufacturing Area
(kN /m sq.) etc.

The Space Management concept offers a completely new approach to the economic evaluation of projects and their alternatives, giving more accurate results. This is achieved by considering new facts, established in the course of this research work, with following examples of resulting indicators e.g.:

Ratio of :

Manufacturing Space to total space of the hall;

Manufacturing Space to Product Space;

Manufacturing Space to Maintenance Space;

Manufacturing Space + Product Space to Manufacturing Services Space;

Manufacturing + Product + Manufacturing Services Spaces to 'Breathing Space'... etc.

The highest ratio of Manufacturing Space to the 'other' spaces is sought. A set of indicators may be tailored according to individual needs.

They could also provide a very instructive feedback for designers and machine manufacturers.

8. PRESENT LIMITATIONS OF THE SYSTEM

AND

RECOMMENDATIONS FOR FURTHER DEVELOPMENT

At this stage of development the system has the following limitations:

There is no independent facility for collision course finding for travelling overhead cranes or installed robots. If they are to be avoided, the 'obstacles' have to be entered at present via 'CIVES3.FOR' program. In the same way that power and pipeline networks are considered.

A facility for an automatic design for an width of industrial bay and optimum industrial hall is not yet available.

There is as yet no facility to move the picture of the bay to keep pace with automatic development of the layout, and to produce the 'continuous bay' in graphical presentation. At present the area of layout shown is limited to individual sections, determined by the size of VDU.

Other programs (e.g. Strathclyde) desirable for 'technological' positioning of work stations are not incorporated in the overall system.

With respect to the above limitations, the following are areas for further development:

- to extend the already developed programs
  into all the remaining areas of plant layout;

- to use colours (colour VDU) for further
  improvement of identification of spaces (man,
  maintenance) and for space saving during
  collision course finding;

- to add a facility for complete automatic design
  of industrial bays and halls;

- to incorporate the 'technological' positioning
  programs and facility for automatic retrieving
  of information from Work Station Cards;

- to build a library of Work Station Modules of
  all British made machine tools;

- to incorporate/develop the system
  into a Computer Integrated Engineering System.

9. CONCLUSIONS

A Computer Aided Factory Layout Planning system has been developed to the stage where it is industrially useful: further refinements are suggested.

The SPACE MANAGEMENT principles used are abstracted from the complex reality of the Factory Layout Planning field. These principles, translated into CAFLAP system, enable layout tasks to be greatly simplified.

All the main ideas and principles of CAFLAP developed here have been confirmed by computer programs compiled and their results.

The Computer Aided Factory Layout Planning system should not be considered as a new drafting system, nor as an algorithm for finding the most suitable relative placement of work stations.

CAFLAP should be judged as a tool for:

- speeding up layout work through the application of CAFLAP ideas e.g. Work Station Modules, Space Management concepts and positioning systems;

- increasing the quality of layout work by means of design of Work Station Modules and

collision course finding·positioning programs;

- diminishing manual repetitivenes of layout work;

- introducing facility for a more detailed layout
  in the early stages of a project, which will
  increase the quality and the quantity of information
  available for strategic decision making.

CAFLAP is therefore a device to:

- free engineers for more creative work;

- eliminate the number of project stages;

- ease finding optimum alternatives of layout;

- introduce new models into production
  in the shortest possible time;

- lower the cost of capital investment.

The developed SPACE MANAGEMENT concept also offers a new approach to the economic evaluation of projects and their alternatives, by means of comparison of ratios of spaces (Chapter 7. -Economic Evaluation of Project Alternatives). Assessment of the essential Manufacturing Spaces, together with all the auxiliary, service, and 'breathing' spaces, helps to find the areas of potential retrench. This then leads to an expedient relayout and even to a rational redesign of Work Station Modules. If an improvement of the existing factory is undertaken, the assessment, with the

help of the spaces ratios, pinpoints the areas with the most abundant use of the auxiliary spaces which should be tackled first.

Computer graphics methodology, principles, and kinetic functions, have all been used in an innovative way to assist the creative design work of plant layout engineer.

An early decision was made to use simple hardware in this work, e.g. a small monochrome VDU and a basic printer. The aim was to make CAFLAP system accessible to a widest possible spectrum of users. Certainly this decision imposed some limitations on the extent of development of the Space Management ideas. Further development is therefore a matter of some compromise, but the main objectives of the current work have been achieved.

CAFLAP system is an important step forward in the direction of total computer integrated engineering system design.

BOB KOBLIHA

22nd July 1988.

10. REFERENCES

10.1 LITERATURE SEARCH

A computer literature search (Dialog), from NTIS data base, was carried out at Middlesex Polytechnic in March 1985.

The key words were: Plant Layout, Factory Layout, Computer Aided and CAD.

Following sources were searched manually:

The International Software Directory (IBM - 1985),

Engineering and Scientific Application - Programs available fron non-IBM sources (IBM-1983),

Research in British Universities, Polytechnics and Colleges (1984), superseded by Current Research in Britain (J.W. Arrowsmith Ltd. 1985),

Location and Layout Planning, An International Bibliography, (Spring-Verlag 1985),

Buyers Guide to CAD Systems (Draughting and Design 1987, Vol.7, No.7., 9.June, 12-17),

Factors to consider in choosing a graphically animated simulation system (Industrial Engineering, August 1986, 36-68).

Applied Science and Technology Index (The H.W. Wilson

Company, New York, 1980 to Feb. 1988),

British Technology Index (1967 to 1980) superseded by Current Technology Index (Library Association Publishing 1981 to 1988),

and

Engineering Index (USA - Port City Press Inc., 1962 to 1988).

Further detailed manual searches included:

Soviet Engineering Research (PERA 1985 to 1986),

International Journal of Production Research (1972 to Feb. 1988),

Chartered Mechanical Engineer-Professional Engineering (1980 to June 1988),

The Engineer (1980 to 1988),

Machinery and Prodn. Engineering (Jan. 1979 to Feb. 1988),

and

Mechanical Engineering (1986 to 1988).

10.2 REFERENCES

1   Reed R.,JR.,   Plant Layout-Factors,Principles

                                     and Techniques

                                     (Richard D.Irwin,Inc. 1961)

(pp. 3,34)

2   Cullinane T.P. and   Facility Layout in The 80s
    Tompkins J.A.   The Changing consideration
                            (PERA   85045 6)
                            (p.36)

3   Bestwick P.F. and   Quantitative Production Management
    Lockyer K.   (Pitman - 1982)

4   Muther Richard   Systematic Layout Planning
                            (CBI Publishing Company, Inc.
                            1973)
                            (pp. 2-1,2-2)

5   Armour G.C. and   A Heuristic Algorithm and Simulation
    Buffa E.S.   Approach to Relative Location of
                            Facilities
                            (Management Science, Vol.9,
                            No.2, 1963)

6   Armour G.C.,Buffa E.S.   Allocation Facilities with Craft
    and Vollmann T.E.   (Harvard Business Review,
                            March-1964)

7   Hicks Philip E.   Introduction to Industrial Eng.
                            and Management Science
                            (McGraw-Hill Book Comp., 1977)

8   Lee R.C. and   CORELAP-computerised Relationship
    Moor J.M.   Layout Planning

(J.Ind.Eng.,Vol.18,No.3,195-200,
1967)

9   Apple J.M. and   A computerised Plant Layout
    Deisenroth M.P.   Analysis and Evaluation Technique
                            (PLANET)
                            (Proceedings of the 23rd Annual
                            Conf. and Conv., American Insitute
                            of Industr. Engineers,Anaheim,
                            California, pp.121-127, 1972)

10 Apple James M.   Plant Layout and Material Handling
                            (The Ronald Press Company,N.Y.,
                            1963)

11 Kuhle H.,   Computer-Aided Layout Planning
    Dangelmeir W. and
    Warnecke H.J.   (PERA -87036 14)

12 Krejcirik M.   RUGU Algorithm
                            (Computer Aided Design, 1969)

13 Choudhury Shyamal   Numerical Taxonomy Applied to
                            Plant Layout
                            (University of Strathclyde, 1970)
                            (pp.34-44)

14 Carrie Allan S.   The Layout of multi-product lines
                            (INT.J.PROD.RES., 1975, VOL.13,
                            NO.6, 541-557)

15 Parnaby J.   Concept of Manufacturing System

                            System Behaviour

                            (Open University System Group-

                            Open University , 1980)

16 Francis R.L.   Facility Layout and Location

    and   an analytical approach

    White J.A.   (Prentice-Hall, 1974)

17 Immer John.R.   Material Handling

                            (McGraw-Hill, 1953)

18 Elmaghraby S.E.   The Design of Production Systems

                            (Chapman & Hall Ltd., 1966)

19 Wilde D.J.   Foundation of Optimization

    and   (Prentice-Hall, 1967)

    Beichtler C.S.

20 Lockett M.   Organisation as Systems

    and   (The Open University Press, 1980)

    Spear R.

21 Lockyer K.G.   Factory and Production

                            Management

                            (Piman, 1981)

22 Hiscox W.J.   Factory Layout Planning and

                            Progress

                            (Pitman, London, 1948)

23 Gough P.J.C.   Swarf and machine tool

(Hutchinson of London, 1970)

24   Zorzi A.   Venice,

City-Republic-Empire

(Sidgwick and Jackson Ltd, 1983)

25   Hollocks B.W.   Cost effective engineering

through simulation

(Proc Instn Mech Engrs

Vol 198A No5, I Mech E 1984)

26   Schriber J.J.   Simulation Using GPSS

(Wiley, New York 1974)

27   Haken H.   Synergetics - cooperative

phenomena in multicomponent

systems

(Proc., Conference on

Synergetics, 1973)

28   Fuller Burkminster R.   Synergetics: Exploration in

the Geometry of Thinking

(Macmillan Publishing Comp.,

New York, 1982)

29   Byg Systems Ltd.   GRASP

(Company catalogues and

a manual;

Nottingham, 1986)

30   Moore J.M.   Computer aided facilities design:

An international survey.
(INT.J.PROD.RES.,1974,
Vol. 13, No.1, 21-44)

31   Evans G.W.,   Layout design heuristic employing
      Wilhelm M.R. and   the theory of fuzzy sets.
      Karwowski W.   (INT.J.PROD.RES., 1987,
                             VOL. 25, NO.10, 1431-1450)

32   Lewis W.P. and   On the application of computer
      Block   aids to plant layout.
                             (INT.J.PROD.RES., 1980,
                             Vol. 18, No.1, 11-20)

33   Farish Mike   CAD keeps factory planning in trim
                             for project present.
                             (The Engineer, 21 May 1987, p.48)

34   O'Brian C. and   An interactive approach to computer
      Abdel Barp S.E.Z.   aided facility layout.
                             (INT.J.PROD.RES., 1980,
                             Vol. 18, No.2, 201-211)

35   Apple J.M.   Material Handling Design.
                             (New York, Ronald Press, 1973)

36   Ridley J.   Safety at Work.
                             (Butterworths, 1983)

37   Broadhurst A.   The Health and Safety at Work
                             Act in Practice.

(Heyden, 1978)

38	Nugent C.T., Vollmann T.E. and Ruml J.	An experimental comparison of techniques for the assignment of facilities to location. (Operation Research, 1968, Vol. 16, 156)
39	Tompkins J.A. and White J.A.	Facilities Planning. (New York, John Wiley and Sons, 1984)
40	Sedlacek L.	Complex Design of Industrial Plants. (Komplexni projektovani stroj. zavodu-Institut tezkeho stroj.- Praha, 1967)
41	Vollmann T.E., Buffa E.S. and Elwood S.	The facilities layout problem in perspective. (Management Science, 1966, 12, 13-450.)
42	Tompkins J.A.	Facilities Design. (North Carolina State University, Raleigh, N.C., 1975)
43	Tompkins J.A. and Reed R.,Jr.	An Applied Model for the Facilities Design Problem. (IND.J.PROD.RES., 1976,

Sept., Vol.14, No.5, 583-595)

44   Johnson R.V.   SPACECRAFT for Multi-floor Layout
                            Planning.
                            (Management Science, 1982,
                            Vol. 28, No.4, April, 407-417)

45   Jacobs R.F.   A note on SPACECRAFT for
                            multi-floor layout planning.
                            (Management Science, 1984,
                            Vol. 30, May, No.5, 648-649)

46   Cinar Unver   Facilities Planning: A system and
                            space alloction approach in
                            spatial synthesis in computer
                            aided building design.
                            (Charles M.Eastman (Ed.), New York
                            Wiley, 1975)

47   Hassan M.D.Mohsen,   SHAPE: A construction algorithm
     Hogg G.L. and   for area placement evaluation.
     Smith D.R.   (INT.J.PROD.RES., 1986,
                            Vol.24, No.5, 1283-1295)

48   Domschke Wolfgang and Location and Layout Planning
     Drexl Andreas   An International Bibliography.
                            (Springer-Verlag, Berlin
                            Heidelberg, 1985)

49   Muther R. and   Simplified Systematic Layout
     Wheeler J.D.   Planning.

(Factory, Vol.120, n 8,9,10,

August p.68-77, Sept. p.111-119,

Oct. p. 101-110)

50   Carrie A.S.,   Graph Theory and Computer Aided

     Moore J.M.,   Facilities Design.

     Roczniak M., and   (OMEGA. The Int.Journal of Mgmt.

     Seppanen J.J.   Sci., 1978, Vol.6, No.4, 353-361)

51   Carrie A.S.   Numerical taxonomy applied to

                             group technology and plant layout.

                             (INT.J.PROD.RES., 1973,

                             Vol.11, No.4, 399-416)

52   Carrie A.S. and   Layout design and simulation

     Mannion J.   of group cells.

                             (16th International Machine Tool

                             Design and Research Conference-

                             Proceedings- The Macmillan

                             Press Ltd. 1976)

53   Seppänen J.J. and   String processing algorithms

     Moore J.M.   for palnt layout problems.

                             (INT.J.PROD.RES., 1975,

                             Vol. 13, No.3, 239-254)

54   Carrie A.S.   PLANTAP: A package for group

                             technology and plant layout.

                             (Advances in Computer Aided

                             Manufacture, D.McPherson, ed.

North-Holland Publishing Comp.
1977)

55   Carrie A.S.   Computer-aided layout planning-
                            the way ahead.
                            (INT.J.PROD.RES., 1980,
                            Vol. 18, No.3, 283-294)

56   Ross G.C.   PLANTEC,
                            Internal Memo MI/331.
                            (East Kilbride:Computer Aided
                            Manufacturing Division,
                            National Engineering Laboratory)

57   Tompkins J.A. and   Computer Aided Layout: A User's
      Moore J.M.   Guide.
                            (Facilities Planning and Design
                            Division, American Insitute of
                            Industrial Engineers, Inc. 1978)

58   Konz Stephan   Facilities design.
                            (John Wiley and Sons, Inc., 1985)

59   Muther R. and   Four approaches to
      McPherson K.   computerised layout planning.
                            (Industrial Engineering,
                            Feb. 1970)

60   Rosenblatt Meir.J.   The facilities layout problem:
                            a multi-goal approach.

(INT.J.PROD.RES., 1979,

Vol. 17, No.4, 323-332)

61   Liggett R.S.   A partitioning approach to large

floor plan layout problems.

(CAD 80:Int.Conf. and Exhibition

on Computers in Design Eng.

4th Brighton, Mar. 31-Apr.3 1980,

Proceedings Published by IPC Sci.

and Technol.Press, Guilford

Surrey, 1980)

62   Kaltnekar Z.   Some algorithms for decision-

making about layout of

production systems.

(INT.J.PROD.RES., 1980,

Vol.18, No.4, 467-478,

PERA abstract No.1 85047 12)

63   Foulds L.R. and   Some graph theoretic approaches
      Giffin J.W.   to certain facilities layout

models.

(Research Report No.84-10,

Dept.of Industrial and Systems

Eng.,University of Florida,

Mar. 1984)

64   Giffin J.W.,   Drawing a block plan from
      Foulds L.R. and   a REL chart with graph theory
      Cameron D.C.   and a microcomputer.

(Research Report No. 84-9,

Dept. of Industrial and Systems

Eng., Univerisity of Florida,

Mar. 1984)

65   Foulds L.R. and   A graph theoretic heuristic

      Giffin J.W.   for minimizing total transportation

                             cost in facilities layout.

                             (Research Report No.84-20,

                             Dept. of Industrial and System

                             Eng., University of Florida,

                             April 1984)

66   Foulds L.R.   Towards a new decision support

      Giffin J.W. and   system for facilities layout

      Evans J.D.   planners.

                             (Research Report No.85-1,

                             Dept. of Industrial and System

                             Eng., University of Florida,

                             Sept.1985)

67   Herroelen W. and   On the use of flow dominance

      Van Gils A.   in complexity measures for

                             facility layout problems.

                             (INT.J.PROD.RES., 1985,

                             Vol.23, No.1, 97-108)

68   Driscoll J. and   A computer model for investi-

      Sawyer J.H.R.   gating the relayout of batch

                             production areas.

(INT.J.PROD.RES., 1985,

Vol.23, No.4, 783-794)

69   Baer T.   MAPping the factory.

(Mechanical Engineering,

Jan. 1986)

70   Tice S.E.   Interactive Computer Graphics

Model and Simulat On-orbit

Operatios.

(Mechanical Engineering,

Feb. 1986)

71   Grant J.W. and   Factors To Consider In Choosing

Weiner S.A.   A Graphically Animated

Simulation System.

(Industrial Engineering,

Aug. 1986, 36-40,65-68)

72   Buyers guide to CAD Systems.

(Draughting and Design, 1987,

Vol.7, No.7, 9.June, 12-17)

73   Ministry of   Planned Maintenance.

Technology   (London, A.H.S. Lucas, 1966)

74   Clifton R.H.   Principles of Planned

Maintenance.

(London, Edward Arnold, 1974)

75   Heintzelman J.E.   The complete handbook

of maintenance management.
(Prentice-Hall, 1978)

76   Patton J.D.,Jr.   Preventive Maintenance.
                            (Research Triangle Park, NC:
                            Instrument Society of
                            America, 1983)

77   Burbridge J.L.   The Japanese Kanban
                            System.
                            (Institute of Production
                            Control- January/February
                            1982; PERA I 86552 5)

78   Voss C.A.   Two sides of the JIT coin-
                            Japan and UK.
                            (CME, April 1988)

79   Battersby A.   A guide to Stock Control.
                            (Pitman, 1970)

80   Marsden A.   Just in Time - the People
                            implication.
                            (Ingersol Engineers, 1986)

81   Kvålseth Tarald   Ergonomics of workstation
                            design.
                            (London, Butterworths, 1983)

82   Woodson W.E. and   Human engineering guide
      Conover D.E.   for equipment designer.

(University of California

Press, 1964)

83   Kulwiec R.A.   Material Handling Handbook.

-Sponsored by ASME and

International Material

Management Society-

(New York, John Wiley

and Sons, 1985)

BRITISH STANDARDS

84   British Standard   BS 5191:1975

                               Glossary of Production Planning

                               and Control terms

                               (Items: 12001,13006,13005,23004)

85   British Standard   BS 3138:1979

                               Glossary of terms used

                               in Work Study and Organisation

                               and Methods.

86   British Standard   BS 3811:1974

                               Maintenance Terms in

                               Terotechnology.

87   British Standard   BS 308:Part1:1984

                               Engineering drawings practice.

                               Recommendation for general

                               principles.

88   Act   Health and Safety at

                               Work Act 1974.

                               (Her Majesty's Stationary

                               Office, 1974)

COMPUTING AND COMPUTER GRAPHICS

89   Haag James N.   Comprehensive Standard Fortran
                               Programming.
                               (Hayden Book Company, Inc.,
                               New York, 1970)

90   Hill Louis A., Jr.   Stuctured Programming in Fortran.
                               (Prentice-Hall, Inc., 1981)

91   Nanney Ray.T.   Computing.
                               A Problem-Solving Approach
                               with FORTRAN 77.
                               (Prentice-Hall,Inc., 1981)

92   Brainerd Walter S.,   FORTRAN 77 Programming.
      Goldberg Charles H.   (Harper & Row, Publishers, 1978)
      and
      Gross Jonathan L.

93   Vince John   The Picaso System.
                               (Campus, 1983)

94   Vince John   Picaso Programs.
                               (Campus, 1983)

95   Vince John   An Intoroduction to Computer
                               Graphics.
                               (Campus, Handout)

96   Vince John   Fortran Coding Techniques.

                           (Campus, Handout)

97   Vince J.A.   Dictionary of Computer

                           Graphics.

                           (Frances Pinter, 1984)

98   Gardan Y. and   Interactive Graphs.

     Lucas M.   (Kogan Page Ltd., 1985)

99   Rooney J. and   Principles of Computer-aided

     Steadman P.   Design.

                           (The Open University, 1987)

APPENDIX I

Appendix I

TERMINOLOGY

Standard terminology, given by British Standards, still fails to cover some areas in Production and Industrial Engineering. In these areas terminology varies from factory to factory and also internationally among English speaking countries. This is true especially in the field of Factory Layout Planning which is often accented by American English. Some terminology and expressions which, are frequently used in parallel, follow:

Item	Term	Parallel Expression(s)	Remarks
1	Plant Layout	Factory Layout Planning	
		Facility Layout	
		Facility Allocation	
		Economic Activity Location	
2	Project Stage	Project Phase	e.g. Muther[4]
3	Feasibility Study	Programme Study	
		Investment Study	
4	Investment Project	Programme	e.g.Ford Motor Company
		Tender	
5	Project	Final Stage Project	

6	Working Drawings	Detail Drawings Shop Drawings "as made" drawings	
7	Introductory Project		intermediate stage
8	'technological' positioning	theoretical pos.	positioning to suit best technol. demands and economy of production
9	Preventive Maintenance	Regular Maintenance	
10	Manufacturing Services	Auxiliary Services Subsidiary Services	
11	Services	Energy supply	
12	Templates on 'Skins'	Templates and Tapes Templates and Paste	Tompkins and White[39] Farish[33]

APPENDIX II

COMPUTER PROGRAMS

1. 'WSBUILDR.FOR'

2. 'WSRECALL.FOR'

3. 'CIVES.FOR'

4. 'IYTVAX00.FOR'

5. 'IYTWSFILE.FOR'

6. 'POSCLASH5.FOR'

7. 'DISPLAY.FOR'

8. 'MFEED.FOR'

9. 'WSVTOTO.FOR'

10. 'M100.FOR'

```
4444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444
4444444444444444444444444444444444   MIDDLESEX POLYTECHNIC VAXB 11/7B5    44444444444444444444444444
4444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444

              BBBBBBBB       OOOOOO      BBBBBBBB        11
              BBBBBBBB       OOOOOO      BBBBBBBB        11
              BB    BB     OO    OO      BB    BB      1111
              BB    BB     OO    OO      BB    BB      1111
              BB    BB     OO    OO      BB    BB        11
              BB    BB     OO    OO      BB    BB        11
              BBBBBBBB     OO    OO      BBBBBBBB        11
              BBBBBBBB     OO    OO      BBBBBBBB        11
              BB    BB     OO    OO      BB    BB        11
              BB    BB     OO    OO      BB    BB        11
              BB    BB     OO    OO      BB    BB        11
              BB    BB     OO    OO      BB    BB        11
              BBBBBBBB       OOOOOO      BBBBBBBB      111111
              BBBBBBBB       OOOOOO      BBBBBBBB      111111


         W   W   SSSS   BBBB   U   U   111   L       DDDD   RRRR
         W   W   S      B   B  U   U    1    L       D   D  R   R
         W   W   S      B   B  U   U    1    L       B   D  R   R
         W   W   SSS    BBBB   U   U    1    L       D   D  RRRR
         W W W     S    B   B  U   U    1    L       D   D  R R
         WW WW     S    B   B  U   U    1    L       D   D  R  R
         W   W   SSSS   BBBB   UUUUU   111   LLLLL   DDDD   R   R




             J    OOO   BBBB          1      1    55555   999
             J   O   O  B   B        11     11    5       9   9
             J   O   O  B   B         1      1    555     9   9
             J   O   O  BBBB          1      1       5    9999
          J  J   O   O  B   B         1      1       5       9
          J  J   O   O  B   B         1      1    5   5       9
          JJJ    OOO    BBBB         111    111    555     999
```

```
4444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444
4444444444444444444444444444   Digital Equipment Corporation - VAX/VMS Version V4.5   44444444444444444444
4444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444444
```

```
 1   C     "WSBUILDR.FOR" PROGRAM
 2   C     FOR DESIGN/DRAWING OF WORK STATIONS AND EQUIPM...
 3   C     IMPROVED ON 1-8.10.86.
 4   C     FURTHER IMPROVEMENT INTRODUCED ON 10.2.87.
 5   C     FURTHER IMPROVEMENT ON 31.7.87 ('OPERATOR' ADDED)
 6   C
 7
 8         REAL A(3000),B(5000),C(5000),R(2000)
 9         INTEGER SIDES
10         LOGICAL FIRST
11         CHARACTER*12 FILNAR
12         CHARACTER*12 WSNAME
13         CHARACTER*12 TAGNO
14
15
16         FIRST = .TRUE.
17   C
18   C
19         WRITE (6,50)
20   50    FORMAT (" WORK STATION DESIGN PROGRAM. ")
21   C     Please start
22   C     &design from the origin using only positive figures ...
23   C     &including Work Station Module Volume...turning point is
24   C     &left bottom corner. This is important for JC ...ick and
25   C     &antomatic positioning as well!
26         CALL BELL
27         CALL NEWPAG
28
29         WRITE (6,60)
30   60    FORMAT (" SHAPES and  CODES"//" Select wanted")
31         CALL UPPISC (FILNAR,10)
32
33   30    CONTINUE
34         WRITE (6,5001)
35   5001  FORMAT (" BX   BOX-shaped PARTS,start with foundat.plate")
36         WRITE (6,5020)
37   5020  FORMAT (" AB   ANCHORING BOLTS or FOUNDATION BOLTS")
38         WRITE (6,5030)
39   5030  FORMAT (" CY   CYLINDRICAL PARTS")
40         WRITE (6,5040)
41   5040  FORMAT (" CO   CONICAL PARTS")
42         WRITE (6,5050)
43   5050  FORMAT (" PY   PYRAMIDAL PARTS")
44         WRITE (6,5060)
45   5060  FORMAT (" SP   SPHERICAL PARTS")
46         WRITE (6,5090)
47   5090  FORMAT (" OP   OPERATOR")
48         WRITE (6,5070)
49   5070  FORMAT (" TN   TAG NUMBER a unique identification no")
50         WRITE (6,5080)
51   5080  FORMAT (" XX   NO MORE SHAPES REQUESTED-END OF SESSION",/)
52         WRITE (6,35)
53   35    FORMAT (" Please write the selected CODE")
54         CALL BELL
55
56         READ(6,40)CODE
57   40    FORMAT(A2/)
58         IF (CODE.EQ."BX") GOTO 200
59         IF (CODE.EQ."AB") GOTO 300
60         IF (CODE.EQ."CY") GOTO 400
```

```
61              IF (CODE.EQ."CO") GOTO 500
62              IF (CODE.EQ."PY") GOTO 600
63              IF (CODE.EQ."SP") GOTO 700
64              IF (CODE.EQ."UP") GOTO 900
65              IF (CODE.EQ."IN") GOTO 800
66              IF (CODE.EQ."XX") GOTO 100
67      C
68      C       IF THE ENTRY DOES NOT CORRESPOND WITH THE CODE
69      C       THE ERROR MESSAGE IS WRITTEN
70      C
71              CALL BELL
72
73              WRITE (6,70)
74      70      FORMAT (" Please enter your response again - using CAPITALS")
75              GOTO 30
76
77      200     CONTINUE
78      C
79      C       BOX SHAPES ARE INTRODUCED
80      C
81              CALL BELL
82              WRITE (6,210)
83      210     FORMAT (" Please enter dim. for X,Y,Z,ROT,XS,YS,ZS in cm!"/)
84      C
85      C       NOTE DIMENSIONS MUST BE PUT IN CENTIMETERS
86      C       NUMBERS MUST BE ENTERED  IN 5 FIG.,DEC.POIN AND 2 FIG.FORM
87      C       ROTATION IN DEGREE (EXAMPLE 30.0)
88      C
89              READ (5,220,END=230) X,Y,Z,ROT,XS,YS,ZS
90              WRITE (10,220) X,Y,Z,ROT,XS,YS,ZS
91      220     FORMAT (7F8.2/)
92              CALL BOX (A,X,Y,Z)
93              CALL TURN3D (A,ROT,0.0,0.0,2,B)
94              CALL SHIFT3 (P,XS,YS,ZS)
95      230     CONTINUE
96              GOTO 1000
97
98      300     CONTINUE
99              CALL BELL
100     C
101     C       SHAPES OF ENCHORING BOLTS ARE INTRODUCED
102     C
103
104             WRITE(6,310)
105     310     FORMAT (" Please enter data for ROTation and Shift XS,YS,ZS"/)
106             READ(5,320,END=330)ROT,XS,YS,ZS
107             WRITE(10,320)ROT,XS,YS,ZS
108     320     FORMAT(4F8.2/)
109             CALL FBOLT (A)
110             CALL TURN3D(A,ROT,0.0,0.0,2,B)
111             CALL SHIFT3(B,XS,YS,ZS)
112     330     CONTINUE
113             GOTO 1000
114
115     400     CONTINUE
116             CALL BELL
117     C
118     C       CYLINDRICAL PARTS ARE INTRODUCED
119     C
120             WRITE(6,405)
```

```
121    405    FORMAT(' Please write dim. DIA,HEIGHT,SIDES,ROT,XS,YS,ZS'/)
122
123           READ (5,410,END=420)DIA,HEIG,SIDES,ROT,XS,YS,ZS
124           WRITE(10,410)DIA,HEIG,SIDES,ROT,XS,YS,ZS
125    410    FORMAT(2F8.2,I8,4F8.2)
126           CALL CYLIND(A,DIA,HEIG,SIDES)
127           CALL TURN3D(A,ROT,0.0,0.0,2,B)
128           CALL SHIFT3(B,XS,YS,ZS)
129    420    CONTINUE
130           GOTO 1000
131
132
133    500    CONTINUE
134           CALL BELL
135    C
136    C      CONICAL PARTS ARE INTRODUCED HERE
137    C
138           WRITE (6,510)
139    510    FORMAT (' Please enter dim. of cone DIAM,HEIGHT and No of
140          &sides,Rotation ROT and shift XS,YS,ZS'//)
141           READ (5,520,END=530)DIAM,HEIGHT,NO,ROT,XS,YS,ZS
142           WRITE (10,520) DIAM,HEIGHT,NO,ROT,XS,YS,ZS
143    520    FORMAT (2F8.2,I14,4F8.2)
144           CALL CONE (A,DIAM,HEIGHT,NO)
145           CALL TURN3D (A,ROT,0.0,0.0,2,B)
146           CALL SHIFT3 (B,XS,YS,ZS)
147    530    CONTINUE
148           GOTO 1000
149    C
150    600    CONTINUE
151           CALL BELL
152    C
153    C      PYRAMIDAL PARTS ARE INTRODUCED HERE
154    C
155           WRITE(6,610)
156    610    FORMAT (' Please enter dimensions for Pyramidal parts WIDTH,
157          &DEPTH,HEIGHT and ROTATION and Shift XS,YS,ZS'//)
158           READ (5,620,END=630) WIDTH,DEPTH,HEIGHT,ROT,XS,YS,ZS
159           WRITE (10,620) WIDTH,DEPTH,HEIGHT,ROT,XS,YS,ZS
160    620    FORMAT (7F8.2)
161           CALL PYRAM (A,WIDTH,DEPTH,HEIGHT)
162           CALL TURN3D (A,ROT,0.0,0.0,2,B)
163           CALL SHIFT3 (B,XS,YS,ZS)
164    630    CONTINUE
165           GOTO 1000
166
167
168    700    CONTINUE
169           CALL BELL
170
171    C
172    C      HERE ARE INTRODUCED ALL SPHERICAL PARTS
173    C
174           WRITE (6,710)
175    710    FORMAT (' Please enter dimension for spherical parts DIAM,
176          &NH_no of horizontal tiles and NV_no of vertical tiles
177          &and Rotation and Shift XS,YS,ZS'/)
178
179
180           READ (5,720,END=730)DIAM,NH,NV,ROT,XS,YS,ZS
```

```
181          WRITE (10,720)DIAM,NH,NV,ROT,XS,YS,ZS
182   720    FORMAT (1F8.2,2I8,4F8.2)
183          CALL SPHERE (A,DIAM,NH,NV)
184          CALL TURN3D(A,ROT,0.0,0.0,2,B)
185          CALL SHIFT3(B,XS,YS,ZS)
186   730    CONTINUE
187          GOTO 1000
188
189   900    CONTINUE
190          CALL BELL
191   C
192   C      3-D TEMPLATE/MODEL OF 'OPERATOR' IS INTRODUCED
193   C
194          WRITE (6,910)
195   910    FORMAT (' Please enter data for ROTATION and SHIFT...
196         &XS,YS,ZS' /)
197          READ (5,920,END=930)ROT,XS,YS,ZS
198          WRITE (10,920)ROT,XS,YS,ZS
199   920    FORMAT (4F8.2)
200          CALL OPERATOR (A)
201          CALL TURN3D (A,ROT,0.0,0.0,2,B)
202          CALL SHIFT3 (B,XS,YS,ZS)
203   930    CONTINUE
204          GOTO 1000
205
206   800    CONTINUE
207          CALL BELL
208   C
209   C      HERE IS INTRODUCED A TAG NUMBER
210   C
211          WRITE (6,810)
212   810    FORMAT (' Please enter TAG NO, ROTation and shift XS,YS,ZS'/)
213          READ (5,820,END=830)TAGNO,ROT,XS,YS,ZS
214          WRITE(10,820)TAGNO,ROT,XS,YS,ZS
215   820    FORMAT(A6,4F8.2)
216          CALL HERSH(TAGNO,6,2,60.0,R)
217          CALL TRANSP(R,A)
218          CALL TURN3D (A,ROT,0.0,0.0,2,B)
219          CALL SHIFT3 (B,XS,YS,ZS)
220   830    CONTINUE
221          GOTO 1000
222
223   1000   CONTINUE
224          IF (FIRST) GOTO 1010
225          CALL JOIN (B,C)
226
227          GOTO 30
228
229   1010   CONTINUE
230          CALL COPY (B,C)
231          FIRST = .FALSE.
232          GOTO 30
233
234   100    CONTINUE
235          CALL CLDISC (FILNAM,10)
236
237          CALL OPDISC('ASFDIM',10)
238          FAC  =DIM('FAC   ')
239          FORX =DIM('FORX  ')
240          FORY =DIM('FORY  ')
```

```
241        FRAX1 =DIN("FRAX1 ")
242        FRAX2 =DIN("FRAX2 ")
243        FRAY1 =DIN("FRAY1 ")
244        FRAY2 =DIN("FRAY2 ")
245        PICPLA=DIN("PICPLA")
246        DISTNC=DIN("DISTNC")
247        ROTATN=DIN("ROTATN")
248        ELEVTN=DIN("ELEVTN")
249        CALL CLDISC("WSFDIM",IO)
250        CALL NEWPAG
251        CALL START
252    C   CALL FACTOR(FAC)
253        CALL FORMAT(FORX,FORY)
254        CALL FRAME(FRAX1,FRAX2,FRAY1,FRAY2)
255        CALL PLANE(PICPLA)
256        CALL PEYE(0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
257        CALL DRAWIT(C)
258        CALL RCLOSE
259        CALL FINISH
260    C
261    C   IF THE SHAPE IS ACCORDING TO OUR REQUIREMENT SAY YES
262    C
263        WRITE(6,2100)
264    2100 FORMAT(" Is the work station of a required likeness YE/NO?")
265
266        READ (5,2110)ANS
267    2110 FORMAT(A2/)
268        IF (ANS.EQ."NO".OR.ANS.EQ."N") GOTO 30
269        IF (ANS.EQ."YE".OR.ANS.EQ."Y") GOTO 2200
270
271    2200 CONTINUE
272    C
273    C   WORK STATION DETAILED DRAWN BY HELP OF THE ABOVE PROGRAM
274    C   IS FILED UNDER A UNIQUE TAG NUMBER
275    C    EACH WORK   STATION HAS GOT ITS OWN FILE
276    C
277        WRITE(6,2300)
278    2300 FORMAT(" ENTER FILENAME/WSNAME=a tag No. of work station drawn")
279        READ(5,2310)WSNAME
280    2310 FORMAT(A12)
281        CALL OUT30(C,WSNAME)
282        STOP
283        END
284    C
285    C
287    C   "FBOLT"  _  FOUNDATION BOLT
288    C   THIS IS A SUBROUTINE DRAWING AN ANCHORING BOLT
288    C
288    C...
290
291        SUBROUTINE FBOLT (F)
292
293        READ D(39), E(88), F(127)
294        CALL LINE3D(D,0.0,0.0,2.0,0.0,0.0,-2.0,10)
295        CALL LINE3D(E,2.0,0.0,0.0,-2.0,0.0,0.0,10)
296        CALL JOIN(D,E)
297        CALL LINE3D(F,0.0,2.0,0.0,0.0,-8.0,0.0,10)
298        CALL JOIN(E,F)
299        RETURN
300        END
```

```
301     C
302     C          'OPERATOR' -3-D TEMPLATE
303     C
304               SUBROUTINE OPERATOR (T)
305     C
306     C          TRUNK,ARMS,LEGS
307     C
308               READ A(100),B(500),C(900)
309     C          READ
310               READ F(1000),D(1200),T(2000)
311
312
313               CALL BOX (A,55.0,60.0,35.0)
314               CALL SHIFT3 (A,0.0,90.0,0.0)
315               CALL BOX (B,10.0,90.0,20.0)
316               CALL JOIN (A,B)
317               CALL BOX (C,10.0,90.0,20.0)
318               CALL SHIFT3 (C,35.0,0.0,0.0)
319               CALL JOIN (B,C)
320               CALL BOX (F,20.0,25.0,20.0)
321               CALL SHIFT3 (F,27.0,150.0,0.0)
322               CALL JOIN (C,F)
323               CALL CUBE (D,20.0,15.0,6)
324               CALL TURN3D (D,270.0,0.0,0.0,1,T)
325               CALL SHIFT3 (T,27.0,155.0,-20.0)
326               CALL JOIN (F,T)
327               CALL DRAWIT(T)
328
329               RETURN
330               END
331     C
332     C...
333     C
334     C... BUILDER UNDER THE NAME 'ASFILE.FOR'
335     C
```

8.

```
555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555
55555555555555555555555555555555  MIDDLESEX POLYTECHNIC VAXB 11/785   5555555555555555555555555555
555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555
```

```
              BBBBBBBB      000000    BBBBBBBB        11
              BBBBBBBB      000000    BBBBBBBB        11
              BB    BB   00      CO   BB      BB     1111
              BB    BB   00      CO   BB      BB     1111
              BB    BB   00      CO   BB      BB       11
              BB    BB   00      CO   BB      BB       11
              BBBBBBBB   00      CO   BBBBBBBB         11
              BBBBBBBB   OC      CO   BBBBBBBB         11
              BB    BB   00      CO   BB      BB       11
              BB    BB   00      CO   BB      BB       11
              BB    BB   00      CO   BB      BB       11
              BB    BB   00      CO   BB      BB       11
              BBBBBBBB      000000    BBBBBBBB     111111
              BBBBBBBB      000000    BBBBBBBB     111111
```

```
     W    W   SSSS   RRRR   EEEEE   CCCC   AAA   L       L
     W    W   S      R   R  E       C      A   A L       L
     W    W   S      R   R  E       C      A   A L       L
     W    W    SSS   RRRR   EEEE    C      A   A L       L
     W  W W       S  R  R   E       C      AAAAA L       L
     WW   WW      S  R   R  E       C      A   A L       L
     W    W   SSSS   R    R EEEEE   CCCC   A   A LLLLL   LLLLL
```

```
        J    000   BBBB         1      1     666     000
        J    0   0  B   B      11     11    6        0   0
        J    0   0  B   B       1      1    6        0   00
        J    0   0  BBBB        1      1    6666     0 0 0
   J    J    0   0  B   B       1      1    6   6    00  0
   J    J    0   0  B   B       1      1    6   6    0   0
    JJJ      000   BBBB       111    111     666     000
```

160) queued to SYSSPRINT on 9-NOV-1987 12:13 by user BOB1, UIC [RESM0012,BOB1], under account RE
 printer _LPA0: on 9-NOV-1987 12:14 from queue LFA0.

```
555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555
55555555555555555555555555  Digital Equipment Corporation - VAX/VMS Version V4.5  5555555555555555
555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555555
```

```
 1    C        PROGRAM "RECALLWS.FOR"
 2    C        THIS PROGRAM IS RECALLING/PRESENTING THE WORK STATIONS DRAWN
 3    C        BY HEPL OF PROGRAM WSFILE.FOR
 4    C
 5             REAL V(5000)
 6             CHARACTER*12 WSNAME
 7             CHARACTER*12 TAGNO
 8             CALL OPDISC('WSFDIR',10)
 9             FAC    =DIN('FAC     ')
10             FORX   =DIN('FORX    ')
11             FORY   =DIN('FORY    ')
12             FRAX1  =DIN('FRAX1   ')
13             FRAX2  =DIN('FRAX2   ')
14             FRAY1  =DIN('FRAY1   ')
15             FRAY2  =DIN('FRAY2   ')
16             PICPLA=DIN('PICPLA')
17             DISTNC=DIN('DISTNC')
18             ROTATN=DIN('ROTATN')
19             ELEVTN=DIN('ELEVTN',10)
20             CALL CLDISC('WSFDIR',10)
21             CALL START
22             CALL FACTOR(FAC)
23             CALL FORMAT(FORX,FORY)
24             CALL FRAME(FRAX1,FRAX2,FRAY1,FRAY2)
25             CALL PLANE(PICPLA)
26             CALL PEYE(0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
27
28             WRITE (6,50)
29    50       FORMAT (' Please write in the Work Station tag No.')
30             READ(5,60) TAGNO
31    60       FORMAT(A12)
32             CALL IN3D(V,TAGNO)
33             CALL DRAWIT (V)
34             CALL DCLOSE
35             CALL FINISH
36             STOP
37             END
38
39    C
40    C... FILE UNDER THE NAME 'RECALLWS.FOR'
41    C
```

```
6666666666666666666666666666666666666666666666666666666666666666666666666666666666666666
666666666666666666666666666666  MIDDLESEX POLYTECHNIC VAXB 11/765   66666666666666666666666
6666666666666666666666666666666666666666666666666666666666666666666666666666666666666666666


       BBBBBBBB     OOOOOO    BBBBBBBB       11
       BBBBBBBB     OOOOOO    BBBBBBBB       11
       6B     BB   OO    CO   6B     BB     1111
       BB     BB   OO    CO   BB     BB     1111
       BB     BB   OO    CO   BB     BB       11
       BB     BB   OO    CO   BB     BB       11
       BBBBBBBB    OO    CO   BBBBBBBB        11
       BBBBBBB     OO    CO   BBBBBBBB        11
       BB     BB   OO    CO   BB     BB       11
       BB     BB   OO    CO   BB     BB       11
       BB     BB   OO    CO   BB     BB       11
       BB     BB   OO    CO   BB     BB       11
       BBBBBBBB     OOOOOO    BBBBBBBB     111111
       BBBBBBBB     OOOOOO    BBBBBBBB     111111


        CCCC    111    V    V   EEEEE   SSSS    333
        C        1     V    V   E       S      3   3
        C        1     V    V   E       S          3
        C        1     V    V   EEEE    SSS        3
        C        1     V    V   E          S       3
        C        1      V  V    E          S    3   3
        CCCC    111       V      EEEEE   SSSS    333




                 J    OOO    BBBB          1     1     666     1
                 J    O   O   B    B      11    11     6      11
                 J    O   O   B    B       1     1     6       1
                 J    O   O   BBBB         1     1     6666     1
            J    J    O   O   B    B       1     1     6   6    1
            J    J    O   O   B    B       1     1     6   6    1
             JJJ     OOO    BBBB         111   111     666    111
```

```
6666666666666666666666666666666666666666666666666666666666666666666666666666666666666666666
6666666666666666666666666666  Digital Equipment Corporation - VAX/VMS Version V4.5  6666666666666666
6666666666666666666666666666666666666666666666666666666666666666666666666666666666666666666
```

```
 1   C      "CIVES.FOR" PROGRAM IS WRITTEN FOR DESIGN OF CIVIL
 2   C      ENGINEERING SPACE (SECTION OF A BAY) - CONSISTING
 3   C      OF CIVIL ENGINEERING ELEMENTS (HERE PRESENTED AS
 4   C      BOXES ONLY!)
 5   C
 6   C      DATA ARE READ IN MANUALLY ONLY
 7   C      (EXEPT 'DIN' FEEDING)
 8   C
 9   C      PRINTER AND VDU IS USED
10   C
11   C
12          REAL  A(98),B(98), CESPAC (10000)
13          REAL  XWID(100),YWID(100),ZWID(100),XDIS(100),YDIS(100),ZDIS(100)
14          REAL  UGR(100),ZT(100),XT(100)
15
16          INTEGER NCEE
17          INTEGER SELECT,DESEL, ALPHA,GRAPHI
18          DATA SELECT/"40033/
19          DATA DESEL/"40433/
20          DATA ALPHA/"30/
21          DATA GRAPHI/"35/
22
23
24   C      WRITE(6,10)ALPHA
25   C10     FORMAT("+",A2,$)
26   C      WRITE(6,10)SELECT
27          WRITE(6,20)
28   20     FORMAT(" Program for design of a Civil Eng. Space(bay) in 3-D")
29   C      WRITE(6,10)DESEL
30   C      WRITE(6,10)GRAPHI
31   C
32   C      THE CIVIL ENGINEERING ELEMENTS AND
33   C      OTHER SPACES - ALL DIMESIONS SHOULD BE ENTERED IN DECIMETERS (DM)
34          CALL START
35          CALL OPDISC("CIVDIR",10)
36          DISTRC=DIN("DISTRC")
37          ROTATN=DIN("ROTATN")
38          ELEVTN=DIN("ELEVTN")
39          ZOOM  =DIN("ZOOM  ")
40          NLX   =DIN("NLX   ")
41          NLY   =DIN("NLY   ")
42          NLZ   =DIN("NLZ   ")
43          SPACE =DIN("SPACE ")
44          CALL CLDISC("CIVDIR",10)
45          CALL FORMAT (80.0,80.0)
46          CALL FRAME(-55.0,25.0,-35.0,25.0)
47          CALL PEYE (0.0,0.0,0.0,DISTRC,ROTATN,ELEVTN)
48          CALL PLANE (ZOOM)
49          CALL MESH(NLX,NLY,NLZ,SPACE)
50
51   C      PRESENT SITUATION IS DRAWN
52
53          CALL PRESENT
54   C
55   C      NEW DEVELOPMENT STARTS IF REQUESTED
56   C
57          CALL DEVELOP
58          CALL NCLOSE
59          CALL FINISH
60          STOP
```

```
61          END
62    C...
63
64          SUBROUTINE DEVELOP
65          REAL   A(98),B(98), CESPAC (10000)
66          REAL  XWID(100),YWID(100),ZWID(100),XDIS(100),YDIS(100),ZDIS(100)
67          REAL  DGR(100),ZT(100),XT(100)
68
69          INTEGER NCEE
70          INTEGER SELECT,DESEL, ALPHA,GRAPHI
71          DATA SELECT/"40033/
72          DATA DESEL/"40433/
73          DATA ALPHA/"30/
74          DATA GRAPHI/"35/
75
76
77    C     WRITE(6,10)ALPHA
78    C10     FORMAT("+",A2,S)
79    C     WRITE(6,10)SELECT
80    C
81    C     IF REQUESTED A NEW DEVELOPMENT FOLLOWS
82    C
83    50    CONTINUE
84          WRITE (6,60)
85    60    FORMAT (' Do you wish to change/devlop the Layout...YES/NO')
86          READ (5,70)ANS
87    70    FORMAT (A2)
88          IF (ANS.EQ.'NO'.OR.ANS.EQ.'N') GOTO 500
89          IF (ANS.EQ.'YE'.OR.ANS.EQ.'N') GOTO 125
90          WRITE (6,120)
91    120   FORMAT (' Please enter your response again')
92          GOTO 50
93    125   CONTINUE
94          CALL NEWPAG
95    130   CONTINUE
96          CALL OPDISC ('CELDIM',10)
97          READ(10,190,END=135)I,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),
98         &ZDIS(I),DGR(I),ZT(I),XT(I)
99
100         WRITE(6,190)I,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),
101        &ZDIS(I),DGR(I),ZT(I),XT(I)
102         GOTO 130
103   135   CONTINUE
104         CALL CLDISC ('CELDIM',10)
105   C
106   C     WRITE(6,10)ALPHA
107   C     WRITE(6,10)SELECT
108   C     WRITE(6,140)
109   C140    FORMAT(' PLEASE ENTER NO. OF CIV,E. ELEMENTS(NCEE) REQUIRED')
110   C     WRITE(6,10)DESEL
111   C     WRITE(6,10)GRAPHI
112   C     READ(5,*)NCEE
113   C     WRITE(6,150)NCEE
114   C150    FORMAT(I3)
115   C     WRITE(6,10)ALPHA
116   C     WRITE(6,10)SELECT
117   C     WRITE(6,160)NCEE
118   C160    FORMAT(I3)
119   C     WRITE(6,10)DESEL
120   C     WRITE(6,10)GRAPHI
```

```
121   C      WRITE(6,10)ALPHA
122   C      WRITE(6,10)SELECT
123          WRITE(6,260)
124   260    FORMAT (' Please enter Item No., dim. & posn. of objects in dm
125          &to end development/extending type 99 ')
126          WRITE (6,270)
127   270    FORMAT (' I',2X,'XWID',4X,'YWID',4X,'ZWID',4X,'XDIS',4X,'YDIS',4X,
128          &'ZDIS',5X,'DGR',5X,'ZT',5X,'XT')
129   C      WRITE(6,10)DESEL
130   C      WRITE(6,10)GRAPHI
131   280    CONTINUE
132          READ(5,190)I,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),ZDIS(I),
133          &DGR(I),ZT(I),XT(I)
134          IF (I.NE.99) GOTO 280
135   C      WRITE(6,10)ALPHA
136   C      WRITE(6,10)SELECT
137          CALL OPDISC ('CELDIM',10)
138          DO 200 I=1,99
139          IF (XWID(I).EQ.0.0.AND.YWID(I).EQ.0.0) GOTO 200
140          WRITE(6,190)I,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),ZDIS(I),
141          &DGR(I),ZT(I),XT(I)
142   190    FORMAT(I3,9F8.2)
143   C      WRITE(6,10)DESEL
144   C      WRITE(6,10)GRAPHI
145          WRITE(10,190)I,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),ZDIS(I),
146          &DGR(I),ZT(I),XT(I)
147   200    CONTINUE
148          CALL CLDISC ('CELDIM',10)
149   C
150   C      A PAUSE IS INTRODUCED FOR CHECKING
151   C      TO CONTINUE TYPE 'G'
152   C
153          CALL NEWPAG
154          DO 300 I = 1,99
155          IF (XWID(I).EQ.0.0.AND.YWID(I).EQ.0.0) GOTO 300
156          CALL BOX (A,XWID(I),YWID(I),ZWID(I))
157          CALL SHIFT3(A,XDIS(I),YDIS(I),ZDIS(I))
158          CALL TURN3D (A,DGR(I),ZT(I),XT(I),2,B)
159          IF (I.EQ.1) CALL COPY (B,CESPAC)
160          IF (I.NE.1) CALL JOIN (B,CESPAC)
161   300    CONTINUE
162          CALL DRAWIT (CESPAC)
163          CALL OUT3D (CESPAC,'CIVILD')
164          GOTO 50
165   500    CONTINUE
166          RETURN
167          END
168
169   C
170   C...
171          SUBROUTINE MESH(NLX,NLY,NLZ,SPACE)
172          REAL A(1000)
173          CALL GRIL3D(A,NLX,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,SPACE,.0,.0)
174          CALL DRAWIT(A)
175          CALL GRIL3D(A,NLY,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,SPACE,.0)
176          CALL DRAWIT(A)
177          CALL GRIL3D(A,NLZ,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,.0,.0,SPACE)
178          CALL DRAWIT(A)
179          CALL GRIL3D(A,NLY,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,.0,SPACE,.0)
180          CALL DRAWIT(A)
```

```
181          CALL GRIL3D(A,NLX,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,SPACE,.0,.0)
182          CALL DRAWIT(A)
183          CALL GRIL3D(A,NLZ,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,.0,SPACE)
184          CALL DRAWIT(A)
185          RETURN
186          END
187   C...
188          SUBROUTINE PRESENT
189          REAL   A(98),B(98), CESPAC (10000)
190          REAL XWID(100),YWID(100),ZWID(100),XDIS(100),YDIS(100),ZDIS(100)
191          REAL DGR(100),ZT(100),XT(100)
192
193          INTEGER DCEE
194          INTEGER SELECT,DESEL, ALPHA,GRAPH1
195          DATA SELECT/"40033/
196          DATA DESEL/"40433/
197          DATA ALPHA/"30/
198          DATA GRAPH1/"35/
199
200
201   C      WRITE(6,10)ALPHA
202   C10     FORMAT("+",A2,S)
203   C      WRITE(6,10)SELECT
204
205          WRITE (6,20)
206   20     FORMAT(" LAYOUT...The present situation of development")
207          CALL BELL
208          CALL OPDISC("CIVDIM",10)
209          DISINC=DIM("DISINC")
210          ROTATH=DIM("ROTATH")
211          ELEVTH=DIM("ELEVTH")
212          ZOOM  =DIM("ZOOM  ")
213          NLX   =DIM("NLX   ")
214          NLY   =DIM("NLY   ")
215          NLZ   =DIM("NLZ   ")
216          SPACE =DIM("SPACE ")
217          CALL CLDISC("CIVDIM",10)
218          CALL MESH(NLX,NLY,NLZ,SPACE)
219          CALL OPDISC ("CELDIM",10)
220
221   60     CONTINUE
222          READ(10,90,END=110)1,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),
223          &ZDIS(1),DGR(1),ZT(1),XT(1)
224   90     FORMAT(I3,9F8.2)
225   C      WRITE(6,90)1,XWID(I),YWID(I),ZWID(I),XDIS(I),YDIS(I),
226   C      &ZDIS(1),DGR(I),ZT(1),XT(I)
227          GOTO 60
228   110    CONTINUE
229          CALL CLDISC ("CELDIM",10)
230          DO 150 I=1,99
231          CALL BOX (A,XWID(I),YWID(I),ZWID(I))
232          CALL SHIFT3(A,XDIS(I),YDIS(I),ZDIS(I))
233          CALL TURN3D (A,DGR(I),ZT(1),XT(1),2,B)
234          IF (1.EQ.1) CALL COPY (B,CESPAC)
235          IF (I.NE.1) CALL JOIN (B,CESPAC)
236   150    CONTINUE
237          CALL DRAWIT (CESPAC)
238          RETURN
239          END
240
```

```
241    C....
241    C       THIS IS 'CIVES3.FOR PROGRAM
241    C       USING PRINTER (COMMANDS) AND 'DIR' FUNCTIONS
241    C
```

16.

```
BBBBBBBB      OOOOOC    BBBBBBBB        11
BBBBBBBB      OOOOOO    BBBBBBBB        11
BB      BB   OO     CO  BB      BB    1111
BB      BB   OO     CO  BB      BB    1111
BB      BB   OO     CO  BB      BB      11
BB      BB   OO     OO  BB      BB      11
BBBBBBBB     OO     CO  BBBBBBBB        11
BBBBBBBB     OO     CO  BBBBBBBB        11
BB      BB   OO     CO  BB      BB      11
BB      BB   OO     CO  BB      BB      11
BB      BB   OO     CO  BB      BB      11
BB      BB   OO     CO  BB      BB      11
BBBBBBBB      OOOOOC    BBBBBBBB     111111
BBBBBBBB      OOOOCC    BBBBBBBB     111111
```

```
111    Y   Y   TTTTT   V    V    AAA    X   X    000    000
 1     Y  Y      T     V    V   A   A    X X    0   0  0   0
 1      Y Y      T     V    V   A   A    X X    0  00  0  0B
 1       Y       T     V    V   AAAAA     X     0  0 0  0 0 0
 1       Y       T      V  V    A   A    X X    B0  0  00  0
 1       Y       T       V V    A   A   X   X   0   0  0   0
111      Y       T        V     A   A   X   X    000    000
```

```
 J    OOO    BBBB          1       1      666    333
 J   O   O   B    B       11      11      6        3   3
 J   O   O   B    B        1       1      6            3
 J   O   O   BBBB          1       1      6666         3
J  J O   O   B    B        1       1      6   6        3
J  J O   O   B    B        1       1      6   6   3    3
 JJJ   OOO   BBBB         111     111      666    333
```

```
1    C       'IYTVAX00.FOR'
2    C       INTERACTIVE LAYOUT PROGRAM
3    C       FOR MANUAL POSITIONING OF ANY 'OBJECTS'
4    C       (WORK STATION,DEPARTMENTS,BAYS,HALLS IN PLOT ETC.)
5    C       USING 'LARGEST VOLUMES' ONLY
6    C
7    C
8            REAL X,Y,Z,P,XPOS,ZPOS,ANGLE
9            INTEGER NWS
10           COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
11          &FNAME
12           CHARACTER*12 FNAME(77)
13           DATA X,Y,Z/231*999.0/
14           DATA XPOS,ZPOS/154*999.0/
15           DATA ANGLE/77*0.0/
16           CALL START
17           CALL WSVOL
18           CALL OPDISC('WESDIM',10)
19           FAC    =DIN('FAC    ')
20           FORX   =DIN('FORX   ')
21           FORY   =DIN('FORY   ')
22           FRAX1  =DIN('FRAX1  ')
23           FRAX2  =DIN('FRAX2  ')
24           FRAY1  =DIN('FRAY1  ')
25           FRAY2  =DIN('FRAY2  ')
26           PICPLA=DIN('PICPLA')
27           DISTNC=DIN('DISTNC')
28           ROTATN=DIN('ROTATN')
29           ELEVTN=DIN('ELEVTN')
30           ZOOM   =DIN('ZOOM   ')
31           NLX    =DIN('NLX    ')
32           NLY    =DIN('NLY    ')
33           NLZ    =DIN('NLZ    ')
34           SPACE  =DIN('SPACE  ')
35           CALL CLDISC('WESDIM',10)
36   C       CALL FACTOR(FAC)
37           CALL FORMAT(FORX,FORY)
38           CALL FRAME(FRAX1,FRAX2,FRAY1,FRAY2)
39           CALL PLANE(PICPLA)
40           CALL PEYE(0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
41           CALL MESH(NLX,NLY,NLZ,SPACE)
42           CALL NCLOSE
43           CALL OPDISC('WSVOLD',10)
44           NWS=1
45   5       READ(10,10,END=20)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
46   10      FORMAT(I5,3F6.2,A12)
47           NWS=NWS+1
48           GOTO 5
49   20      CALL CLDISC('WSVOLD',10)
50           NWS=NWS-1
51           CALL PRESIT(NWS)
52           CALL JOYST(NWS,PICPLA,DISTNC)
53           CALL FINISH
54           STOP
55           END
56   C...
57           SUBROUTINE WSVOL
58           INTEGER ANS,NWS
59           COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
60          &FNAME
```

```
61              INTEGER SELECT,DESEL, ALPHA,GRAPH1
62              CHARACTER*12 FNAME(77)
63              DATA SELECT/"40033/
64              DATA DESEL/"40433/
65              DATA ALPHA/"30/
66              DATA GRAPH1/"35/
67      C
68      C       OUTPUT OF CURRENT DATA FILE
69      C
70              WRITE(6,10)ALPHA
71      10      FORMAT('+',A2,$)
72              WRITE(6,10)SELECT
73              WRITE(6,20)
74      20      FORMAT(' File of existing Work Station Module volumes')
75              CALL OPDISC('WSVOLD',10)
76      30      CONTINUE
77              READ(10,40,END=60)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
78      40      FORMAT(I5,3F8.2,A12)
79              WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
80      50      FORMAT(I5,3F8.2,1X,A12)
81      C       PLEASE NOTE ABOVE WAS THE EXTRA SPACE '1X'DELETED
82              GOTO 30
83      60      CONTINUE
84              CALL CLDISC('WSVOLD',10)
85      C
86      C       EXTEND FILE?
87      C
88              WRITE(6,70)
89      70      FORMAT(' Do you wish to extend/update the existing file-YE or NO')
90              WRITE(6,10)DESEL
91              WRITE(6,10)GRAPH1
92      80      READ(5,85)ANS
93      85      FORMAT(A2)
94              IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 150
95              IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 100
96              WRITE(6,90)
97      90      FORMAT(' Please enter your response again')
98              GOTO 80
99      100     CONTINUE
100             WRITE(6,110)
101     110     FORMAT(' PLEASE ENTER WS No.,X,Y,Z,DIM OF WS AND TAG No OF WS...
102            &TO END EXTENDING TYPE 77')
103     120     CONTINUE
104             READ(5,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
105             IF(J.NE.77)GOTO 100
106     C
107     C       OUTPUT LATEST DATA TO DISC AND TERMINAL
108     C
109             WRITE(6,10)ALPHA
110             WRITE(6,10)SELECT
111             WRITE(6,20)
112             CALL OPDISC('WSVOLD',10)
113     130     CONTINUE
114             DO 140 J=1,76
115             IF (X(J).EQ.999.0.AND.Y(J).EQ.999.0)GOTO 140
116             WRITE(10,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
117             WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
118     140     CONTINUE
119             CALL CLDISC('WSVOLD',10)
120             WRITE(6,10)DESEL
```

```
121         WRITE(6,10)GRAPHI
122   150   CONTINUE
123         RETURN
124         END
125   C...
126   C...
127         SUBROUTINE MESH(NLX,NLY,NLZ,SPACE)
128         REAL A(1000)
129         CALL GRID3D(A,NLX,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,SPACE,.0,.0)
130         CALL DRAWIT(A)
131         CALL GRID3D(A,NLY,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,SPACE,.0)
132         CALL DRAWIT(A)
133         CALL GRID3D(A,NLZ,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,.0,.0,SPACE)
134         CALL DRAWIT(A)
135         CALL GRID3D(A,NLY,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,.0,SPACE,.0)
136         CALL DRAWIT(A)
137         CALL GRID3D(A,NLX,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,SPACE,.0,.0)
138         CALL DRAWIT(A)
139         CALL GRID3D(A,NLZ,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,.0,SPACE)
140         CALL DRAWIT(A)
141         RETURN
142         END
143   C...
144   C     THIS IS A SUBROUTINE FOR SHOWING THE PRESENT SITUATION
145
146         SUBROUTINE PRESIT(NWS)
147         REAL P(500),F(2000),G(2000),T(2000),U(2000)
148         INTEGER NWS
149         COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
150        &FNAME
151         INTEGER SELECT,DESEL, ALPHA,GRAPHI
152         CHARACTER*12 FNAME(77)
153         DATA SELECT/"40033/
154         DATA DESEL/"40433/
155         DATA ALPHA/"30/
156         DATA GRAPHI/"35/
157   C     PRINTING THE PRESENT SITUATION OF LAYOUT DEVELOPMENT
158         WRITE(6,10)
159   10    FORMAT(" LAYOUT-the existing situation of development")
160         CALL BELL
161         CALL OPDISC("MESDIM",10)
162         NLX    =DIM("NLX   ")
163         NLY    =DIM("NLY   ")
164         NLZ    =DIM("NLZ   ")
165         SPACE =DIM("SPACE ")
166         CALL CLDISC("MESDIM",10)
167         CALL MESH(NLX,NLY,NLZ,SPACE)
168         CALL OPDISC("WSPOSD",11)
169         DO 80 K=1,76
170   50    READ(11,60,END=70)J,XPOS(J),ZPOS(J),ANGLE(J),FNAME(J)(1:12)
171   60    FORMAT(I5,3F10.2,A12)
172         CALL BOX(P,X(J),Y(J),Z(J))
173         XWORK = XPOS(J)
174         ZWORK = ZPOS(J)
175         CALL TURN3D(P,ANGLE(J),0.0,0.0,0.0,2,R)
176         CALL HERSH(FNAME(J)(1:12),6,2,60.0,Q)
177         CALL TRANSP(Q,T)
178         CALL TURN3D(T,270.0,0.0,0.0,0.0,1,U)
179         CALL JOIN(R,U)
180         CALL DRAW3D(U,1.0,XWORK,0.0,ZWORK,1)
```

```
181    80    CONTINUE
182    70    CALL CLDISC('*SPOSD',11)
183          RETURN
184          END
185    C
186    C     'JOTST' SUBROUTINE IS FOR MANIPULATION OF ANY
187    C     'OBJECT' USING ORDER 'N' (GOT VIA TAG NOS.!)
188    C
189
190    C...
191          SUBROUTINE JOTST(NWS,PICPLA,DISTNC)
192          REAL P(500),R(2000),U(2000),T(2000),U(2000)
193          INTEGER NWS
194          COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
195         &FRAME
196          INTEGER SELECT,DESEL, ALPHA,GRAPHI
197          CHARACTER*12 FRAME(77)
198          DATA SELECT/"40033/
199          DATA DESEL/"40433/
200          DATA ALPHA/"30/
201          DATA GRAPHI/"35/
202
203    C     CHANGE OF LAYOUT IS CONSIDERED
204          WRITE(6,85)ALPHA
205    85    FORMAT('+',A2,$)
206          WRITE(6,85)SELECT
207          WRITE(6,90)
208    90    FORMAT(' Do you wish to develope the layout-YE or NO')
209          WRITE(6,85)DESEL
210          WRITE(6,85)GRAPHI
211    100   READ(5,110)ANS
212    110   FORMAT(A2)
213          IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 250
214          IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 150
215    120   FORMAT(' Please enter your response again')
216    150   CONTINUE
217    160   CALL BELL
218          CALL PLIT(3.0,-5.0,3)
219          WRITE(6,170)
220    170   FORMAT(' which workstation?')
221          READ(5,*)N
222          IF(N.EQ.0)GOTO 190
223          CALL BOX(P,X(N),Y(N),Z(N))
224          CALL SCREEN(ICHAR,X1,Y1)
225          CALL SCREEN(ICHAR,X2,Y2)
226          CALL NEWPAG
227          CALL BELL
228          CALL OPDISC('MESDIM',10)
229          NLX  =DIM('NLX   ')
230          NLY  =DIM('NLY   ')
231          NLZ  =DIM('NLZ   ')
232          SPACE =DIM('SPACE ')
233          CALL CLDISC('MESDIM',10)
234          CALL MESH(NLX,NLY,NLZ,SPACE)
235          ANGLE(N) = ATAN2(Y2-Y1,X2-X1)*180.0/3.14159265
236          XPOS(N) = Y1*DISTNC/PICPLA
237          ZPOS(N) = X1*DISTNC/PICPLA
238          DO 180 K = 1,76
239          CALL BOX(P,X(K),Y(K),Z(K))
240          XWORK = XPOS(K)
```

```
241          ZWORK = ZPOS(K)
242          IF(XWORK.EQ.999.0.AND.ZWORK.EQ.999.0)GOTO 180
243          CALL TURN3D(P,ANGLE(K),0.0,0.0,2,R)
244          CALL HERSH(FNAME(K)(1:12),6,2,60.0,0)
245          CALL TRANSP(U,T)
246          CALL TURN3D(T,270.0,0.0,0.0,1,U)
247          CALL JOIN(R,U)
248          CALL DRAW3D(U,1.0,XWORK,0.0,ZWORK,1)
249    180   CONTINUE
250          GOTO 160
251    190   CONTINUE
252          CALL OPDISC('WSPOSD',11)
253          DO 200 K = 1,76
254          IF(XPOS(K).EQ.999.0.AND.ZPOS(K).EQ.999.0)GOTO 200
255          WRITE(10,210)K,XPOS(K),ZPOS(K),ANGLE(K),FNAME(K)(1:12)
256    210   FORMAT(I5,3F10.2,A12)
257    200   CONTINUE
258          CALL CLDISC('WSPOSD',11)
259    250   RETURN
260          END
261    C...
262    C....
263    C     FILE UNDER 'ITTVAX00.FOR'
264    C
```

```
2222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222
222222222222222222222222222222222  MIODLESEX POLYTECHNIC VAXB 11/785  2222222222222222222222222222
222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222

          BBBBBBBB      OOOOOC   BBBBBBBB        11
          BBBBBBBB      OOOOOC   BBBBBBBB        11
          BB    BB   OO      CO  BB    BB      1111
          BB    BB   OO      CO  BB    BB      1111
          BB    BB   OO      CO  BB    BB        11
          BB    BB   OO      OO  BB    BB        11
          BBBBBBBB   OO      CO  BBBBBBBB        11
          BBBBBBBB   OO      CO  BBBBBBBB        11
          BB    BB   OO      CO  BB    BB        11
          BB    BB   OO      OO  BB    BB        11
          BB    BB   OO      CO  BB    BB        11
          BB    BB   OO      CO  BB    BB        11
          BBBBBBBB      OOOCOC   BBBBBBBB      111111
          BBBBBBBB      OOOOOC   BBBBBBBB      111111


  III   Y   Y   TTTTT  W    W   SSSS  FFFFF   III   L       EEEEE
   I    Y   Y     T    W    W   S     F        I    L       E
   I     Y Y      T    W    W   S     F        I    L       E
   I      Y       T    W    W    SSS  FFFF     I    L       EEEE
   I      Y       T    W  W  W     S  F        I    L       E
   I      Y       T    WW   WW     S  F        I    L       E
  III     Y       T    W    W   SSSS  F       III   LLLLL   EEEEE
```

```
           J    OOO   BBBB          1     1      666    4   4
           J   O   O  B   B        11    11     6       4   4
           J   O   O  B   B         1     1     6       4   4
           J   O   O  BBBB          1     1     6666   44444
      J    J   O   O  B   B         1     1     6   6      4
      J    J   O   O  B   B         1     1     6   6      4
       JJJ    OOO    BBBB         111   111     666        4
```

.1164) queued to SYSSPRINT on 9-NOV-1987 12:14 by user BOB1, UIC [RESM0012,BOB1], under account ;
; printer _LPA0: on 9-NOV-1987 12:19 from queue LPA0.

```
:2222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222.
:22222222222222222222222  Digital Equipment Corporation - VAX/VMS Version V4.5  2222222222222222:
:2222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222222.
```

```
 1  C       PROGRAM INTERACTIVE LAYOUT (IYTWSFILE)
 2  C       INCORPORATING WORK STATION DETAILS (WSFILE)
 3  C       READING FROM FILES 'WSNAME'
 3  C       DETAILED WORK STATIONS ARE RECALLED VIA
 3  C       ORDER NOS 'N' ONLY ! (NOT VIA TAG NOS. !)
 3  C
 3  C
 4          REAL X,Y,Z,P,XPOS,ZPOS,ANGLE
 5          INTEGER NWS
 6          COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
 7         &FNAME
 8          CHARACTER*12 WSNAME
 9          CHARACTER*12 FNAME(77)
10          DATA X,Y,Z/231*999.0/
11          DATA XPOS,ZPOS/154*999.0/
12          DATA ANGLE/77*0.0/
13          CALL START
14          CALL WSVOL
15          CALL OPDISC('MESDIM',10)
16          FAC   =DIN('FAC   ')
17          FORX  =DIN('FORX  ')
18          FORY  =DIN('FORY  ')
19          FRAX1 =DIN('FRAX1 ')
20          FRAX2 =DIN('FRAX2 ')
21          FRAY1 =DIN('FRAY1 ')
22          FRAY2 =DIN('FRAY2 ')
23          PICPLA=DIN('PICPLA')
24          DISTNC=DIN('DISTNC')
25          ROTATN=DIN('ROTATN')
26          ELEVTN=DIN('ELEVTN')
27          ZOOM  =DIN('ZOOM  ')
28          NLX   =DIN('NLX   ')
29          NLY   =DIN('NLY   ')
30          NLZ   =DIN('NLZ   ')
31          SPACE =DIN('SPACE ')
32          CALL CLDISC('MESDIM',10)
33          CALL FACTOR(FAC)
34          CALL FORMAT(FORX,FORY)
35          CALL FRAME(FRAX1,FRAX2,FRAY1,FRAY2)
36          CALL PLANE(PICPLA)
37          CALL PEYE(0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
38          CALL MESH(NLX,NLY,NLZ,SPACE)
39          CALL NCLOSE
40          CALL OPDISC('WSVOLD',10)
41          NWS=1
42  5       READ(10,10,END=20)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
43  10      FORMAT(I5,3F8.2,A12)
44          NWS=NWS+1
45          GOTO 5
46  20      CALL CLDISC('WSVOLD',10)
47          NWS=NWS-1
48          CALL PRESIT(NWS)
49          CALL JOYST(NWS,PICPLA,DISTNC)
50          CALL FINISH
51          STOP
52          END
53  C...
54          SUBROUTINE WSVOL
55          INTEGER AWS,NWS
56          COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
```

```
57              &FNAME
58              INTEGER SELECT,DESEL, ALPHA,GRAPH1
59              CHARACTER*12 FNAME(77)
60              DATA SELECT/"40033/
61              DATA DESEL/"40433/
62              DATA ALPHA/"30/
63              DATA GRAPH1/"35/
64      C
65      C       OUTPUT OF CURRENT DATA FILE
66      C
67              WRITE(6,10)ALPHA
68      10      FORMAT('+',A2,S)
69              WRITE(6,10)SELECT
70              WRITE(6,20)
71      20      FORMAT(/// ' File of existing work Station Module volumes'//)
72              WRITE (6,35)' Item','Dim X','Dim Y','Dim Y','Tag No'
73      35      FORMAT (A5,3A8,A7/)
74              CALL OPDISC('WSVOLD',10)
75      30      CONTINUE
76              READ(10,40,END=60)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
77      40      FORMAT(I5,3F8.2,A12)
78              WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
79      50      FORMAT(I5,3F8.2,1X,A12)
80      C       PLEASE NOTE ABOVE WAS THE EXTRA SPACE '1X'DELETED
81              GOTO 30
82      60      CONTINUE
83              CALL CLDISC('WSVOLD',10)
84      C
85      C       EXTEND FILE?
86      C
87              WRITE(6,70)
88      70      FORMAT( / ' Do you wish to extend/update the  file-YE or NO'/)
89              WRITE(6,10)DESEL
90              WRITE(6,10)GRAPH1
91      80      READ(5,85)ANS
92      85      FORMAT(A2)
93              IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 150
94              IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 100
95      C
96      C       ERROR MESSAGE
97      C
98              WRITE(6,90)
99      90      FORMAT(' Please enter your response again ! use CAPITALS !')
100             GOTO 80
101     100     CONTINUE
102     C
103     C       NEW ENTRY IS WRITTEN
104     C
105             WRITE(6,110)
106     110     FORMAT(' Please enter Item No. Dim of W.S. X,Y,Z, and TAG No
107          &...TO END EXTENDING TYPE 77')
108     120     CONTINUE
109             READ(5,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
110             IF(J.GE.77)GOTO 100
111     C
112     C       OUTPUT LATEST DATA TO DISC AND TERMINAL
113     C
114             WRITE(6,10)ALPHA
115             WRITE(6,10)SELECT
116             WRITE(6,20)
```

```
117          CALL UPDISC('WSVOLD',10)
118    130   CONTINUE
119          DO 140 J=1,76
120          IF (X(J).EQ.999.0.AND.Y(J).EQ.999.0)GOTO 140
121          WRITE(10,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
122          WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
123    140   CONTINUE
124          CALL CLDISC('WSVOLD',10)
125          WRITE(6,10)DESEL
126          WRITE(6,10)GRAPH1
127    150   CONTINUE
128          RETURN
129          END
130    C...
131    C...
132          SUBROUTINE MESH(NLX,NLY,NLZ,SPACE)
133          REAL A(1000)
134          CALL GRID3D(A,NLX,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,SPACE,.0,.0)
135          CALL DRAWIT(A)
136          CALL GRID3D(A,NLY,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,SPACE,.0)
137          CALL DRAWIT(A)
138          CALL GRID3D(A,NLZ,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,.0,.0,SPACE)
139          CALL DRAWIT(A)
140          CALL GRID3D(A,NLY,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,.0,SPACE,.0)
141          CALL DRAWIT(A)
142          CALL GRID3D(A,NLX,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,SPACE,.0,.0)
143          CALL DRAWIT(A)
144          CALL GRID3D(A,NLZ,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,.0,SPACE)
145          CALL DRAWIT(A)
146          RETURN
147          END
148    C...
149    C     THIS IS A SUBROUTINE FOR SHOWING THE PRESENT SITUATION
150
151          SUBROUTINE PRESIT(NWS)
152          REAL P(500),R(2000),Q(2000),T(2000),U(2000),V(7000)
153          INTEGER NWS
154          COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
155         &FNAME
156          INTEGER SELECT,DESEL, ALPHA,GRAPH1
157          CHARACTER*12 FNAME(77)
158          CHARACTER*12 WSNAME
159          DATA SELECT/"40033/
160          DATA DESEL/"40433/
161          DATA ALPHA/"30/
162          DATA GRAPH1/"35/
163    C
164    C     PRINTING THE PRESENT SITUATION OF LAYOUT DEVELOPMENT
165    C
166          WRITE (6,5)ALPHA
167    5     FORMAT('+',A2,$)
168          WRITE (6,5)SELECT
169          WRITE(6,10)
170    10    FORMAT(' LAYOUT-the existing situation of development'/////)
171          WRITE (6,5)DESEL
172          WRITE (6,5)GRAPH1
173          CALL BELL
174          CALL UPDISC('MESDIM',10)
175          NLX   =DIM('NLX   ')
176          NLY   =DIM('NLY   ')
```

```
177              NLZ   =DIN('NLZ   ')
178              SPACE =DIN('SPACE ')
179              CALL CLDISC('MESDIM',10)
180              CALL MESH(NLX,NLY,NLZ,SPACE)
181              CALL OPDISC('WSPOSD',11)
182              DO 80 K=1,76
183              READ(11,60,END=70)J,XPOS(J),ZPOS(J),ANGLE(J),FNAME(J)(1:12)
184        60    FORMAT(I5,3F10.2,A12)
185              CALL BOX(P,X(J),Y(J),Z(J))
186              XWORK = XPOS(J)
187              ZWORK = ZPOS(J)
188              IF(XWORK.EQ.999.0.AND.ZWORK.EQ.999.0)GOTO 80
189              CALL TURN3D(P,ANGLE(J),0.0,0.0,2,R)
190              WSNAME=FNAME(J)
191              CALL HERSH(FNAME(J)(1:12),6,2,60.0,Q)
192              CALL TRANSP(Q,T)
193              CALL TURN3D(T,270.0,0.0,0.0,1,U)
194              CALL JOIN(R,U)
195        C
196        C     DETAIL SHAPE OF THE WORK STATION IS RETRIEVED
197        C     FROM A DISK
198        C
199              CALL IN3D(V,WSNAME)
200              CALL JOIN(U,V)
201              CALL DRAW3D(V,1.0,XWORK,0.0,ZWORK,1)
202        80    CONTINUE
203        70    CALL CLDISC('WSPOSD',11)
204              RETURN
205              END
206        C...
207
208        C...
209              SUBROUTINE JOIST(NWS,FICFLA,DISTNC)
210              REAL P(500),R(2000),Q(2000),T(2000),U(2000),V(7000)
211              INTEGER ANS, NWS
212              COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
213             &FNAME
214              INTEGER SELECT,DESEL, ALPHA,GRAPHI
215              CHARACTER*12 FNAME(77)
216              CHARACTER*12 WSNAME
217              DATA SELECT/"40033/
218              DATA DESEL/"40433/
219              DATA ALPHA/"30/
220              DATA GRAPHI/"35/
221
222        C     CHANGE OF LAYOUT IS CONSIDERED
223              WRITE(6,85)ALPHA
224        85    FORMAT('+',A2,S)
225              WRITE(6,85)SELECT
226              WRITE(6,90)
227        90    FORMAT(' Do you wish to develope the layout-YE or NO')
228              WRITE(6,85)DESEL
229              WRITE(6,85)GRAPHI
230        100   READ(5,110)ANS
231        110   FORMAT(A2)
232              IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 250
233              IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 150
234        120   FORMAT(' Please enter your response again')
235        150   CONTINUE
236        160   CALL BELL
```

```
237              CALL PLIT(3.0,-5.0,3)
238              WRITE(6,170)
239     170      FORMAT(" which workstation?")
240              READ(5,*)N
241              IF(N.EQ.0)GOTO 190
242              CALL BOX(P,X(N),Y(N),Z(N))
243              CALL SCREEN(ICHAR,X1,Y1)
244              CALL SCREEN(ICHAR,X2,Y2)
245              CALL NEWPAG
246              CALL BELL
247              CALL OPDISC("MESDIM",10)
248              NLX  =DIN("NLX   ")
249              NLY  =DIN("NLY   ")
250              NLZ  =DIN("NLZ   ")
251              SPACE =DIN("SPACE ")
252              CALL CLDISC("MESDIM",10)
253              CALL MESH(NLX,NLY,NLZ,SPACE)
254              ANGLE(N) = ATAN2(Y2-Y1,X2-X1)*180.0/3.14159265
255              XPOS(N) = Y1*DISTNC/PICPLA
256              ZPOS(N) = X1*DISTNC/PICPLA
257              DO 180 K = 1,76
258              CALL BOX(P,X(K),Y(K),Z(K))
259              XWORK = XPOS(K)
260              ZWORK = ZPOS(K)
261              IF(XWORK.EQ.999.0.AND.ZWORK.EQ.999.0)GOTO 180
262              CALL TURN3D(P,ANGLE(K),0.0,0.0,2,R)
263              WSNAME=FNAME(K)
264              CALL HERSH(FNAME(K)(1:12),6,2,60.0,C)
265              CALL TRANSP(C,T)
266              CALL TURN3D(T,270.0,0.0,0.0,1,U)
267              CALL JOIN(R,U)
268     C
269     C        DETAIL SHAPE OF THE WORK STATION IS RETRIEVED
270     C        FROM A DISK
271     C
272              CALL IN3D(V,WSNAME)
273              CALL JOIN(U,V)
274              CALL DRAW3D(V,1.0,XWORK,0.0,ZWORK,1)
275     180      CONTINUE
276              GOTO 160
277     190      CONTINUE
278              CALL OPDISC("WSPOSD",10)
279              DO 200 K = 1,76
280              IF(XPOS(K).EQ.999.0.AND.ZPOS(K).EQ.999.0)GOTO 200
281              WRITE(10,210)K,XPOS(K),ZPOS(K),ANGLE(K),FNAME(K)(1:12)
282     210      FORMAT(I5,3F10.2,A12)
283     200      CONTINUE
284              CALL CLDISC("WSPOSD",10)
285     250      RETURN
286              END
287     C...
288     C....
289     C        FILE UNDER "IYTWSFILE"
```

28.

```
333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333
33333333333333333333333333333333   MIDDLESEX POLYTECHNIC VAXB 11/785   333333333333333333333333333333
333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333

                BBBBBBBB      000000    BBBBBBBB          11
                BBBBBBBB      000000    BBBBBBBB          11
                BB    BB  00      00  BB      BB        1111
                BB    BB  00      00  BB      BB        1111
                BB    BB  00      00  BB      BB          11
                BB    BB  00      00  BB      BB          11
                BBBBBBBB  00      00  BBBBBBBB            11
                BBBBBBBB  00      00  BBBBBBBB            11
                BB    BB  00      00  BB      BB          11
                BB    BB  00      00  BB      BB          11
                BB    BB  00      00  BB      BB          11
                BB    BB  00      00  BB      BB          11
                BBBBBBBB    000000    BBBBBBBB        111111
                BBBBBBBB    000000    BBBBBBBB        111111

        PPPP   000   SSSS   CCCC  L       AAA    SSSS  H   H   55555
        P   P  0   0  S      C    L      A   A  S      H   H   5
        P   P  0   0  S      C    L      A   A  S      H   H   555
        PPPP   0   0   SSS   C    L      A   A   SSS   HHHHH      5
        P      0   0      S  C    L     AAAAA       S  H   H  5   S
        P      0   0      S  C    L      A   A      S  H   H  5   S
        P       000   SSSS   CCCC LLLLL  A   A  SSSS   H   H   555
```

```
        J   000   BBBB        1      1     666    55555
        J  0   0  B   B      11     11     6      5
        J  0   0  B   B       1      1     6      555
        J  0   0  BBBB        1      1     6666      5
     J  J  0   0  B   B       1      1     6   6       S
     J  J  0   0  B   B       1      1     6   6   5   S
      JJJ   000   BBBB       111    111    666     555
```

```
33333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333
33333333333333333333333333   Digital Equipment Corporation - VAX/VMS Version V4.5   333333333333333333
3333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333333
```

```
 1   C        "POSCLASH5.FOR" PROGRAM IS AN INTRACTIVE PROGRAM
 2   C        FOR AUTOMATIC POSITIONING OF A LINE OR A GROUP OF
 3   C        WORK STATION WITHIN BUILDING (CIVIL ENG.SPACE)
 4   C        INCLUDING COLLISION COURSE FINDING WITH
 5   C        OBJECTS (WALLS,COLUMNS ETC) WITHIN BUILDING
 6   C        AND FACILITY TO ENTER READY BUILT LAYOUT AT ANY WORK STATION
 7   C        FOR RE-LAYOUT VIA JOYSTICK AND AUTOMATIC
 8   C
 9   C
10   C
11   C
12   C        THE "MFEED" PROGRAM RESULTS (OR DR.C. SYSTEM) ARE INTRODUCED
13   C        AND W.S. IN AN PRODUCTION LINE ORDER VIA "WSVTGIC"
14   C        DISC WSVTOR.DAT ARE ENTERED
15   C
16   C
17   C
18   C        GENERALLY: I AM SOLVING A TASK OF AUTOMATIC POSITIONING
19   C        OF GROUP OF WORK STATION (MAX. NUMBER OF W.S. IS 77!).
20   C
21   C
22   C...
23   C        PROGRAM INTERACTIVE LAYOUT (INTLAY)
24            INTEGER NWS
25            COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
26           &FNAME(77)
27            CHARACTER*12 FNAME
28            CHARACTER*12 WSNAME
29
30            INTEGER SELECT,DESEL, ALPHA,GRAPH1
31            DATA X,Y,Z/231*999.0/
32            DATA XPOS,ZPOS/154*999.0/
33            DATA ANGLE/77*0.0/
34            DATA SELECT/"40033/
35            DATA DESEL/"40433/
36            DATA ALPHA/"30/
37            DATA GRAPH1/"35/
38            CALL START
39            CALL WSVOL
40            CALL OPDISC('MESDIM',10)
41            FAC   =DIM('FAC   ')
42            FORX  =DIM('FORX  ')
43            FORY  =DIM('FORY  ')
44            FRAX1 =DIM('FRAX1 ')
45            FRAX2 =DIM('FRAX2 ')
46            FRAY1 =DIM('FRAY1 ')
47            FRAY2 =DIM('FRAY2 ')
48            PICPLA=DIM('PICPLA')
49            DISTNC=DIM('DISTNC')
50            ROTATN=DIM('ROTATN')
51            ELEVTN=DIM('ELEVTN')
52            ZOOM  =DIM('ZOOM  ')
53            NLX   =DIM('NLX   ')
54            NLY   =DIM('NLY   ')
55            NLZ   =DIM('NLZ   ')
56            SPACE =DIM('SPACE ')
57            CALL CLDISC('MESDIM',10)
58   C        CALL FACTOR(FAC)
59            CALL FORMAT(FORX,FORY)
60            CALL FRAME(FRAX1,FRAX2,FRAY1,FRAY2)
```

```
61            CALL PLANE(PICPLA)
62            CALL PEYE(0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
63            CALL MESH(NLX,NLY,NLZ,SPACE)
64            CALL OPDISC('WSVOLD',10)
65            NWS=1
66      5     READ(10,10,END=20)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
67      10    FORMAT(I5,3F6.2,A12)
68            NWS=NWS+1
69            GOTO 5
70      20    CALL CLDISC('WSVOLD',10)
71            NWS=NWS-1
72            CALL PRESIT (NWS)
73      40    CONTINUE
74            WRITE(6,50)ALPHA
75      50    FORMAT('+',A2,$)
76            WRITE(6,50)SELECT
77            WRITE(6,70)
78      70    FORMAT(' Do you want to continue/change the layout...
79            &YE or NO ? ')
80            WRITE(6,50)DESEL
81            WRITE(6,50)GRAPH1
82            READ(5,85)ANS
83      85    FORMAT(A2)
84            IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 2900
85            IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 100
86            WRITE(6,50)ALPHA
87            WRITE(6,50)SELECT
88            WRITE(6,90)
89      90    FORMAT(' Please enter your response again - use CAPITALS')
90            WRITE(6,50)DESEL
91            WRITE(6,50)GRAPH1
92            GOTO 40
93      100   CONTINUE
94      C
95            CALL POSIT(PICPLA,DISTNC)
96      2900  CONTINUE
97            CALL RCLOSE
98            CALL FINISH
99            STOP
100           END
101     C
102     C     THIS IS THE END OF MAIN POSCOL2.FOR PROGRAM
103     C
104
105     C...
106           SUBROUTINE WSVOL
107           INTEGER ANS,NWS
108           COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
109           &FNAME(77)
110           INTEGER SELECT,DESEL, ALPHA,GRAPH1
111           CHARACTER*12 FNAME
112           DATA SELECT/"40033/
113           DATA DESEL/"40433/
114           DATA ALPHA/"30/
115           DATA GRAPH1/"35/
116     C
117     C     OUTPUT OF CURRENT DATA FILE
118     C
119           WRITE(6,10)ALPHA
120     10    FORMAT('+',A2,$)
```

```
121          WRITE(6,10)SELECT
122          WRITE(6,20)
123     20   FORMAT(" File of existing Work Station Module volumes")
124          CALL UPDISC("WSVOLD",10)
125     30   CONTINUE
126          READ(10,40,END=60)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
127     40   FORMAT(I5,3F6.2,A12)
128     C    WRITE(6,10)ALPHA
129     C    WRITE(6,10)SELECT
130          WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
131     50   FORMAT(I5,3F6.2,1X,A12)
132     C    WRITE(6,10)DESEL
133     C    WRITE(6,10)GRAPHI
134     C    PLEASE NOTE ABOVE WAS THE EXTRA SPACE "1X"DELETED
135          GOTO 30
136     60   CONTINUE
137          CALL CLDISC("WSVOLD",10)
138     C
139     C    EXTEND FILE?
140     C
141     C    CALL BELL
142     C    WRITE(6,10)ALPHA
143     C    WRITE(6,10)SELECT
144          WRITE(6,70)
145     70   FORMAT(" Do you wish to extend/update the existing file...
146          &YE or NO")
147          WRITE(6,10)DESEL
148          WRITE(6,10)GRAPHI
149     80   READ(5,85)ANS
150     85   FORMAT(A2)
151          IF(ANS.EQ."NO".OR.ANS.EQ."N")GOTO 150
152          IF(ANS.EQ."YE".OR.ANS.EQ."Y")GOTO 100
153     C    WRITE(6,10)ALPHA
154     C    WRITE(6,10)SELECT
155          WRITE(6,90)
156     90   FORMAT(" Please enter your response again")
157     C    WRITE(6,10)DESEL
158     C    WRITE(6,10)GRAPHI
159          GOTO 80
160     100  CONTINUE
161          WRITE(6,110)
162     110  FORMAT(" PLEASE ENTER WS No.,X,Y,Z,DIM OF WS AND TAG No OF WS...
163          &TO END EXTENDING TYPE 77")
164     120  CONTINUE
165          READ(5,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
166          IF(J.NE.77)GOTO 100
167     C
168     C    OUTPUT LATEST DATA TO DISC AND TERMINAL
169     C
170          WRITE(6,10)ALPHA
171          WRITE(6,10)SELECT
172          WRITE(6,20)
173          CALL UPDISC("WSVOLD",10)
174     130  CONTINUE
175          DO 140 J=1,76
176          IF (X(J).EQ.999.0.AND.Y(J).EQ.999.0)GOTO 140
177          WRITE(10,40)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
178          WRITE(6,50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
179     140  CONTINUE
180          CALL CLDISC("WSVOLD",10)
```

```
181          WRITE(6,10)DESEL
182          WRITE(6,10)GRAPHI
183    150   CONTINUE
184          RETURN
185          END
186    C...
187          SUBROUTINE MESH(NLX,NLY,NLZ,SPACE)
188          REAL A(1000)
189          CALL GRIL3D(A,NLX,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,SPACE,.0,.0)
190          CALL DRAWIT(A)
191          CALL GRIL3D(A,NLY,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,SPACE,.0)
192          CALL DRAWIT(A)
193          CALL GRIL3D(A,NLZ,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,.0,.0,SPACE)
194          CALL DRAWIT(A)
195          CALL GRIL3D(A,NLY,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,.0,SPACE,.0)
196          CALL DRAWIT(A)
197          CALL GRIL3D(A,NLX,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,SPACE,.0,.0)
198          CALL DRAWIT(A)
199          CALL GRIL3D(A,NLZ,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,.0,SPACE)
200          CALL DRAWIT(A)
201          RETURN
202          END
203
204    C...
205          SUBROUTINE PRESIT (NWS)
206    C
207    C     THIS IS A SUBROUTINE FOR SHOWING THE PRESENT SITUATION
208    C
209          REAL P(500),R(2000),W(2000),T(2000),U(2000)
210          REAL CESPAC(10000)
211          INTEGER NWS
212          COMMON/UCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
213         &FRAME(77)
214          INTEGER SELECT,DESEL, ALPHA,GRAPHI
215          CHARACTER*12 FRAME
216          DATA SELECT/"40033/
217          DATA DESEL/"40433/
218          DATA ALPHA/"30/
219          DATA GRAPHI/"35/
220    C     PRINTING THE PRESENT SITUATION OF LAYOUT DEVELOPMENT
221          WRITE(6,10)ALPHA
222    10    FORMAT("+",A2,$)
223          WRITE(6,10)SELECT
224          WRITE(6,20)
225    20    FORMAT(" LAYOUT...The existing situation of development")
226          WRITE(6,10)DESEL
227          WRITE(6,10)GRAPHI
228          CALL BELL
229          CALL OPDISC("MESDIM",10)
230          NLX   =DIN("NLX   ")
231          NLY   =DIN("NLY   ")
232          NLZ   =DIN("NLZ   ")
233          SPACE =DIN("SPACE ")
234          CALL CLDISC("MESDIM",10)
235          CALL MESH(NLX,NLY,NLZ,SPACE)
236    C
237    C     BUILDING IS CALLED IN
238    C
239          CALL IN3D (CESPAC,"CIVILD")
240          CALL DRAWIT (CESPAC)
```

```
241            CALL UPDISC("WSVTOR",12)
242      40    READ(12,60,END=50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
243            CALL UPDISC("WSPOSA",11)
244      50    READ(11,60,END=90)J,XPOS(J),ZPOS(J),ANGLE(J),FNAME(J)(1:12)
245      60    FORMAT(I5,3F8.2,A12)
246            CALL BOX(P,X(J),Y(J),Z(J))
247            XWORK = XPOS(J)
248            ZWORK = ZPOS(J)
249            CALL HERSH(FNAME(J)(1:12),6,2,60.0,G)
250            CALL TRANSP(G,T)
251            CALL TURN3D(T,270.0,0.0,0.0,1,U)
252            CALL JOIN(P,U)
253            CALL TURN3D(U,ANGLE(J),0.0,0.0,2,R)
254            CALL SHIFT3 (R,XWORK,0.0,ZWORK)
255            CALL DRAWIT (R)
256      C     CALL DRAW3D(U,1.0,XWORK,0.0,ZWORK,1)
257            GOTO 40
258      90    CONTINUE
259            CALL CLDISC("WSPOSA",11)
260            CALL CLDISC("WSVTOR",12)
261
262
263            RETURN
264            END
265      C...
266      C...
267            SUBROUTINE POSIT(PICPLA,DISTNC)
268      C
269      C     THIS IS A SUBROUTINE FOR ENTIRE POSITIONING OF W.S.
270      C     INCLUDING SUBROUTINE JOY2 (FOR MANUAL POSITION OF ONE W.S.)
271      C     SUBROUTINE JOUST (FOR ENTRY AT ANY SITUATION AND FOR
272      C     GROUP TECHNOLOGY LAYOUT
273      C     AND SUBROUTINE PLACE (FOR AUTOMATIC PLACING OF SELECTED
274      C     GROUP/LINE OF WORK STATIONS INTO AN OPTIMAL PLACE)
275      C
276
277            REAL X,Y,Z,XPOS,ZPOS,ANGLE,XSUM,ZSUM
278            REAL XS,ZS,AS
279            REAL JR
280            REAL P(500),R(2000),C(2000),T(7300),U(2000),G(2000),V(2000)
281            REAL W(7000),CESPAC(10000)
282            LOGICAL FOUND
283            INTEGER NWS,ANS,SUMJ,RESULT
284            COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
285           &FNAME(77)
286            INTEGER SELECT,DESEL, ALPHA,GRAPH1
287            CHARACTER*12 FNAME
288            CHARACTER*12 WSNAME
289            DATA X,Y,Z/231*999.0/
290            DATA XPOS,ZPOS/154*999.0/
291            DATA ANGLE/77*0.0/
292            DATA SELECT/"40033/
293            DATA DESEL/"40433/
294            DATA ALPHA/"30/
295            DATA GRAPH1/"35/
296      C
297      C
298      15    CONTINUE
299            WRITE(6,10)ALPHA
300      10    FORMAT("+",A2,S)
```

```
301          WRITE(6,10)SELECT
302
303          WRITE (6,20)
304    20    FORMAT (' You are now in POSITIONING MODE ')
305          WRITE (6,22)
306    22    FORMAT (' Are you starting a NEW layout,from the first W.St.
307          &in technological order?'/'...YES or NO')
308          WRITE(6,10)DESEL
309          WRITE(6,10)GRAPHI
310
311    42    CONTINUE
312
313          READ (5,43 )ANS
314    43    FORMAT (A2)
315          IF (ANS.EQ.'NO'.OR.ANS.EQ.'N') GOTO 7000
316          IF (ANS.EQ.'YE'.OR.ANS.EQ.'Y') GOTO 25
317          WRITE (6,44)
318    44    FORMAT (' Please enter your response again - use capitals')
319          GOTO 42
320    7000  CONTINUE
321          CALL JOYST (N43,PICPLA,DISTNC,L)
322          GOTO 7100
323
324
325    25    CONTINUE
326    C
327    C     WORK STATION (VOLUMES) IN A REORGANISED TECHNOLOGICAL
328    C     ORDER ARE INTRODUCED VIA DISC 'WSVTOR'.
329    C     DISC 'WSVTOR' IS FED VIA PROGRAM WSVTOTO.FOR WHICH
330    C     IS NOT AN INTEGRAL PART OF THIS PROGRAM 'POSCOL'
331    C     (COMPUTER TIME SAVING !   DURING RUN OF 'POSCOL')
332    C
333          CALL UPDISC ('WSVTOR',12)
334    C
335    C     READING IN THE 'first' WORK STATION ONLY
336    C
337          READ (12,30)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
338    30    FORMAT (I5,3F8.2,A12)
339          WRITE(6,10)ALPHA
340          WRITE(6,10)SELECT
341          WRITE (6,50)
342    50    FORMAT (' Do you wish to POSITion the considered work
343          &Station manually ... YE or NO'/)
344          WRITE(6,10)DESEL
345          WRITE(6,10)GRAPHI
346    100   READ(5,110)ANS
347    110   FORMAT(A2)
348          IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 405
349          IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 150
350          WRITE(6,10)ALPHA
351          WRITE(6,10)SELECT
352          WRITE (6,120)
353    120   FORMAT(' Please enter your response again')
354          WRITE(6,10)DESEL
355          WRITE(6,10)GRAPHI
356          GOTO 100
357    C
358    C     IF YOU SELECT 'NO' YOU ARE GOING DIRECTLY INTO
359    C     THE AUTOMATIC POSITIONING PROGRAM -SUBROUTINE 'PLACE'
360    C
```

```
361    150    CONTINUE
362    160    CALL BELL
363           WRITE (6,200)
364    200    FORMAT (' Use joystic for corrective action')
365    C
366    C      BUILDING IS CALLED IN
367    C
368           CALL IN3D (CESPAC,'CIVILD')
369           CALL DRAWIT (CESPAC)
370           CALL JOY2 (J,PICPLA,DISTNC,G,XS,ZS,AS)
371
372
373    405    CONTINUE
374           WRITE(6,10)ALPHA
375           WRITE(6,10)SELECT
376           WRITE (6,410)
377    410    FORMAT (' Do you wish to continue developing the layout...
378           &in automatic mode ... YE or NO'/)
379           WRITE(6,10)DESEL
380           WRITE(6,10)GRAPHI
381    420    READ(5,430)ANS
382    430    FORMAT(A2)
383           IF(ANS.EU.'NO'.OR.ANS.EU.'N')GOTO 700
384           IF(ANS.EU.'YE'.OR.ANS.EU.'Y')GOTO 450
385           WRITE(6,10)ALPHA
386           WRITE(6,10)SELECT
387           WRITE (6,410)
388    440    FORMAT(' Please enter your response again')
389           WRITE(6,10)DESEL
390           WRITE(6,10)GRAPHI
391           GOTO 405
392    450    CONTINUE
393
394    C
395    C      CONTINUES IN AUTOMATIC MODE
396    C
397    C
398    C      PROGRAM IS GOING TO SUBMOF DIRECTLY
399    C
400           XPOS(J) = XS
401           ZPOS(J) = ZS
402           ANGLE(J) = AS
403           GOTO 500
404    7100   CONTINUE
405           CALL OPDISC ('*SVTOR',12)
406
407    C      CALL NEWPAG
408    C
409    C      THE NEXT (CORRECT) W.S., AFTER THE SELECTED  W.S.
410    C      (OR WORK STATIONS) ARE POSITIONED
411    C      TO START WITHIN AUTOMATIC POSITIONING SYSTEM,
412    C      IS RETRIEVED
413    C
414    7110   CONTINUE
415           READ (12,30)J,X(J),Y(J),Z(J),FRAME(J)(1:12)
416           IF (J.NE.L) GOTO 7110
417           IF (J.EU.L) GOTO 7120
418    7120   CONTINUE
419           XS = XPOS(J)
420           ZS = ZPOS(J)
```

```
421              AS = ANGLE(J)
422      480     CONTINUE
423
424              CALL IN3D (CESPAC,'CIVILD')
425              CALL DRAWIT (CESPAC)
426      C
427      C       BECAUSE THE NEXT ROUND IS ADDING TO 'K'   ZS=SUMZ
428      C
429
430
431      500     CALL SUMUPZ (J,XSUM,ZSUM,XS,ZS,AS)
432              WRITE(6,10)ALPHA
433              WRITE(6,10)SELECT
434              WRITE (6,520)
435      520     FORMAT (' TOTAL VALUE OF -Z- DIMENSION IS')
436              WRITE (6,540) ZSUM
437      540     FORMAT (F10.2)
438              WRITE(6,10)DESEL
439              WRITE(6,10)GRAPH1
440
441      C
442      C       A NEW (NEXT) W.S. IS CONSIDERED
443      C
444
445
446              READ (12,30,END=700)K,X(K),Y(K),Z(K),FNAME(K)(1:12)
447
448              CALL PLACE(K,XSUM,ZSUM,AS,T)
449      C
450      C       'T' IS THE VERY LAST WORK STATION WHICH IS CLASHING
451      C       WITH BUILDING (CIVIL ENG. SPACE/ELEMENT/BOX)
452      C       OR IN COLLISION WITH ANOTHER WORK STATION
453      C
454
455              CALL  COLLCWS (T,CESPAC,RESULT)
456      C
457      C       ACTIONS WHEN CLASH OR COLLISION OCCURS
458      C
459              WRITE (6,800)
460      800     FORMAT (' RESULT')
461              WRITE (6,1000)RESULT
462      1000    FORMAT (I8)
463              IF (RESULT.EQ.2) GOTO 5000
464              IF (RESULT.EQ.3) THEN
465              GOTO 5500
466              ELSE
467              GOTO 4000
468              END IF
469
470      4000    CALL BELL
471              WRITE (6,10)ALPHA
472              WRITE (6,10)SELECT
473              WRITE (6,4100)
474      4100    FORMAT (' CLASH !!!')
475              WRITE (6,4110)FNAME(K)(1:12)
476      4110    FORMAT (2X,A12)
477
478
479              WRITE (6,10)DESEL
480              WRITE (6,10)GRAPH1
```

```
481          WRITE(6,4200)
482    4200  FORMAT (" Do you wish to see the scene of the clash")
483    4250  READ (5,4300)ANS
484    4300  FORMAT (A2)
485          IF (ANS.EQ."NO".OR.ANS.EQ."N") GOTO 6100
486          IF (ANS.EQ."YE".OR.ANS.EQ."Y") GOTO 6000
487          WRITE (6,4400)
488    4400  FORMAT (" Please enter your response again - use capitals")
489          GOTO 4250
490
491
492    5000  CONTINUE
493          WRITE (6,5200)
494    5200  FORMAT (" TOUCH ! ")
495    5500  CONTINUE
496    C     CALL DRAWIT (T)
497          CALL DRAWIT (CESPAC)
498          WRITE (6,10)ALPHA
499          WRITE (6,10)SELECT
500          WRITE (6,3100)
501    3100  FORMAT(" LAYOUT ACCEPTABLE")
502          WRITE (6,10)DESEL
503          WRITE (6,10)GRAPH1
504    C
505    C     "J" IS REPLACED BY "K"
506    C
507          J = K
508          XPOS(K) = XSUM
509          ZPOS(K) = ZSUM
510          ANGLE(K) = AS
511          ZS = ZSUM
512    5800  CONTINUE
513          GOTO 480
514    6000  CONTINUE
515          CALL NEWPAG
516          CALL DRAWIT(T)
517          CALL DRAWIT (CESPAC)
518
519    6100  CONTINUE
520          WRITE (6,10)ALPHA
521          WRITE (6,10)SELECT
522          WRITE (6,6120)
523    6120  FORMAT (" DO YOU WISH TO RE-POSIT THE CLASHING W.S. ONLY"/
524          6"...YES,NO...If NO you can reposition any No.of W.S.")
525          WRITE (6,10)DESEL
526          WRITE (6,10)GRAPH1
527    6130  READ (5,6140)ANS
528    6140  FORMAT (A2)
529          IF (ANS.EQ."NO".OR.ANS.EQ."N") GOTO 7000
530          IF (ANS.EQ."YE".OR.ANS.EQ."Y") GOTO 6200
531          WRITE (6,6150)
532    6150  FORMAT (" Please enter your response again - use capitals")
533          GOTO 6130
534    6200  CONTINUE
535    C
536    C     THE CLASHING WORK STATION WILL BE REPOSITIONED
537    C
538
539          J = K
540
```

```
541
542    6500    GOTO 150
543    700     CONTINUE
544    C
545    C       POSITION OF THE LAST WORK STATION IS RECORDED
546    C
547
548            CALL UPDISC ('WSPOSA',11)
549            DO 3300 L = 1,76
550            IF (XPOS(L).EQ.999.0.AND.ZPOS(L).EQ.999.0) GOTO 3300
551            WRITE (11,3200) L,XPOS(L),ZPOS(L),ANGLE(L),FNAME(L)(1:12)
552    3200    FORMAT (I5,3F8.2,A12)
553
554    3300    CONTINUE
555            CALL CLDISC ('WSPOSA',11)
556            CALL CLDISC ('WSVTOR',12)
557    C
558    C       FOR A NEET FINAL PRESTATION THE LEYOUT IS REDRAWN
559    C       WITH DETAILES OF WORK STATIONS RETRIEVED
560    C
561            CALL NEWPAG
562            CALL PRESIT (NWS)
563    C       CALL PRESITDET (NWS)
564
565    C
566    C       FINAL DECISSION IS MADE REGARDING CONTINUATION
567    C       OR STOPING THE PROGRAM
568    C
569            WRITE (6,10)ALPHA
570            WRITE (6,10)SELECT
571            WRITE(6,3320)
572    3320    FORMAT (' Do you wish to reorda the layout?...YES,NO..'/
573           &' If NO is typed, the session is over')
574            WRITE (6,10)DESEL
575            WRITE (6,10)GRAPHI
576    3360    READ (5,3330)ANS
577    3330    FORMAT (A2)
578            IF (ANS.EQ.'NO'.OR.ANS.EQ.'N') GOTO 3400
579            IF (ANS.EQ.'YE'.OR.ANS.EQ.'Y') GOTO 15
580            WRITE (6,3340)
581            WRITE (6,10)ALPHA
582            WRITE (6,10)SELECT
583    3340    FORMAT (' Please enter your response again - use capitals')
584            WRITE (6,10)DESEL
585            WRITE (6,10)GRAPHI
586            GOTO 3360
587
588    3400    CONTINUE
589            RETURN
590            END
591
592
593    C...
594            SUBROUTINE JOY2 (J,PICPLA,DISTNC,R,XS,ZS,AS)
595    C
596    C       SUBROUTINE "JOY2" IS A MODIFIED SUBROUTINE JOYS1
597    C       WHICH WILL ALLOWE TO POSITION ONLY ONE WORK STATION
598    C       IN TIME.
599    C       THIS IS BECAUSE OF THE 'ZPOS' DIMENSION WHICH HAS
600    C       TO BE SUMMED.
```

```
601    C
602    C
603            REAL X,Y,Z,XPOS,ZPOS,ANGLE
604            REAL P(500),R(2000),G(2000),T(2000),G(2000),V(2000)
605            REAL CESPAC(10000)
606            INTEGER NWS,ANS
607            COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
608           &FNAME(77)
609            INTEGER SELECT,DESEL, ALPHA,GRAPHI
610            CHARACTER*12 FNAME
611            CHARACTER*12 ASNAME
612            DATA X,Y,Z/231*999.0/
613            DATA XPOS,ZPOS/154*999.0/
614            DATA ANGLE/77*0.0/
615            DATA SELECT/"40033/
616            DATA DESEL/"40433/
617            DATA ALPHA/"30/
618            DATA GRAPHI/"35/
619    C
620            WRITE(6,10)ALPHA
621    10      FORMAT(' ',A2,S)
622            WRITE(6,10)SELECT
623            WRITE (6,50)
624    50      FORMAT (' You are now in the Manual ..to..Auto Mode'/)
625
626    70      CONTINUE
627    C       CHANGE OF LAYOUT IS CONSIDERED
628            WRITE(6,90)
629    90      FORMAT(' Do you wish to re-POSITion the work Station...YE or NO')
630            WRITE(6,10)DESEL
631            WRITE(6,10)GRAPHI
632    100     READ(5,110)ANS
633    110     FORMAT(A2)
634            IF(ANS.EQ.'NO'.OR.ANS.EQ.'N')GOTO 250
635            IF(ANS.EQ.'YE'.OR.ANS.EQ.'Y')GOTO 150
636            WRITE(6,10)ALPHA
637            WRITE(6,10)SELECT
638            WRITE (6,120)
639    120     FORMAT(' Please enter your response again')
640            WRITE(6,10)DESEL
641            WRITE(6,10)GRAPHI
642            GOTO 70
643    150     CONTINUE
644    153     CONTINUE
645            CONTINUE
646            WRITE(6,10)ALPHA
647            WRITE(6,10)SELECT
648            WRITE (6,155)
649    155     FORMAT (' Please POSITion the w.s. by cross-hairs...')
650            WRITE(5,10)DESEL
651            WRITE(6,10)GRAPHI
652    C
653    C       1st movement POSIT the right bottom corner..press spacer..
654    C       2nd movement POSIT/turns the w.s. around this corner..
655    C
656    C       press spacer.
657    C
658    160     CALL BELL
659    C       CALL PLIT(3.0,-5.0,3)
660    C
```

```
661   C       FIRST WORK STATION VOLUME IS FEAD AUTOMATICALLY
662   C       VIA SUBROUTINE "POSIT" (AREA LABLE 25-30)...J...N !
663   C       REANGLE(J)ON IS TO HAVE FIKST W.S. OF A GROUP OF MACHINES
664   C       READY FOR AUTOMATIC READING.
665   C
666           CALL BOX(P,X(J),Y(J),Z(J))
667           CALL SCREEN(ICHAR,X1,Y1)
668           CALL SCREEN(ICHAR,X2,Y2)
669           CALL NEWPAG
670   C       CALL BELL
671           CALL OPDISC("MESDIM",10)
672           NLX    =DIN("NLX    ")
673           NLY    =DIN("NLY    ")
674           NLZ    =DIN("NLZ    ")
675           SPACE  =DIN("SPACE ")
676           CALL CLDISC("MESDIM",10)
677           CALL MESH(NLX,NLY,NLZ,SPACE)
678           CALL IN3D (CESPAC,"CIVILD")
679           CALL DRAWIT (CESPAC)
680           AS = ATAN2(Y2-Y1,X2-X1)*180.0/3.14159265
681           XS = Y1*DISTNC/PICPLA
682           ZS = X1*DISTNC/PICPLA
683           CALL BOX(P,X(J),Y(J),Z(J))
684
685           CALL HERSH(FNAME(J)(1:12),0,2,60.0,0)
686           CALL TRANSP(0,T)
687           CALL TURN3D(T,270.0,0.0,0.0,1,G)
688           CALL JOIN(P,G)
689           WSNAME = FNAME(J)
690           CALL IN3D (V,WSNAME)
691           CALL JOIN (G,V)
692           CALL TURN3D(V,AS,0.0,0.0,2,R)
693           CALL SHIFT3(R,XS,0.0,ZS)
694           CALL DRAWIT (R)
695   C       CALL DRAW3D(V,1.0,XS,0.0,ZS,1)
696   180     CONTINUE
697           WRITE(6,10)ALPHA
698           WRITE(6,10)SELECT
699
700           WRITE (6,200)
701   200     FORMAT (" Is the POSITion of W.S. according to your wish...
702          &YE or NO"/)
703           WRITE(6,10)DESEL
704           WRITE(6,10)GRAPHI
705   210     READ(5,220)ANS
706   220     FORMAT(A2)
707           IF(ANS.EQ."NO".OR.ANS.EQ."N")GOTO 153
708           IF(ANS.EQ."YE".OR.ANS.EQ."Y")GOTO 250
709           WRITE(6,10)ALPHA
710           WRITE(6,10)SELECT
711           WRITE (6,230)
712   230     FORMAT(" Please enter your response again")
713           WRITE(6,10)DESEL
714           WRITE(6,10)GRAPHI
715           GOTO 210
716   250     CONTINUE
717           XPOS(N) = XS
718           ZPOS(N) = ZS
719           ANGLE(N) = AS
720   C
```

```
721    C        POSITION OF THE WORK STATION POSITIONED VIA JOYSTICK
722    C        IS RECORDED/FILED IN 'WSPOSA',11
723    C
724             CALL OPDISC('WSPOSA',11)
725             DO 290 N = 1,76
726             IF(XPOS(N).EQ.999.0.AND.ZPOS(N).EQ.999.0)GOTO 290
727             WRITE(10,270)N,XPOS(N),ZPOS(N),ANGLE(N),FNAME(N)(1:12)
728    270      FORMAT(I5,3F10.2,A12)
729    290      CONTINUE
730             CALL CLDISC('WSPOSA',11)
731
732             RETURN
733             END
734
735    C
736    C
737    C...
738             SUBROUTINE SUMUPZ (J,SUMX,SUMZ,XS,ZS,AS)
739    C
740    C        THIS SUBROUTINE IS CALCULATING THE TOTAL 'Z' DIMENSION
741    C
742
743             REAL X,Y,Z,XPOS,ZPOS,ANGLE
744             REAL XS,ZS,AS
745             REAL P(500), W(7000), SUMX, SUMZ
746             INTEGER J
747             COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
748            &FNAME(77)
749             INTEGER SELECT,DESEL, ALPHA,GRAPHI
750             CHARACTER*12 FNAME
751             CHARACTER*12 WSNAME
752             DATA SELECT/"40033/
753             DATA DESEL/"40433/
754             DATA ALPHA/"30/
755             DATA GRAPHI/"35/
756
757             WRITE(6,10)ALPHA
758    10       FORMAT('+',A2,$)
759             WRITE(6,10)SELECT
760             WRITE (6,20)
761    20       FORMAT (' YOU ARE NOW IN SUMUPZ SUBROUTINE
762            &to activate press return/new line once! '/)
763             WRITE(6,10)DESEL
764             WRITE(6,10)GRAPHI
765    C
766    C        'ZPOS(J)'  SUM UP
767    C        SUM UP THE 'Z' DIMENSIONS OF ALL PREVIOUS WORK STATIONS
768    C        BECAUSE THE WORK STATION MODULE VOLUME AND WORK STATION
769    C        DETAILED SHOULD BE CONSIDERED BOTH ARE TAKEN INTO
770    C        AN ACCOUNT.
771    C
772    C
773             CALL BOX (P,X(J),Y(J),Z(J))
774             WSNAME=FNAME(J)
775             CALL IN3D(X,WSNAME)
776    C        write(*,*)' w',w(4),w(5),w(6)
777    C        write(*,*)' ',w(7),w(8),w(9)
778             CALL JOIN (P,W)
779             D = DEPTH(W)
780    C        write(*,*)' p',p(4),p(5),p(6)
```

```
781   C        write(*,*)'  ',p(7),p(8),p(9)
782   C
783   C        BECAUSE OF TURNING DURING THE POSITIONING
784   C        THE ANGLE IS CHANGING AND THIS IS CHANGING
785   C        THE ACTUAL DISTANCE OF THE NEXT WORK STATION
786   C        POSITION
787   C        D = D/cosh of the angle
788   C
789
790            F = D/COS(AS)
791
792   C
793   C        INSTEAD OF THE ORIGINAL ZPOS(J) XPOS(J) IS TAKEN
794   C        SUMM OF 'Z' DIMENSION
795   C
796   C        write(*,*)' zs',zs,' d' ,d
797            SUMZ = ZS + F
798            SUMX=XS
799   C         ZS = SUMZ
800            RETURN
801            END
802
803   C...
804
805            SUBROUTINE PLACE (K,XSUM,ZSUM,AS,T)
806   C
807   C        (PLACING A NEXT W.S. IN THE DIRECTION 'Z')
808   C
809
810   C        THIS SUBROUTINE IS ACTUALLY PLACING A WORK STATION INTO
811   C        AN OPTIMUM POSITION RELATED TO OTHER SPACES (W.S. VOLUMES
812   C        CIVIL ENG SPACE AND M.H. SPACE). NO INTERVENTION OF
813   C        THE USER IS NEEDED.
814
815            REAL X,Y,Z,XPOS,ZPOS,ANGLE
816            REAL XSUM,ZSUM,AS
817            REAL P(500), W(7000), T(7300)
818            INTEGER WAS,K
819            COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
820           &FNAME(77)
821            INTEGER SELECT,DESEL, ALPHA,GRAPHI
822            CHARACTER*12 FNAME
823            CHARACTER*12 ASNAME
824            DATA X,Y,Z/231*999.0/
825            DATA XPOS,ZPOS/154*999.0/
826            DATA ANGLE/77*0.0/
827            DATA SELECT/"40033/
828            DATA DESEL/"40433/
829            DATA ALPHA/"30/
830            DATA GRAPHI/"35/
831
832   C        CALL BELL
833            WRITE(6,10)ALPHA
834   10       FORMAT('+',A2,$)
835            WRITE(6,10)SELECT
836            WRITE (6,20)
837   20       FORMAT (' YOU ARE NOW IN AUTOMATIC MODE
838           &to activate press return/new line once! '/)
839            WRITE(6,10)DESEL
840            WRITE(6,10)GRAPHI
```

```
841
842     C        AFTER THE  SUM UP THE NEXT PLACES THE WORK STATION
843     C        VOLUME IN AN OPTIMUM POSITION WITH A NEW 'Z' DIMENSION
844     C        BUT THERE ARE NO CHANGES IN 'X' DIMENSION YET
845     C
846     C        CALL BELL
847              CALL OPDISC('MESDIM',10)
848              NLX   =DIM('NLX    ')
849              NLY   =DIM('NLY    ')
850              NLZ   =DIM('NLZ    ')
851              SPACE =DIM('SPACE ')
852              CALL CLDISC('MESDIM',10)
853              CALL MESH(NLX,NLY,NLZ,SPACE)
854
855              CALL BOX(P,X(K),Y(K),Z(K))
856
857              WSNAME = FNAME(K)
858     C
859     C        DETAILED WORK STATION IS RETRIEVED FROM THE DISC "WSNAME"
860     C
861              CALL IN3D(W,WSNAME)
862              CALL JOIN (P,W)
863              CALL TURN3D(W,AS,0.0,0.0,2,T)
864              CALL SHIFT3 (T,XSUM,0.0,ZSUM)
865              CALL DRAWIT (T)
866              RETURN
867              END
868     C...
869              SUBROUTINE SIGNAL
870     300      CONTINUE
871              WRITE (6,40)
872     40       FORMAT (' DIAGNOSTIC !'//)
873
874     400      CALL BELL
875              WRITE (6,410)
876     410      FORMAT (' CLASH!!! CORRECTIVE ACTION KINDLY REQUESTED!')
877
878     500      CONTINUE
879              RETURN
880              END
881     C
882     C        FOLLOWS SUBROUTINE FOR COLLISION OF THE LAST WORK
883     C        STATION AND THE BUILDING (CIVIL ENG. SPACE)
884     C
885     C...
886
887              SUBROUTINE COLLCWS (WS1,CESPAC,RESULT)
888              REAL WS1(7300)
889
890              REAL CESPAC(10000)
891              INTEGER RESULT,AREA
892     C        COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
893     C        &FNAME(77)
894
895              CHARACTER*12 FNAME
896              CHARACTER*12 WSNAME
897
898              INTEGER SELECT,DESEL, ALPHA,GRAPHI
899              DATA SELECT/"40033/
900              DATA DESEL/"40433/
```

```
901          DATA ALPHA/"30/
902          DATA GRAPHI/"35/
903     C
904     C    FIRST CALL IN CIVIL ENG. SPACE
905     C
906     C    CALL IN3D (CESPAC,'CIVILD')
907
908
909     C    FOLLOWS SUBROUTINE FOR CHECKING RESULT
910     C     OF COLLISION
911
912          WRITE (6,10)ALPHA
913     10   FORMAT ("+",A2,$)
914          WRITE (6,10)SELECT
915          WRITE (6,30)
916     30   FORMAT (" 1 = INSIDE"/" 2 = TOUCH (O.K.!)"// 3 = OUTSIDE")
917          WRITE (6,10)DESEL
918          WRITE (6,10)GRAPHI
919          CALL INSPAC (WS1,CESPAC,RESULT)
920          WRITE (6,100) RESULT
921     100  FORMAT (I8)
922
923
924          RETURN
925          END
926     C
927     C    "INSPAC" IS CONTROLING THE PROCESS IN
928     C    THE COLLISION FINDING
929     C
930     C...
931          SUBROUTINE INSPAC (WS1,CESPAC,RESULT)
932          REAL WS(1), CESPAC(1), OBJECT(100)
933     C
934     C    WS1    = WORK STATION WHICH IS (AS A LAST ONE) POSITIONED
935     C             IN THE BAY (CIVIL ENG. SPACE)
936     C    CESPAC = BUILDING (CIVIL ENG. SPACE)
937     C    OBJECT = IS ANY CIVIL ENG. ELEMENT OF WHICH THE BUILDING
938     C             CONSIST
939     C
940          INTEGER RESULT, AREA
941     C    COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
942     C    &FNAME(77)
943     C
944     C    NBLOCK IS GIVEN BY A NUMBER OF PICASO CONTOURS
945     C    AND IS ACTUALLY GIVING (BY ANALYSIS) A NUMBER
946     C    OF OBJECTS OF WHICH THE BUILDING CONSISTS
947     C    AND IS LIMITING THE NUMBER OF LOOPS
948     C
949          NBLOCK = CESPAC(2)/6.0
950          DO 100 N = 1, NBLOCK
951          CALL ABOX (CESPAC, N, OBJECT)
952          CALL COLISN (WS1, OBJECT, RESULT, AREA)
953          WRITE (6,80) RESULT
954     80   FORMAT (I8)
955          IF (RESULT.EQ.1) RETURN
956     100  CONTINUE
957
958          RETURN
959          END
960     C
```

```
961   C        "ABOX" IS RETRIEVING FORM CIVIL ENGINEERING
962   C        DRAWING INDIVIDUAL CIVIL ENGINEERING SPACES(ELEMENTS)
963   C        ONE SPACE(ELEMENT - ACTUALLY THE 'NTH',NTH) IN TIME
964   C...
965            SUBROUTINE ABOX (CESPAC, NTH, OBJECT)
966            REAL CESPAC(1), OBJECT(1), SHAPE(100)
967            INTEGER FROM, TO
968   C        COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
969   C        &FRAME(77)
970
971            IF (NTH.LT.1) THEN
972            GOTO 200
973            ELSE IF (NTH.GT.100) THEN
974            GOTO 250
975            ELSE
976            GOTO 270
977            END IF
978   200      CONTINUE
979   C
980            WRITE (6,310)
981   310      FORMAT('DIAGNOSTIC - WRONG READING 1')
982   250      WRITE (6,320)
983   320      FORMAT('DIAGNOSTIC - TOO BIG -ERROR 2')
984   C
985   C        READING OF CONTOURS OF INDIVIDUAL OBJECTS
986   C
987   270      CONTINUE
988
989            FROM = (NTH - 1) * 6 + 1
990            TO   = FROM + 5
991
992            DO 10 N = FROM, TO
993   C
994   C        THE INDIVIDUAL SHAPE IS EXTRACTED
995   C
99.            CALL EXTSH (CESPAC, N, SHAPE)
997            IF (N.EQ.FROM) CALL COPY (SHAPE,OBJECT)
998            IF (N.NE.FROM) CALL JOIN (SHAPE,OBJECT)
999   10       CONTINUE
1000           RETURN
1001           END
1002  C...
1003  C...
1004
1005           SUBROUTINE COLISN (WS1,OBJECT,RESULT,AREA)
1006           REAL WS1(1),OBJECT(100)
1007           INTEGER RESULT,AREA
1008  C        COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
1009  C        &FRAME(77)
1010           INTEGER SELECT,DESEL, ALPHA,GRAPHI
1011           DATA SELECT/"40033/
1012           DATA DESEL/"40433/
1013           DATA ALPHA/"30/
1014           DATA GRAPHI/"35/
1015
1016           WRITE (6,10) ALPHA
1017  10       FORMAT ('+',A2,S)
1018           WRITE (6,10) SELECT
1019           CALL HULL3D (WS1,XMIN1,XMAX1,YMIN1,YMAX1,ZMIN1,ZMAX1)
1020           CALL HULL3D (OBJECT,XMIN2,XMAX2,YMIN2,YMAX2,ZMIN2,ZMAX2)
```

```
1021
1022              RESULT = 3
1023              WRITE (6,30) RESULT
1024      30      FORMAT (I8)
1025      C       AREA = 1
1026      C
1027      C       HORIZONTAL PLANE IN AREA 'X' IS TESTED (AREA=1)
1028      C
1029              IF (XMIN2.EQ.XMAX1.OR.XMAX2.EQ.XMIN1) GOTO 100
1030      C       CONDITION OF OUTSIDE ... 3 IS CONSIDERED
1031              IF (XMAX2.LT.XMIN1.OR.XMIN2.GT.XMAX1) RETURN
1032              GOTO 150
1033      100     IF ((YMIN2.LE.YMAX1.AND.YMAX2.GT.YMIN1).OR.
1034             &(YMAX2.GE.YMIN1.AND.YMIN2.GT.YMIN1)) GOTO 200
1035      C       CONDITION OUTSIDE ... 3 IS CONSIDERED
1036      150     IF (YMAX2.LT.YMIN1.OR.YMIN2.GT.YMAX1) RETURN
1037              GOTO 250
1038      C
1039      C       CONDITION IN Z-DIMENSION
1040      C       CONDITION "TOUCH...2" IS CONSIDERED
1041      C
1042      200     IF ((ZMIN2.LE.ZMAX1.AND.ZMAX2.GT.ZMIN1) .OR.
1043             &(ZMAX2.GE.ZMIN1.AND.ZMIN2.GT.ZMIN1)) GOTO 300
1044      250     IF (ZMAX2.LT.ZMIN1.OR.ZMIN2.GT.ZMAX1) RETURN
1045              RESULT = 1
1046              WRITE (6,260) RESULT
1047      260     FORMAT (I8)
1048              RETURN
1049      300     RESULT = 2
1050              WRITE (6,320) RESULT
1051      320     FORMAT (I8)
1052
1053              WRITE (6,10)DESEL
1054              WRITE (6,10)GRAPHI
1055              RETURN
1056              END
1057      C....
1058      C       END OF PROGRAM "COLLCWS1.FOR"
1059      C
1060      C....
1061      C...
1062              SUBROUTINE JOYST(NWS,PICPLA,DISTNC,J)
1063              REAL P(500),R(2000),O(2000),T(2000),U(2000)
1064              REAL V(2000), CESPAC(10000)
1065              INTEGER NWS
1066              COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
1067             &FNAME(77)
1068              INTEGER SELECT,DESEL, ALPHA,GRAPHI
1069              CHARACTER*12 FNAME
1070              CHARACTER*12 WSNAME
1071
1072              DATA SELECT/"40033/
1073              DATA DESEL/"40433/
1074              DATA ALPHA/"30/
1075              DATA GRAPHI/"35/
1076
1077      60      CALL BELL
1078              CALL PLIT(3.0,-5.0,3)
1079              WRITE(6,70)ALPHA
1080      70      FORMAT('+',A2,S)
```

```
1081          WRITE(6,70)SELECT
1082          WRITE(6,80)
1083     80   FORMAT(' Which Work Station,;to start from? Type Tag No...'/
1084          &' To end ...type "END"')
1085          WRITE(6,70)DESEL
1086          WRITE(6,70)GRAPHI
1087
1088     90   CONTINUE
1089          READ (5,100) WSNAME
1090    100   FORMAT (A12)
1091          WRITE (6,110) WSNAME
1092    110   FORMAT (1X,A12)
1093          IF (WSNAME(1:3).EQ."END') GOTO 190
1094
1095          DO 120 J = 1,76
1096          IF (WSNAME.EQ.FNAME(J)(1:12)) GOTO 140
1097    120   CONTINUE
1098
1099          WRITE (6,130)
1100    130   FORMAT (' Please enter your TAG NO exactly again')
1101          GOTO 90
1102
1103     C
1104     C
1105    140   CALL BOX(P,X(J),Y(J),Z(J))
1106          CALL SCREEN(ICHAR,X1,Y1)
1107          CALL SCREEN(ICHAR,X2,Y2)
1108          CALL NEWPAG
1109          CALL BELL
1110          CALL OPDISC("MESDIM",10)
1111          NLX   =DIN('NLX   ')
1112          NLY   =DIN('NLY   ')
1113          NLZ   =DIN('NLZ   ')
1114          SPACE =DIN('SPACE ')
1115          CALL CLDISC('MESDIM',10)
1116          CALL MESH(NLX,NLY,NLZ,SPACE)
1117          CALL IN3D (CESPAC,'CIVILD')
1118          CALL DRAWIT (CESPAC)
1119          ANGLE(J) = ATAN2(Y2-Y1,X2-X1)*180.0/3.14159265
1120          XPOS(J) = Y1*DISTNC/PICPLA
1121          ZPOS(J) = X1*DISTNC/PICPLA
1122          DO 180 M = 1,76
1123          CALL BOX(P,X(M),Y(M),Z(M))
1124          XWORK = XPOS(M)
1125          ZWORK = ZPOS(M)
1126          IF(XWORK.EQ.999.0.AND.ZWORK.EQ.999.0)GOTO 180
1127          CALL HERSH(FNAME(M)(1:12),6,2,60.0,0)
1128          CALL TRANSP(G,T)
1129          CALL TURN3D('T,270.0,0.0,0.0,1,U)
1130          CALL JOIN(P,U)
1131          CALL IN3D (V,FNAME(M))
1132          CALL JOIN (U,V)
1133
1134          CALL TURN3D(V,ANGLE(M),0.0,0.0,2,R)
1135          CALL SHIFT3 (R,XWORK,0.0,ZWORK)
1136          CALL DRAWIT (R)
1137     C    CALL DRAW3D(U,1.0,XWORK,0.0,ZWORK,1)
1138    180   CONTINUE
1139          GOTO 60
1140    190   CONTINUE
```

```
C   48.

      1141            CALL OPDISC('*SPOSA',11)
      1142            DO 200 M = 1,76
      1143            IF(XPOS(M).EQ.999.0.AND.ZPOS(M).EQ.999.0)GOTO 200
      1144            WRITE(10,210)M,XPOS(M),ZPOS(M),ANGLE(M),FNAME(M)(1:12)
      1145      210   FORMAT(I5,3F10.2,A12)
      1146      200   CONTINUE
      1147            CALL CLDISC('*SPOSA',11)
      1148      250   RETURN
      1149            END
      1150   C...
      1151            SUBROUTINE PRESITDET (NWS)
      1152   C
      1153   C        THIS IS A SUBROUTINE FOR SHOWING THE PRESENT SITUATION
      1154   C        WITH DETAILED WORK STATIONS DRAWN
      1155
      1156   C
      1157            REAL P(500),R(2000),Q(2000),T(2000),U(2000)
      1158            REAL CESPAC(10000),V(2000)
      1159            INTEGER NWS
      1160            COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
      1161           &FNAME(77)
      1162            INTEGER SELECT,DESEL, ALPHA,GRAPHI
      1163            CHARACTER*12 FNAME
      1164            CHARACTER*12 WSNAME
      1165            DATA SELECT/"40033/
      1166            DATA DESEL/"40433/
      1167            DATA ALPHA/"30/
      1168            DATA GRAPHI/"35/
      1169   C        PRINTING THE PRESENT SITUATION OF LAYOUT DEVELOPMENT
      1170            WRITE(6,10)ALPHA
      1171      10    FORMAT('+',A2,S)
      1172            WRITE(6,10)SELECT
      1173            WRITE(6,20)
      1174      20    FORMAT(' LAYOUT...The existing situation of development')
      1175            WRITE(6,10)DESEL
      1176            WRITE(6,10)GRAPHI
      1177            CALL BELL
      1178            CALL OPDISC('MESDIM',10)
      1179            NLX   =DIM('NLX   ')
      1180            NLY   =DIM('NLY   ')
      1181            NLZ   =DIM('NLZ   ')
      1182            SPACE =DIM('SPACE ')
      1183            CALL CLDISC('MESDIM',10)
      1184            CALL MESH(NLX,NLY,NLZ,SPACE)
      1185   C
      1186   C        BUILDING IS CALLED IN
      1187   C
      1188            CALL IN3D (CESPAC,'CIVILD')
      1189            CALL DRAWIT (CESPAC)
      1190            CALL OPDISC('*SVTOR',12)
      1191      40    READ(12,60,END=50)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
      1192            CALL OPDISC('*SPOSA',11)
      1193      50    READ(11,60,END=90)J,XPOS(J),ZPOS(J),ANGLE(J),FNAME(J)(1:12)
      1194      60    FORMAT(I5,3F8.2,A12)
      1195            CALL BOX(P,X(J),Y(J),Z(J))
      1196            XWORK = XPOS(J)
      1197            ZWORK = ZPOS(J)
      1198            CALL TURN3D(P,ANGLE(J),0.0,0.0,2,R)
      1199            CALL HERSH(FNAME(J)(1:12),6,2,60.0,Q)
      1200            CALL TRANSP(G,T)
```

49.

```
1201          CALL TURN3D(T,270.0,0.0,0.0,0.0,1.0)
1202          CALL JOIN(R,U)
1203          WSNAME = FNAME(J)
1204          CALL IN3D (V,WSNAME)
1205          CALL JOIN(U,V)
1206          CALL SHIFT3 (V,XWORK,0.0,ZWORK)
1207          CALL DRAWIT (V)
1208    C     CALL DRA*3D(U,1.0,XWORK,0.0,ZWORK,1)
1209          GOTO 40
1210    90    CONTINUE
1211          CALL CLDISC('*SPOSA',11)
1212          CALL CLDISC('*SVTOR',12)
1213
1214
1215          RETURN
1216          END
1217    C...
1218    C...
1219    C....
1220    C     FILE UNDER 'POSCLASH4.FOR'
```

```
1    C        'DISPLAY.FOR'
2    C        THIS IS A PROGRAM FOR DISPLAY OF WHOLE DESIGNES
3    C        SCENE TO ENABLE THE USER TO OBSERVE THE LAYOUT
4    C        FROM ANY REQUESTED POSITION
5    C
6    C
7    C
8             INTEGER NWS
9             COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
10   &FNAME(77)
11            REAL P(500),R(2000),O(2000),T(2000),U(2000)
12            REAL CESPAC(10000)
13            INTEGER SELECT,DESEL,ALPHA,GRAPH1
14            CHARACTER*12 FNAME
15            CHARACTER*12 WSNAME
16            DATA SELECT/"40033/
17            DATA DESEL/"40433/
18            DATA ALPHA/"30/
19            DATA GRAPH1/"35/
20            DATA XPOS,ZPOS/154*999.0/
21            DATA ANGLE/77*0.0/
22            CALL START
23   C        CALL FACTOR(1.0)
24            CALL FORMAT (84.1,59.4)
25            CALL FRAME(-55.0,29.0,-35.0,20.0)
26
27
28   3        FORMAT('Program for display of industr. bay in required
29   & elevation with detailed work Stations')
30            WRITE(6,5)ALPHA
31   5        FORMAT(A2)
32            WRITE(6,5)SELECT
33            WRITE(6,3)
34            WRITE(6,5)DESEL
35            WRITE(6,5)GRAPH1
36            WRITE(6,10)
37   10       FORMAT('Please enter the DISTANCE, ROTATION & ELEVATION')
38            READ(5,*) DISTNC, ROTATN, ELEVTN
39            WRITE(6,20)
40   20       FORMAT ('Please enter the PICPLA(ZOOM) FACTOR')
41            READ(5,*) ZOOM
42            CALL NEWPAG
43            CALL BELL
44            CONTINUE
45            CALL PEYE (0.0,0.0,0.0,DISTNC,ROTATN,ELEVTN)
46            CALL PLANE (ZOOM)
47   C        CALL MESH(NLX,NLY,NLZ,SPACE)
48            CALL UPDISC('WSVOLD',10)
49            NWS=1
50   50       READ(10,70,END=90)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
51   70       FORMAT(I5,3F8.2,A12)
52            NWS=NWS+1
53            GOTO 50
54   90       CALL CLDISC('WSVOLD',10)
55            NWS = NWS-1
56            CALL PRESIT (NWS)
57
58            CALL NCLOSE
59            CALL FINISH
60            STOP
```

```
61          END
62    C...
63          SUBROUTINE PRESIT (NWS)
64    C
65    C     THIS IS A SUBROUTINE FOR SHOWING THE PRESENT SITUATION
66    C
67          REAL P(500),R(6000),G(2000),T(2000),U(2000),V(5000)
68          REAL CESPAC(10000)
69          INTEGER NWS
70          COMMON/LCWS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
71         &FRAME(77)
72          INTEGER SELECT,DESEL, ALPHA,GRAPHI
73          CHARACTER*12 FNAME
74          CHARACTER*12 WSNAME
75          DATA SELECT/"40033/
76          DATA DESEL/"40433/
77          DATA ALPHA/"30/
78          DATA GRAPHI/"35/
79    C     PRINTING THE PRESENT SITUATION OF LAYOUT DEVELOPMENT
80          WRITE(6,10)ALPHA
81    10    FORMAT('+',A2,$)
82          WRITE(6,10)SELECT
83          WRITE(6,20)
84    20    FORMAT(' LAYOUT...The existing situation of development')
85          WRITE(6,10)DESEL
86          WRITE(6,10)GRAPHI
87          CALL BELL
88          CALL OPDISC('MESDIR',10)
89          NLX   =DIN('NLX    ')
90          NLY   =DIN('NLY    ')
91          NLZ   =DIN('NLZ    ')
92          SPACE =DIN('SPACE ')
93          CALL CLDISC('MESDIR',10)
94          CALL MESH(NLX,NLY,NLZ,SPACE)
95    C
96    C     BUILDING IS CALLED IN
97    C
98          CALL IN3D (CESPAC,'CIVILD')
99          CALL DRAWIT (CESPAC)
100         CALL OPDISC('WSVTOR',12)
101   40    READ(12,60,END=50)J,X(J),Y(J),Z(J),FRAME(J)(1:12)
102         CALL OPDISC('WSPOSA',11)
103   50    READ(11,60,END=90)J,XPOS(J),ZPOS(J),ANGLE(J),FNAME(J)(1:12)
104   60    FORMAT(I5,3F8.2,A12)
105         CALL BOX(P,X(J),Y(J),Z(J))
106         WSNAME = FNAME(J)
107         XWORK = XPOS(J)
108         ZWORK = ZPOS(J)
109         CALL MERSH(FRAME(J)(1:12),6,2,60.0,0)
110         CALL TRANSP(G,T)
111         CALL TURN3D(T,270.0,0.0,0.0,1,U)
112         CALL JOIN(P,U)
113         CALL IN3D(V,WSNAME)
114         CALL JOIN(U,V)
115         CALL TURN3D(V,ANGLE(J),0.0,0.0,2,R)
116         CALL SHIFT3 (R,XWORK,0.0,ZWORK)
117         CALL DRAWIT (R)
118   C     CALL DRAW3D(U,1.0,XWORK,0.0,ZWORK,1)
119         GOTO 40
120   90    CONTINUE
```

```
121          CALL CLDISC('*SPOSA',11)
122          CALL CLDISC('*SVTOR',12)
123
124
125          RETURN
126          END
127
128    C
129    C...
130          SUBROUTINE MESH(NLX,NLY,NLZ,SPACE)
131          REAL A(1000)
132          CALL GRIL3D(A,NLX,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,SPACE,.0,.0)
133          CALL DRAWIT(A)
134          CALL GRIL3D(A,NLY,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,SPACE,.0)
135          CALL DRAWIT(A)
136          CALL GRIL3D(A,NLZ,.0,.0,.0,.0,FLOAT(NLY-1)*SPACE,.0,.0,.0,SPACE)
137          CALL DRAWIT(A)
138          CALL GRIL3D(A,NLY,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,.0,SPACE,.0)
139          CALL DRAWIT(A)
140          CALL GRIL3D(A,NLX,.0,.0,.0,.0,.0,FLOAT(NLZ-1)*SPACE,SPACE,.0,.0)
141          CALL DRAWIT(A)
142          CALL GRIL3D(A,NLZ,.0,.0,.0,FLOAT(NLX-1)*SPACE,.0,.0,.0,.0,SPACE)
143          CALL DRAWIT(A)
144          RETURN
145          END
146    C...
147    C...
148    C...
149    C...
150    C
151    C...
152    C     FILE UNDER 'DISPLAY'
```

```
9999999999999999999999999999999999999999999999999999999999999999999999999999999999999
9999999999999999999999999999999   MIDDLESEX POLYTECHNIC VAXB 11/785   99999999999999999999999999
9999999999999999999999999999999999999999999999999999999999999999999999999999999999999
```

```
BBBBBBBB      OOOOOO     BBBBBBBB       11
BBBBBBBB      OOOOOO     BBBBBBBB       11
BB      BB   OO     OO   BB      BB     1111
BB      BB   OO     OO   BB      BB     1111
BB      BB   OO     OO   BB      BB       11
BB      BB   OO     OO   BB      BB       11
BBBBBBBB     OO     OO   BBBBBBBB         11
BBBBBBBB     OO     OO   BBBBBBBB         11
BB      BB   OO     OO   BB      BB       11
BB      BB   OO     OO   BB      BB       11
BB      BB   OO     OO   BB      BB       11
BB      BB   OO     OO   BB      BB       11
BBBBBBBB      OOOOOO     BBBBBBBB       111111
BBBBBBBB      OOOOOO     BBBBBBBB       111111
```

```
M     M   FFFFF   EEEEE   EEEEE   DODO
MM   MM   F       E       E       D   D
M M M M   F       E       E       D   D
M     M   FFFF    EEEE    EEEE    D   D
M     M   F       E       E       D   D
M     M   F       E       E       D   D
M     M   F       EEEEE   EEEEE   DODO
```

```
   J    OOO    BBBB         1       1      666    7777
    J   O   O   B    B       11      11     6          7
    J   O   O   B    B       1       1      6          7
    J   O   O   BBBB         1       1      6666       7
J   J   O   O   B    B       1       1      6   6      7
J   J   O   O   B    B       1       1      6   6      7
 JJJ    OOO    BBBB         111     111     666       7
```

) queued to SYSSPRINT on 9-NOV-1987 12:16 by user BOB1, UIC [RESM0012,BOB1], under account RESM
ter _LPA0: on 9-NOV-1987 12:17 from queue LPA0.

```
9999999999999999999999999999999999999999999999999999999999999999999999999999999999999999
9999999999999999999999   Digital Equipment Corporation - VAX/VMS Version V4.5   999999999999999
9999999999999999999999999999999999999999999999999999999999999999999999999999999999999999
```

```
  1    C     THIS IS A MANUAL FEED PROGRAM "MFEED.FOR"
  2    C     FEEDING INFORMATION ABOUT POSITION OF WORK STATION
  3    C     ACCORDING TO TECHNOLOGICAL ORDER/LINE
  4    C
  5    C      THE PROGRAM IS ALSO SIMULATING THE DR. CARRIES
  6    C      PROGRAM FOR TECHNOLOGICAL POSITIONING OF WORK STATIONS
  7
  8    C      THE PROGRAM IS FEEDING INFORMATION INTO A FILE 'TECHORD'
  9    C      (IN TECH. LINE ...1,2,3,4, ECT...!!!)
 10    C
 11
 12
 13    C       FROM THIS DISK THE INFORMATION ARE FEAD INTO THE
 14    C       AUTOMATIC POSITIONING PROGRAM 'POSCLASH'
 15    C
 16    C
 17
 18          INTEGER ANS
 19          CHARACTER *12 WSNAME (200),WS
 20    C     CALL START
 21    C     OUTPUT OF EXISTING DATA FILE
 22    C     THE LINE IS NOT CHANGING (MUST REMAIN IN A TECHNOLOGICAL
 23    C     ORDER / IN A LINE)
 24    C     INFORMATION HAS TO BE FED IN FORMAT line No. comma Tag.No.
 25    C
 26
 27    5     CONTINUE
 28          WRITE (6,10)
 29    10    FORMAT (' LIST OF M/C AND EQUIPMENT IN TECHNOLOGICAL ORDER'//)
 30          WRITE (6,20) ' Line', 'Work Stn Number'
 31    20    FORMAT (A5,1X,A18)
 32    50    CONTINUE
 33          CALL OPDISC ('TECHORD',11)
 34    60    CONTINUE
 35          READ (11,130,END=135) N,WSNAME(N)(1:12)
 36    130   FORMAT (I5,A12)
 37          WRITE (6,132) N,WSNAME(N)(1:12)
 38    132   FORMAT (I5,2X,A12)
 39
 40          GOTO 60
 41    135   WRITE(6,137)
 42    137   FORMAT (' THERE IS NOTHING FORE IN THE FILE'/)
 43          CALL CLDISC ('TECHORD',11)
 44    C
 45    C     EXTENDING THE FILE
 46    C
 47    138   WRITE (6,140)
 48    140   FORMAT (/' Do you wish to extend or change the file - YE or NO'/)
 49          READ (5,150)ANS
 50    150   FORMAT (A2)
 51          IF (ANS.EQ.'NO'.OR.ANS.EG.'N') GOTO 500
 52          IF (ANS.EQ.'YE'.OR.ANS.EG.'Y') GOTO 170
 53    C
 54    C     ERROR MESSAGE
 55    C
 56          WRITE(6,160)
 57    160   FORMAT (' Please enter your response again! Use CAPITALS!')
 58          GOTO 138
 59    C
 60    C     EXTENDING THE FILE
```

```
61    C
62    170    CONTINUE
63           WRITE (6,172)
64    172    FORMAT (" To run program requested type the prefix letter"/
65           &" for adding a new Work Station at the end type _A_"/
66           &" for inserting  Work Station above a W.S. type _I_"/
67           &" for deleting any Work Station type _R_"/)
68           READ (5,174) ACTION
69    174    FORMAT (A1)
70           IF (ACTION.EQ."A") GO TO 175
71           IF (ACTION.EQ."I") GO TO 300
72           IF (ACTION.EQ."R") GO TO 400
73           WRITE (5,160)
74           GO TO 170
75    175    CONTINUE
76    C
77    C      FEEDING IN INFORMATION ABOUT THE POSIT OF W.S. LINE OR
78    C      ADDING A NEW WORK STATION AT THE END OF LINE
79    C      (ADDING TO THE LINE   EX: ...3,4,5,...ADDING 6,7,8 ETC)
80    C
81           WRITE (6,180)
82    180    FORMAT(" Please enter line No. and W.S.No to end type 200"/)
83           READ (5,130) N,WSNAME(N)(1:12)
84           IF (N.EQ.200) GOTO 210
85    C
86    C      OUTPUT OF THE LATEST DATA TO DICS AND TERMINAL
87    C
88           CALL OPDISC ("TECHORD",11)
89    190    READ (11,130,END=200)I,WSNAME(I)(1:12)
90           GOTO 190
91    200    WRITE(11,130)N,WSNAME(N)(1:12)
92           CALL CLDISC ("TECHORD",11)
93           GO TO 175
94    210    CONTINUE
95    C
96    C      PRINT THE DEVELOPED LIST OF W.S. ON THE VDU
97    C
98           GO TO 5
99    C
100   C      INSERTING A NEW W.S. INTO THE EXISTING LINE
101   C
102   300    CONTINUE
103          CALL OPDISC ("TEMP.DAT",10)
104          CALL OPDISC ("TECHORD",11)
105          WRITE (6,180)
106          READ (5,130) N,WS(1:12)
107   310    READ (11,130,END=330)I,WSNAME(I)(1:12)
108          IF(N.NE.I) GO TO 320
109          WRITE(10,130)N,WS
110   320    J=I
111          IF (I.GE.N) J=J+1
112          WRITE (10,130) J,WSNAME(I)(1:12)
113          GO TO 310
114   330    CONTINUE
115          CALL CLDISC ("TEMP.DAT",10)
116          CLOSE (UNIT=11,DISPOSE="DELETE")
117          CALL OPDISC ("TEMP.DAT",10)
118          CALL OPDISC ("TECHORD.DAT",11)
119   340    READ (10,130,END=350)N,WSNAME(N)(1:12)
120          WRITE (11,130) N,WSNAME(N)(1:12)
```

```
121            GO TO 340)
122      350   CALL CLDISC ('TECHORD.DAT',11)
123            CLOSE (UNIT=10,DISPOSE='DELETE')
124            CONTINUE
125      C
126      C     PRINT THE DEVELOPED LIST OF W.S. ON THE VDU
127      C
128            GO TO 5
129      400   CONTINUE
130      C
131      C     RETYPING/DELETING AN EXISTING W.S. AND REPOSITIONING
132      C     THE LINE OF WORK STATION
133      C
134            CALL OPDISC ('TEMP.DAT',10)
135            CALL OPDISC ('TECHORD',11)
136            WRITE (6,405)
137      405   FORMAT (' Type position and W.S. which has to be deleted'/)
138            READ (5,130) N,WS(1:12)
139      410   READ (11,130,END=430)K,WSNAME(K)(1:12)
140            IF(N.EQ.K) GO TO 410
141            J=K
142            IF (K.GT.N) J=J-1
143            WRITE (10,130) J,WSNAME(K)(1:12)
144            GO TO 410
145      430   CONTINUE
146            CALL CLDISC ('TEMP.DAT',10)
147            CLOSE (UNIT=11,DISPOSE='DELETE')
148            CALL OPDISC ('TEMP.DAT',10)
149            CALL OPDISC ('TECHORD.DAT',11)
150      440   READ (10,130,END=450)N,WSNAME(N)(1:12)
151            WRITE (11,130) N,WSNAME(N)(1:12)
152            GO TO 440
153      450   CALL CLDISC ('TECHORD.DAT',11)
154            CLOSE (UNIT=10,DISPOSE='DELETE')
155            CONTINUE
156      C
157      C     PRINT THE DEVELOPED LIST OF W.S. ON THE VDU
158      C
159            GO TO 5
160      500   CONTINUE
161            STOP
162            END
163      C
164      C
165      C....
166      C     FILE 'WFEED'
167      C
```

58.

```
        BBBB86BB      000000    B6B9B888       11
        B8BB6BBB      000GCC    B6BB69B8       11
        BB     BB  00      CU   88      88   1111
        BB     88  00      GC   88      88   1111
        Bb     BB  00      CO   88      98     11
        BB     BB  00      CU   88      98     11
        BBBBB8BB   UO      CU   88888688       11
        bBBB6B8B   00      CU   8b8888B8       11
        BB     6B  00      CU   8B      8B     11
        BB     88  00      GU   88      6B     11
        BB     BB  00      CO   68      8B     11
        BB     BB  00      GU   88      88     11
        BD66BBBB     000006   88888888     111111
        BBBB6BB6     0G0C0C   B8868888     111111


     w   w   SSSS   V   V   TTTTT   OUO   TTTTT   OUO
     W   w   S      V   V     T    U   0    T    0   0
     w   W   S      V   V     T    0   0    T    0   0
     w   w   SSS    V   V     T    0   0    T    0   0
     W W W      S   V   V     T    0   0    T    0   0
     WW UW      S   V V       T    0   0    T    0   0
     w   w   SSSS     V        T    000     T    OUO


     J   000   BBBB           1      1    566     888
     J  0   0  B   B         11     11    6       8   8
     J  0   0  B   B          1      1    6       8   8
     J  0   0  BBBB           1      1    5556     888
   J J  0   0  B   B          1      1    5   6   6   6
   J J  0   0  B   B          1      1    5   5   8   8
   JJJ   000   B86B          111    111   665     888
```

68) queued to SYSSPRINT on 9-NOV-1987 12:16 by user 8081, BIC [RESM0012,8081], under account RE:
printer _LPA0: on 9-NOV-1987 12:16 from queue LPA0.

```
 1    C      PROGRAM/SUBROUTINE WSVTOTO
 2    C      (WORK STATION (VOLUMES) TO TECHNOLOGICAL ORDER)
 3    C
 4    C      THIS SUBROUTINE IS RETRIEVING WORK STATION REQUESTED
 5    C      FOR A SUGGESTED PRODUCTION LINE FROM THE 'WSVOLD' FILE
 6    C      AND REORGANISES THEM IN TECHNOLOGICAL ORDER-LINE(I.E. FOR
 7    C      PRODUCTION OR PRODUCT ORIENTATED LAYOUT OR GROUP
 8    C      TECHNOLOGY ORIENTATED LAYOUT).
 9    C
10
11           READ X,Y,Z,XPOS,ZPOS,ANGLE
12           INTEGER J,K,N
13           COMMON/LCAS/X(77),Y(77),Z(77),XPOS(77),ZPOS(77),ANGLE(77),
14          &FNAME(77)
15           CHARACTER*12 FNAME
16           CHARACTER*12 WSNAME(77)
17
18           CALL START
19
20    C
21    C      FIRST NAME OF W.S. IN TECHNOLOGICAL ORDER IS RETRIEVED
22    C
23           CALL OPDISC ('WSVTOR',12)
24           CALL OPDISC ('TECHORD',11)
25    20     CONTINUE
26           READ (11,50,END=400)N,WSNAME(N)(1:12)
27    50     FORMAT (15,A12)
28
29           CONTINUE
30           CALL OPDISC ('WSVOLD',10)
31    60     CONTINUE
32           READ (10,80,END=100)J,X(J),Y(J),Z(J),FNAME(J)(1:12)
33    80     FORMAT (15,3F8.2,A12)
34
35    C
36    C      COMPARE LIST OF W.S.VOL. WITH TECHNOLOGICAL ORDER
37    C
38           IF (WSNAME(N)(1:12).EQ.FNAME(J)(1:12)) GOTO 100
39           IF (WSNAME(N)(1:12).NE.FNAME(J)(1:12)) GOTO 90
40    90     CONTINUE
41           GOTO 60
42    100    CONTINUE
43           WRITE (12,150) N,X(J),Y(J),Z(J),FNAME(J)(1:12)
44    150    FORMAT (15,3F8.2,A12)
45           CALL CLDISC ('WSVOLD',10)
46
47           GOTO 20
48    400    CONTINUE
49           CALL CLDISC ('TECHORD',11)
50           CALL CLDISC ('WSVTOR',12)
51    C
52    C      READ ALL CREATED LINE OF W.S.VOL. IN TECHNOLOGICAL ORDER
53    C
54           CALL OPDISC ('WSVTOR',12)
55
56           K = 1
57    450    CONTINUE
58           READ (12,470,END=550) K,X(K),Y(K),Z(K),FNAME(K)(1:12)
59    470    FORMAT (15,3F8.2,A12)
60           WRITE (6,480)K,X(K),Y(K),Z(K),FNAME(K)(1:12)
```

60.

```
61   480   FORMAT (I5,3F8.2,1X,A12)
62         K = K+1
63         GOTO 450
64   550   CONTINUE
65         CALL CLDISC ('45VTOK',12)
66   C     RETURN
67         STOP
68         END
```

```
 1    C.....THIS IS PROGRAM "M100.FOR"
 2    C     FOR BASIC CAPACITY CALCULATION FOR FACTORY LAYOUT PLANNIG
 5
 6    C...
 7          INTEGER ACTION
 8          WRITE(6,10)
 9    10    FORMAT(' CAFLAP MASTER PROGRAM'/)
10    C...Functions of the program are:
11    C...-to enable to enter and run individual programs separately
12    C...-to chnage sequences/order of execution
13    C...-to ease interaction between programs
14    C...
15          WRITE(6,20)
16    20    FORMAT(' MENU of the CAFLP master program'/)
17          WRITE(6,110)
18    110   FORMAT(' A    VOLUME OF MATERIAL HANDLING(VOLMH)')
19          WRITE(6,120)
20    120   FORMAT(' B    NUMBER OF WORK STATIONS (NOWS)')
21          WRITE(6,130)
22    130   FORMAT(' C    MANUFACTURING AREA-in sg.M-(MFAREA)')
23          WRITE(6,140)
24    140   FORMAT(' D    TOTAL LENGTH OF INDUSTRIAL BAY-in M-(BAYLGH)')
25          WRITE(6,30)
26    30    FORMAT(' To run  the program requested type the prefix letter
27         &...To finish type XX ')
28    40    READ(5,50)ACTION
29    50    FORMAT(A1)
30          IF (ACTION.EG.'A')GOTO 210
31          IF (ACTION.EG.'B')GOTO 220
32          IF (ACTION.EG.'C')GOTO 230
33          IF (ACTION.EG.'D')GOTO 240
34          IF (ACTION.EG.'X')GOTO 280
35          WRITE(6,60)
36    60    FORMAT(' PROGRAM IS NOT SELECTED PLEASE TRY AGAIN')
37          GOTO 40
38    210   CONTINUE
39          CALL VOLMH
40    220   CONTINUE
41          CALL NOWS
42    230   CONTINUE
43          CALL MFAREA
44    240   CONTINUE
45          CALL BAYLGH
46    280   CONTINUE
47          STOP
48          END
49    C...
50          SUBROUTINE VOLMH
51    C     FACTORY LAYOUT PLANNING-VOLUME OF MATERIAL HANDLING
52    C     THE FOLLOWING PROGRAM CALCULATES A VOLUME OF MATERIAL ,W.I.P.
52    C     AND PRODUCT
53    C     IN UNIT LOADS(UNL) PASSING TROUGH A FACTORY/INDUSTRIAL BAY
54    C     THIS PROGRAM IS AN ENTRY PROGRAM
55          WRITE(6,10)
56    10    FORMAT('FACTORY LAYOUT PLANNING-VOLUME OF MATERIAL HANDLING')
57    C     STEP 1 CALCULATES THE NUMBER OF PARTS PER UNIT LOAD(NPPUNL)
58    C     VOLUME OF UNIT LOAD IN CUBIC METERS AND VOLUME OF PARTS
59    C     TO BE MACHINED IN THE BATCH )IN CUBIC METERS IS TO BE DECIUED
60    C     /CALCULATED BY PRODUCTION DEPT.PRIOR THIS PROGRAM STARTS.
61          WRITE(6,20)
```

```
62    20    FORMAT(' PLEASE ENTER VOLUME OF UNL (VOLUNL)IN CU METERS')
63          WRITE(6,30)
64    30    FORMAT(' PLEASE ENTER VOLUME OF PART(VOLPT) IN CU METERS')
65    C     VOLUMES TO BE ENTERED VIA KEYBOARD
66          READ(5,*)VOLUNL,VOLPT
67          NPPUNL=VOLUNL/VOLPT
68    C     NOW THE SYSTEM WILL PRINT IN COLUMNS THE ABOVE DATA
69          WRITE(6,40)
70    40    FORMAT (4X,'VOLUNL',7X,'VOLPT',8X,'NO PARTS PER UNL')
71          WRITE(6,50)VOLUNL,VOLPT,NPPUNL
72    50    FORMAT(5X,F5.3,3X,F11.8,F16.2)
73    C
74    C...  STEP 2 . CALCULATE THE NUMBER OF UNIT LOAD GOING TROUGH BAY
75    C...  PER YEAR(NOUNLPY),SO WE HAVE TO ENTER PRODUCTION PROGRAMME
76    C...  IN PARTS PER YEAR(PRODNPROG)
77    C
78          WRITE(6,60)
79    60    FORMAT(' ENTER THE PRODN PROGRAMME IN PARTS PER YEAR(PPROG)')
80          READ (1,*)PPROG
81          NUNLPY=PPROG/NPPUNL
82          WRITE(6,70)
83    70    FORMAT(3X,'PRODN PROG.',4X,'NO PARTS PER UNL',9X,'NO UNL PER YR')
84          WRITE(6,80)PPROG,NPPUNL,NUNLPY
85    80    FORMAT(2X,F12.1,3X,F10.1,15X,F12.2)
86    C     THIS THE BEGINNING OF PROGRAM VOLMH3
87    C
88    C     STEP3-CALCULATE NUMBER OF UNIT LOADS GOING THROUGH
89    C     THE INDUSTRIAL BAY PER HOUR(UNLPH).
90    C     THE PRODUCTION YEAR HAS NUMBER OF WORKING HOURS GIVEN
90    C     BY LOCAL CONDITIONS. THIS CAN BE ALSO
91    C     EXPRESSED BY YEARLY CAPACITY OF A WORK STATION (EFWSH)
92    C     AVERAGE YEARLY CAPACITY OF A WORK STATION FOR 48HRS WEEK
92    C     AND ONE SHIFT
93    C     IS 2000 HOURS(OFCOURSE THIS HAS TO BE AMENDED ACCCRDING
93    C     TO YOUR LOCAL
94    C     CONDITION...LOCAL CONDITION INCLUDE HOURS CONVENTION
95    C     (NUMBER OF WORKING HOURS PER WEEK )AND NUMBER OF SHIFTS).
96    C
97          WRITE (1,90)
98    90    FORMAT(' ENTER PRODUCTION YEAR  NUMBER OF HOURS- (EFWSH)')
99          READ(5,*)EFWSH
100         UNLPH=NUNLPY/EFWSH
101         WRITE(6,100)UNLPH
102   100   FORMAT(' THE TOTAL NUMBER OF UNIT LOAD GOING THROUGH THE INDUSTRIAL
103        & BAY PER HOUR IS',35X,F6.2)
104         RETURN
105         END
106   C     THIS THE END OF PROGRAM 'EXVOLMH'
107   C...
108
109         SUBROUTINE NOWS
110   C     PROGRAM NUMBER OF WORK STATION NEEDED(NOWS)
111   C
112         WRITE(6,200)
113   200   FORMAT (' CALCULATE NUMBER OF WORK STATION NEEDED USING UNL')
114   C
115   C     THIS CALCULATION HAS AN ADVANTAGE FOR ANY FUTURE
115   C      CALCULATION BECAUSE
116   C     OF SPACES CONSIDERATION(PRODUCT SPACES ARE ALWAYS
117   C     CALCULATED FROM UNIT LOADS)
```

```
118   C
119   C      STEP 1-NUMBER OF STANDARD HOURS PER UNIT LOAD HAS TO BE CALCULATED
120   C
121          WRITE(6,210)
122   210    FORMAT(' PLEASE ENTER NUMBER OF STANDARD HOURS PER PART (SHPPTM)')
123          WRITE(6,220)
124   220    FORMAT(' PLEASE ENTER NUMBER OF PARTS PER UNIT LOAD(NPPUNL)')
125          READ(5,*)SHPPTM,NPPUNL
126          SHPUNL=SHPPTM*NPPUNL
127          WRITE(6,230)SHPUNL
128   230    FORMAT(' NUMBER OF STD HOURS PER UNIT LOAD(SHPUNL)IS',
129          &2X,F7.2)
130   C
131   C      STEP 2- NUMBER OF WORK STATION FOR THE PARTICULAR PRODUCTION
132   C      PROGRAMME IS CALCULATED (ON BASIS OF UNIT LOADS)
133   C
134          WRITE(6,240)
135   240    FORMAT(' PLEASE ENTER NUMBER OF UNIT LOADS PER HOUR(UNLPH)' )
136          READ(5,*)UNLPH
137          NOW=SHPUNL*UNLPH
138          WRITE(6,260)NOW
139   260    FORMAT(' THE NUMBER OF WORK STATIONS NEEDED IS' ,2X,F7.3)
140          RETURN
141          END
142   C...
143          SUBROUTINE MFAREA
144   C
145   C
146   C      PROGRAM FOR CALCULATION OF THEORETICAL MANUFACTURING AREA
147   C      (AREA FOR ALL WORK STATION MODULES REQUESTED...MANUFACTURING SPACE)
148   C      IN SQUARE METERS.
149   C
150          WRITE(6,300)
151   300    FORMAT(' CALCULATE THEORETICAL MANUFACTURING AREA IN SQ.METERS' )
152   C      THE AREA IS GIVING APPROXIMATE AREA NEEDED-FOR "STUDY" AND "PPOGRAMME"
153   C      AND INDICATE THE SIZE OF AN "ENDLESS STRAIGHT" INDUSTRIAL BAY
154   C
155          WRITE(6,310)
156   310    FORMAT(' PLEASE ENTER NUMBER OF WORK STATION SUGGESTED(NOWS)')
157          READ(5,*)NOWS
158          WRITE(6,320)
159   320    FORMAT('PLEASE ENTER AVERAGE AREA PER WORK STATION (WSAA)')
160   C      THE AVERAGE AREA PER WORK STATION HAS TO BE ESTIMATED ACCORDING
161   C\TO EXPERIENCE IN SIMILAR PRODUCTION AND WORKSHOP...OR INFORMATION
162   C      IS TAKEN FORM W.S.CARDS(MANUFACTURING MODULES)
163   C
164          READ(5,*)WSAA
165          MFARE=NOWS*WSAA
166          WRITE(6,330)MFARE
167   330    FORMAT(' MANUFACTURING AREA(MFAREA)IN SQ.METERS IS',3X,F7.2)
168          RETURN
169          END
170   C...
171          SUBROUTINE BAYLGH
172   C
173   C      This is"BAYLG"program for computation of a total length
174   C      of "CONTINUOUS" industrial bay.
175   C      Data :MFAREA is received from the program MFAREA
176   C             BAYWD  is determined width of bay according to following
177   C             quantitative requirements
```
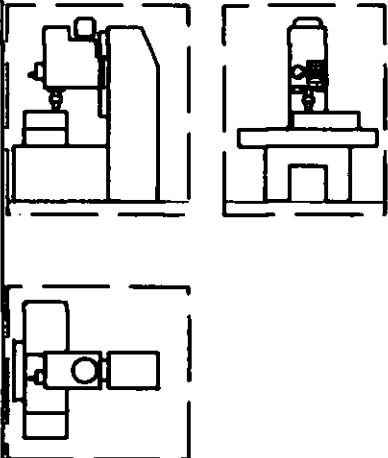
```
178   C              -size of Product
179   C              -size of an average Work Station
180   C            -size of Aisles-Material Handling areas
181   C              -system of Material Handling
182   C              and is usually 6,9,12,15,18,21,24, etc, meters
183   C
184          WRITE(6,400)
185   400    FORMAT(' Calculate Length of "Continuous"Industrial bay(BAYLG)')
186   C
187   C      The determination of sizes of the Bay is useful for graphical
188   C      design of Work Staion in position in the bay and for decision
189   C      regarding dimensions of the Industrial Hall(Plot needed).
190   C      Maximum length of a bay should not exceed length 198 m.
191   C
192          WRITE(6,410)
193   410    FORMAT(' Please enter the size of Manufacturing Area in Sq.m' )
194          READ(5,*)SFAREA
195          WRITE(6,420)
196   420    FORMAT(' Please enter dimension of bay width(BAYWD) in meters' )
197          READ(5,*)BAYWD
198          BAYLG=SFAREA/BAYWD
199          WRITE(6,430)BAYLG
200   430    FORMAT(' Total length of "Continuous" Bay(BAYLG)in m. is',3X,F7.2)
201          RETURN
202          END
203   C...
204   C...
205   C...  FILE UNDER THE NAME "X100.FOR"
```

APPENDIX III

D r a w i n g   No. 1.

Sheets 1 to 6

M/C NAME	M/C NO	CARD NO	POSITION	PAGE NO
GARRETT	17229248	18	CD(03-04)	001

01	CLASS NO. 17229248	07	MANUFACTURER: RICHARD GARRETT	
02	DESCRIPTION: NC DRILL	08	ORDER REF:	
03	COMPONENT-SUB-SYS.DIM/M PUNCHED CARD READER (0.76,0.63,1.45)	09	OTHER INFORMATION:	
04	STATIC LOAD/KN 14	10	DYNAMIC LOAD/KN	
05	TECHNOLOGICAL SPEC:	11	TEMPLATE FOR MSL001:	
06	REMARKS NO ANCHORING FOUNDATIONS			

M/C NAME	M/C NO	CARD NO	POSITION	PAGE NO
R.GARRETT	17229248	18	CD(03-04)	002

2800.0

1700

980.0

1600.0

3000

3000
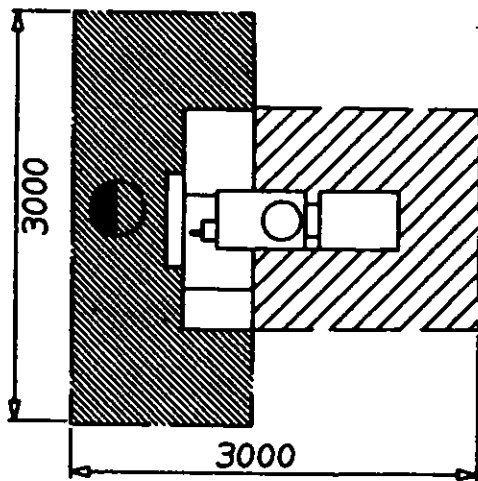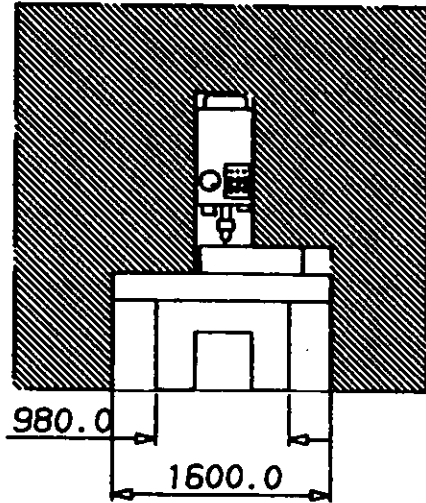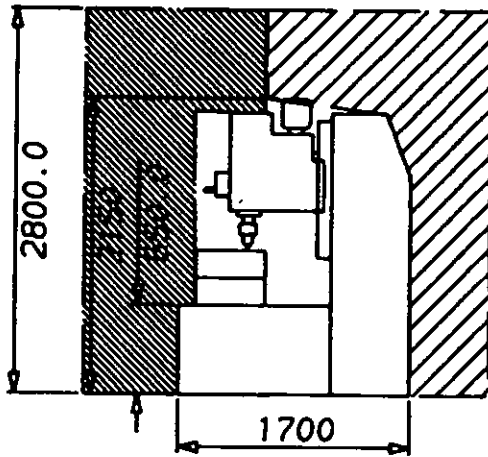
KEY:

▨ : MAINTENANCE SPACE

▧ : MAN SPACE

M/C NAME	M/C NO	CARD NO	POSITION	PAGE NO
R.GARRETT	17229248	18	CD(03-04)	003

SPECIFICATIONS.

A	MACHINE		
.01	Maximum workpiece dimensions (WxDxH)	mm	38
02	Maximum workpiece Weight	Kgs	
03	Front to back table travel	mm	370
04	Left to right table travel	mm	610
05	Vertical slide travel	mm	685
06	Table feed rate	mm/min	
07	Outside dimensions (WxDxH) /m		2.1x1.6x1.6
08	Weight	kgs	
09			
10			
11			

B	POWER SUPPLY.		
01	Output voltage (no load)	V	380
02	Maximum machine current		1.76
03	Machine control system		YES
04	Maximum input		
05	Outside dimensions (WxDxH)	mm	
06	Weight	Kgs	
07			
08			

C	DIELECTRIC FLUID SUPPLY.		
01	Dielectric fluid		COOLANT
02	Tank capacity	l	30
03	Filter element		YES
04	Outside dimensions (WxDxH) /a		0.5x0.3x0.2
05	Weight	Kgs	
06			

D	CONTROL	
01	Control axes	X,Y,Z
02	Interpolation	
03	Minimum command unit	
04	Table position display mm	
05	Block No. display	DIGITAL
06	Program capacity	NO
07	Input method	TAPE
08	Mirror image	YES
09	X Y axis change	YES
10	Single block feed	YES
11	Dry run	YES
12	Machine lock	YES
13	Backlash compensation	YES
14	Memory call	NO
15	Self diagnostic FCN	NO
16	Automatic positioning function	ON TAPE
17	Inch/mm display	NO
18	Outside dimensions (WxDxH) /m	0.7x0.6x1.4
19	Weight	Kgs
20		
21		

E	REMARKS
01	
02	
03	
04	
05	

M/C NAME	M/C NO	CARD NO	POSITION	PAGE NO
R.GARRETT	17229248	18	CD(03-04)	004

	MAINTANANCE CRETERIA	DAILY	WKLY	NTHLY	YRLY	REMARKS
A	MECHANICAL					
A1	CHECK & EXAMINE					PLACE X IN
01	BEARINGS				X	
02	DRIVE BELTS				X	APPROPRIATE
03	SAFETY DEVICES			X		
04	M/C CALIBRATION			X		TIME SCALE
05	TABLE ALIGNMENT			X		
06	MOUNTING BOLTS				X	NOTE:
07	HOSE & PIPES			X		
08						OVERHAULL
09						
A2	CLEAN & LUBRICATE					ONCE
01	MOVING PARTS	X				
02	MOVING SURFACES	X				EVERY YEAR
03						
04						
A3	REPLACE					
01	DRIVE BELTS				X	
02	BEARINGS				X	
03						
04						
05						
B	ELECTRICAL					
B1	CHECK & EXAMINE					
01	CONTACTORS			X		
02	AUTOMATIC CONTROLS			X		
03	FUSES			X		
04	BRUSHES			X		
05	CHARGE COILS			X		
06						
B2	CLEAN					
01	CONTACT POINTS			X		
02						
03	REPLACE					
04						
05						
C	HYDRAULIC					
C1	CHECK & EXAMINE					
01	OIL LEVEL		X			
02	OIL FILTERS		X			
03	PIPES & VESSELS			X		
04	PUMP BEARINGS				X	
05						
C2	CLEAN					
01	OIL FILTERS			X		
02						
C3	REPLACE					
01	OIL			X		
02	OIL FILTERS				X	
03						

M/C NAME	M/C NO	CARD NO	POSITION	PAGE NO
R.GARRETT	17229248	18	CD(03-04)	005

		A	B	C
		TYPE	CONSUMPTION /MONTH	QUALITY
001	OIL	SHELL VIERRA OIL 69	DEPENDS ON USAGE	GOOD
002	GREASE	ALVANIA GREASE NO.2	DEPENDS ON USAGE	GOOD
003	COOLANT	MINERAL OIL	DEPENDS ON USAGE	GOOD
004	HYD.OIL	/	/	/
005				
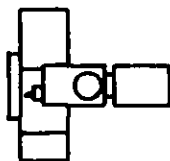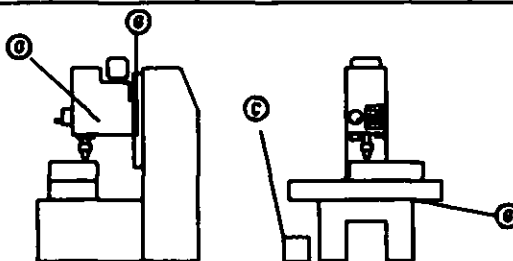
KEY:

Ⓞ : OIL

Ⓖ : GREASE

Ⓒ : COOLANT

M/C NAME	M/C NO.	CARD NO.	POSITION	PAGE NO.
R.GARRETT	17229248	18	CD(03-04)	006

INSTALATION DETAILS

A	MACHINE DETAILS			D	HANDLING REQUIREMENTS	
.01	MANUFACTURER		R.GARRETT	01	Crane Maximum Lift kg	
02	MACHINE TYPE		NC DRILL	02	Fork Lift Truck	
03	MACHINE MODEL		TD.251S	03	Others	
04				E	AUXILLIARIES	
05				01	Water	YES
				02	Power	YES
B	MACHINE DIMENSIONS			03	Lubricating Oil	YES
01	Height	mm	2.1	04	Coolant	YES
02	Width	mm	1.6	05	Gas	NO
03	Depth	mm	1.6	06	Waste Removal	YES
04	Weigth	kg	1100	F	OTHERS	
05	Loads	KN				
C	FLOOR REQUIREMENTS					
01	Type of Floor		CONCRETE			
02	Method of Fixing					

DRAWING OF FOUNDATION FLOOR

NO ANCHORING FOUNDATIONS

D r a w i n g   No. 2.

D r a w i n g   No. 3.
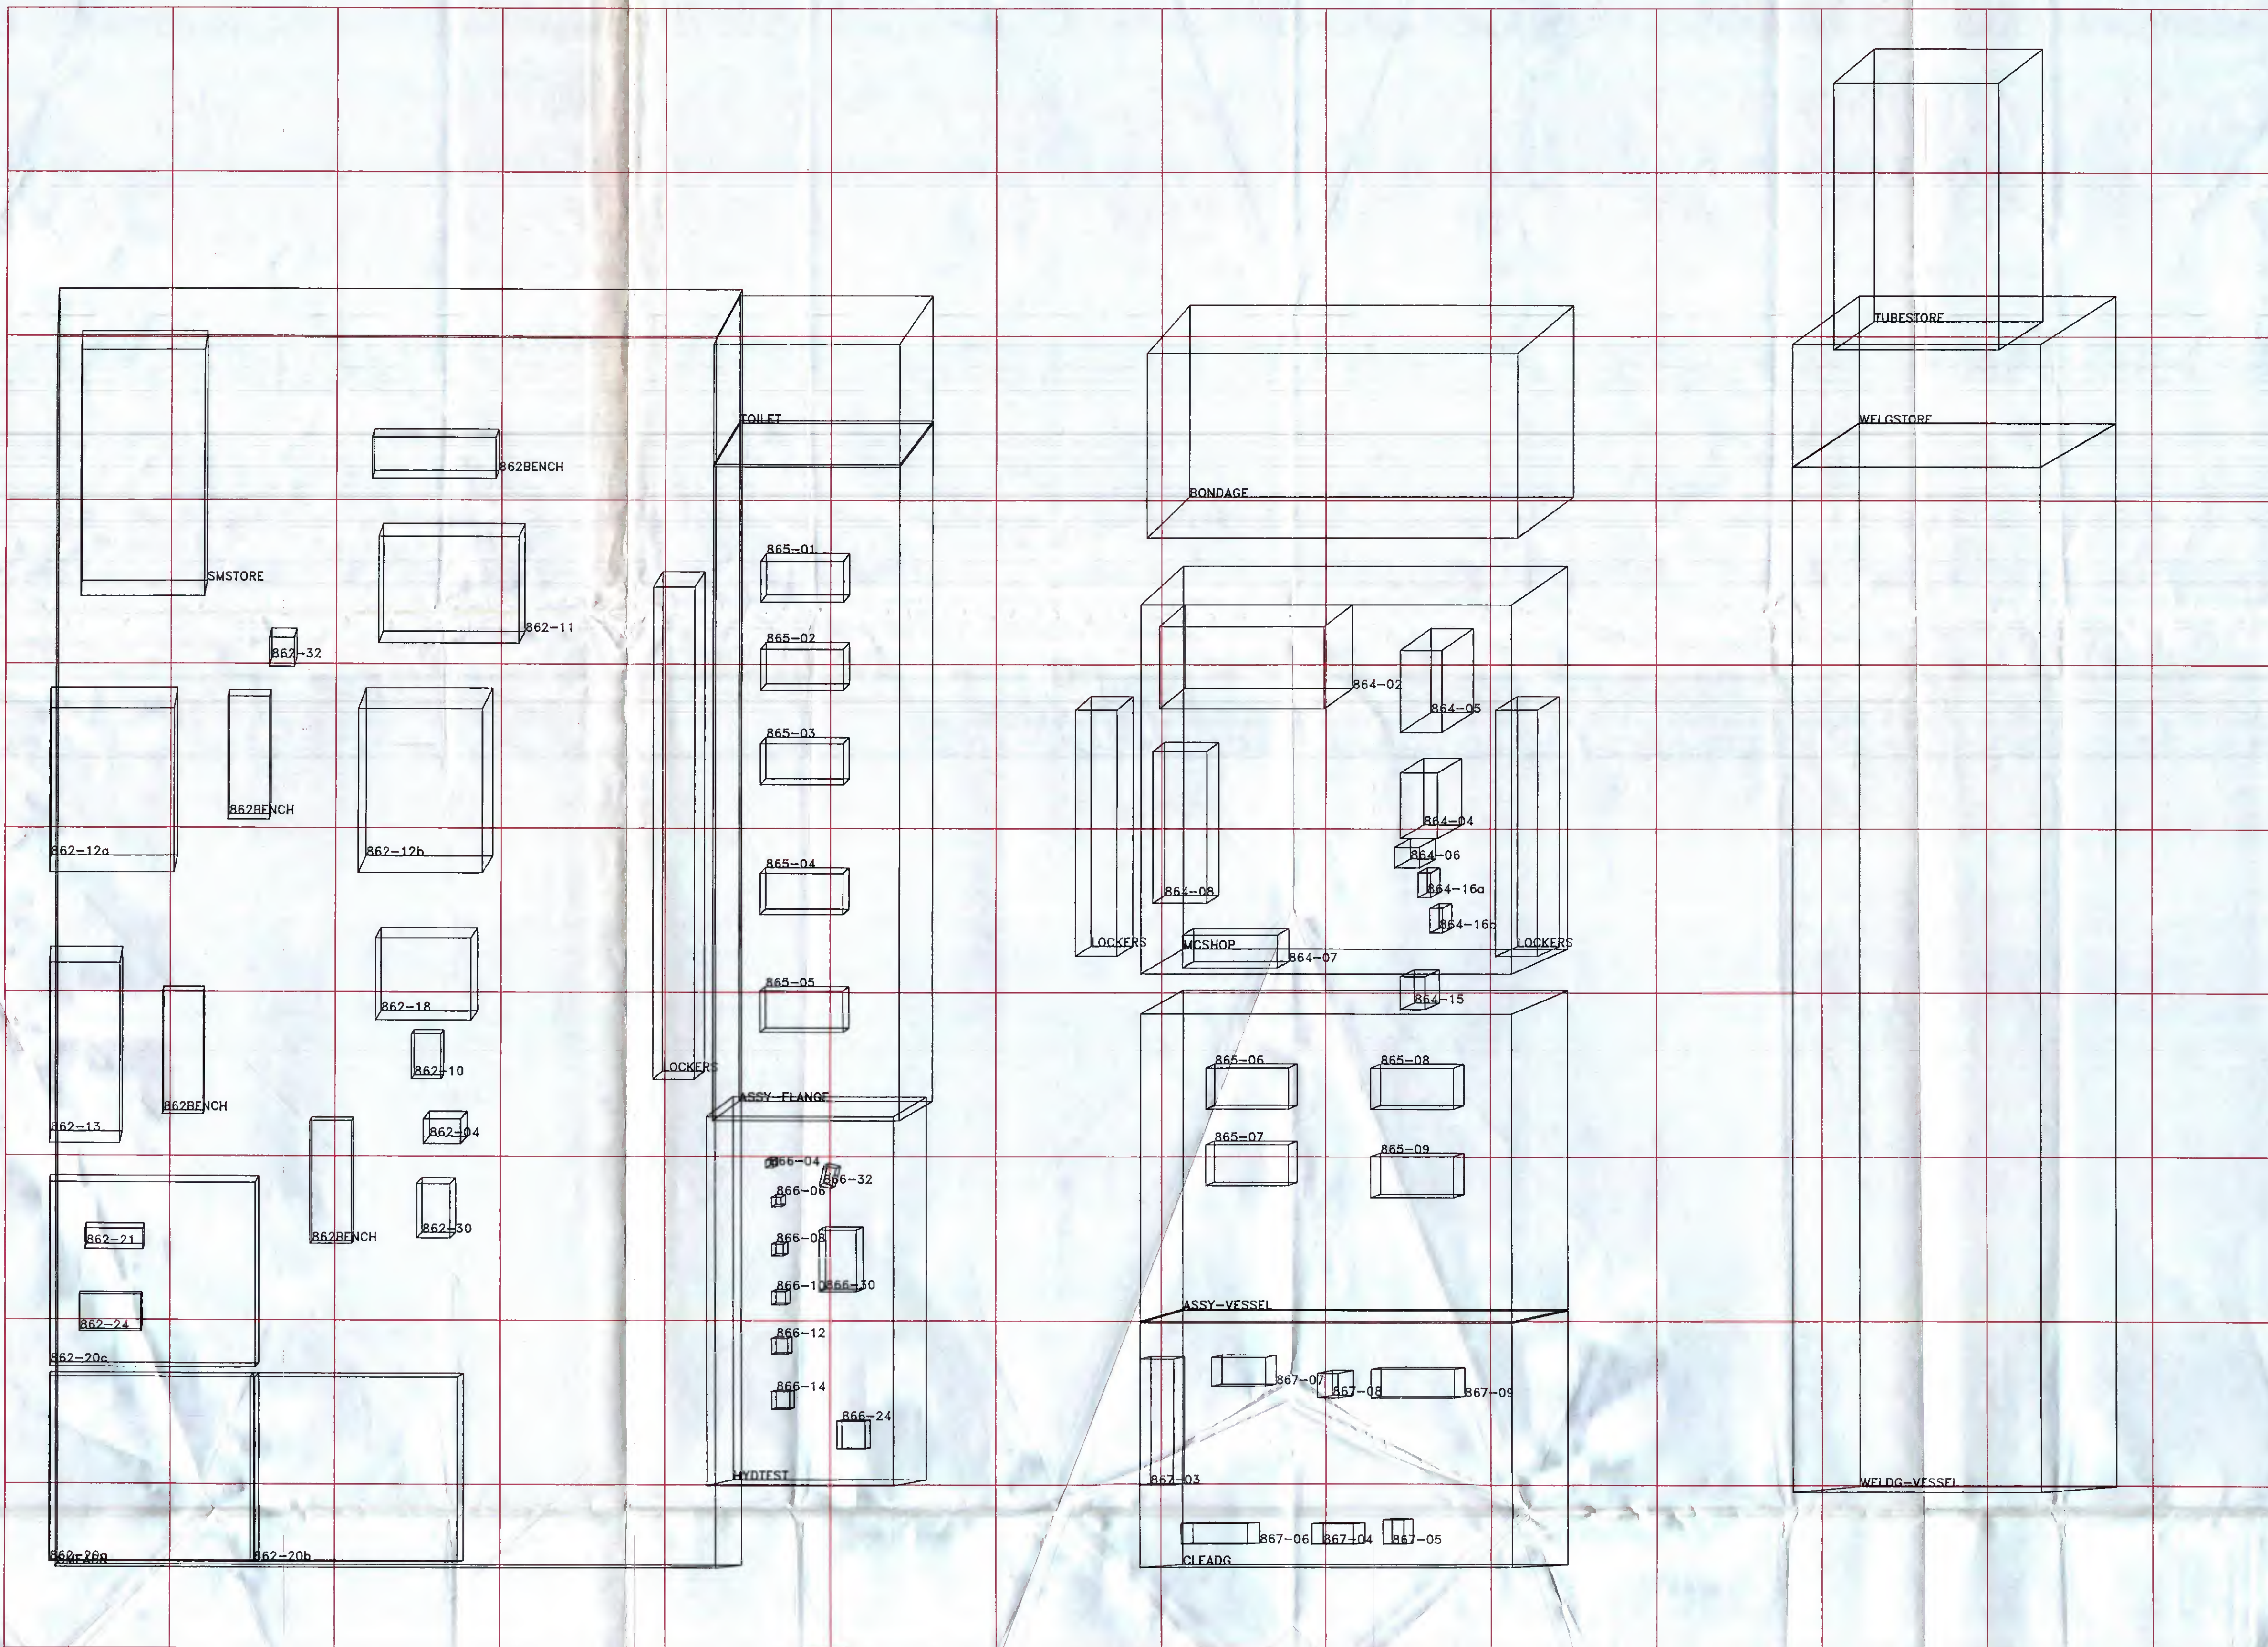
ELTRON (LONDON) LTD.

DETAIL LAYOUT II

TUBESTORE

WELGSTORE

TOILET

862BENCH

SMSTORE

BONDAGE

865-01

865-02

865-03

864-02

864-05

862-32

862-11

862BENCH

864-04

864-06

864-16a

862-12a

862-12b

865-04

LOCKERS

864-08

864-16b

LOCKERS

MCSHOP

864-07

862-18

865-05

864-15

862-10

LOCKERS

865-06

865-08

862-13

862BENCH

862-04

ASSY-FLANGE

865-07

865-09

862-21

862BENCH

862-30

866-04

866-32

866-06

ASSY-VESSEL

866-08

867-07

862-24

866-10

866-30

867-08

867-09

862-20c

866-12

867-03

862-20a

862-20b

866-14

866-24

WELDG-VESSEL

HYDTEST

867-06

867-04

867-05

CLEADG

ELTRON (LONDON) LTD.

DETAIL LAYOUT II